NBSIR 76-1058

Performance of Mobile Homes - Summary Report

J. H. Pielert W. E. Greene, Jr. L. F. Skoda W. G. Street

Office of Building Standards and Codes Services Center for Building Technology Institute for Applied Technology National Bureau of Standards Washington, D. C. 20234

April 1976

Final Report

Prepared for

Office of Policy Development and Research
Division of Energy, Building Technology and Standards
U.S. Department of Housing and Urban Development
Washington, D. C. 20410



PERFORMANCE OF MOBILE HOMES - SUMMARY REPORT

J. H. Pielert W. E. Greene, Jr. L. F. Skoda W. G. Street

Office of Building Standards and Codes Services Center for Building Technology Institute for Applied Technology National Bureau of Standards Washington, D. C. 20234

April 1976

Final Report

Prepared for
Office of Policy Development and Research
Division of Energy, Building Technology and Standards
U.S. Department of Housing and urban Development
Washington, D. C. 20410



U.S. DEPARTMENT OF COMMERCE, Elliot L. Richardson, Secretary

James A. Baker, III, Under Secretary
Dr. Betsy Ancker-Johnson, Assistant Secretary for Science and Technology
NATIONAL BUREAU OF STANDARDS, Ernest Ambler, Acting Director



Table of Contents

Paş	ge		
Abstract	ii		
SI Conversion Units is	ii		
1.0 Introduction	1		
1.1 Project Objectives and Approach 1.2 Summary Comments	1 2 2 2 3 3		
2.0 Mobile Home Performance Data	3		
2.1 Mobile Home Performance Data Acquisition 2.1.1 HUD Sample	3 3 4 4 4 5		
3.0 Evaluation of Problems Related to the ANSI Al19.1 Standard	6		
3.3 Heating Systems (Part D)	6 17 23 24		
4.0 Evaluation of Problems Related to the Mobile Home Enforcement Process	26		
4.2 Plumbing Systems	26 28 33 40		
5.0 Durability Related Problems	50		
6.0 Summary Comments and Recommendations	52		
References 5	55		
Acknowledgements 5	56		
Figures	57		
Tables 6	65		
Appendix A - Organization and Use of the Problem Summation Tables	89		
Appendix B - Problem Summation TablesHUD Sample			
Appendix C - Problem Summation TablesPrivate Sample			
Appendix D - Problem Summation TablesField Sample	25		

Performance of Mobile Homes-Summary Report

by

J. H. Pielert, W. E. Greene, Jr., L. F. Skoda and W. G. Street
Center for Building Technology

Abstract

This project was sponsored at the National Bureau of Standards by the Department of Housing and Urban Development, Office of Policy Development and Research, Division of Energy, Building Technology and Standards, with the objective of documenting mobile home performance problems and relating them to possible inadequacies in the ANSI Al19.1 Standard for Mobile Homes and the mobile home enforcement process. Additionally, the durability of mobile home components was a study objective for potential use in mortgage insurance evaluation. The mobile home performance data were obtained for 4,105 mobile homes, categorized and related to the project objectives. This summary report is the last of a series of four project reports. It documents the project approach, results of the various tasks, and presents conclusions and recommendations. This was a problem-oriented study and did not attempt to document the many areas of satisfactory mobile home performance.

Key Words: Computer Techniques; Construction; Enforcement Process; Housing; Hurricane Agnes; Mobile Homes; Mobile Home Parks; Performance Data; Regulatory Process; Standards

SI CONVERSION UNITS

In view of the present accepted practice in this country for building technology, common U.S. units of measurement have been used throughout this publication. In recognition of the position of the United States as a signatory to the General Conference on Weights and Measures, which gave official status to the metric SI system of units in 1960, appropriate conversion factors have been provided in the table below. The reader interested in making further use of the coherent system of SI units is referred to:

NBS SP330, 1972 Edition, "The International System of Units"

E380-72 ASTM Metric Practice Guide (American National Standard Z210.1)

Table of Conversion Factors to Metric (S.I.) Units

Physical Quantity	To Convert From	То	Multiply By
Length	inch foot	meter m	2.54* x 10 ⁻² 3.048* x 10 ⁻¹
Area	inch ² foot ²	m ² m ²	$6.4516* \times 10^{-4}$ 9.290×10^{-2}
Jolume	inch ³ foot	m3 m3	1.639×10^{-5} 2.832×10^{-2}
Temperature	Fahrenheit	Celsius	$c = (t_{\circ}F^{-32})/1.8$
Cemperature difference	Fahrenheit	Kelvin	$\Delta t^{\circ}K = (\Delta t_{\circ F})/1.8$
ressure	inch Hg (60°F)	newton/m ²	3.377×10^{3}
ass	1bm	kg	4.536×10^{-1}
lass/unit area	1bm/ft ²	kg/m^2	4.882
Moisture content rate	1bm/ft ² week	kg/m ² s	8.073×10^{-6}
Density	1bm/ft ³	kg/m ³	1.602 x 10 ¹
Thermal conductivity	Btu/hr ft ² (°F/in)	$\frac{W}{mK}$	1.442×10^{-1}
U-value	Btu/hr ft ² °F	$\frac{W}{m^2 K}$	5.678
Thermal resistance	°F/(Btu/hr ft ²)	$K/(W/m^2)$	1.761×10^{-1}
Heat Flow	Btu/hr ft ²	W/m^2	3.155

^{*}Exact value; others are rounded to fourth place.



1.0 INTRODUCTION

PROJECT OBJECTIVES AND APPROACH. Recently, many individuals and groups have questioned the effectiveness of mobile homes in providing safe, adequate and low-cost shelter. Although life-safety aspects such as fire safety and susceptiblity to wind damage receive the most publicity, functional characteristics appear to be of broader concern to mobile home owners. It is recognized that the mobile homes supply process (manufacturing, transportation, siting 1/) differs greatly from conventional site-built housing and is partly responsible for some of their unique performance problems. Unfortunately, there is a limited amount of organized documentation of these performance problems, making it difficult to pinpoint what aspect of the mobile home supply process may be in need of change or improvement.

To respond to this recognized deficiency of information, a project funded at the National Bureau of Standards (NBS) by the Office of Policy Development and Research of the Department of Housing and Urban Development (HUD) was structured around the following objectives:

- 1. Identification and documentation of significant mobile home performance problems.
- 2. Determine the relationship of these problems to provisions of the ANSI Al19.1 Standard for Mobile Homes $[1]^{2}$.
- 3. Determine the relationship of these problems to the mobile home enforcement process (plan review, design certification, plant inspection.)
- Relate problem data to the durability of mobile home components (mortgage insurance concern.)
- Identification of needed areas of research relative to the mobile home supply process.

The project scope and the unique data acquisition and analysis methodology developed to accomplish the objectives are presented in reference [2]. The project was organized into two principal tasks. Task I was designed to collect and analyze existing mobile home performance data relative to the structural, electrical, heating and plumbing systems. These data, presented in reference [3], were obtained from Federal and state agencies responsible for the regulation of mobile homes, consumer groups, and owner of mobile homes. Task II involved the field inspection of mobile homes to determine the causes and consequences of the performance problems found during Task I. The results of Task II are documented in reference [4].

This report summarizes the results of the project where the data obtained in Tasks I and II are synthesized to determine if a relationship exists between the identified problems, the ANSI Al19.1 Standard, and the mobile home enforcement process. The mobile home problems documented can be generally related to (1) malfunctioning components (structural, electrical, mechanical and plumbing) resulting in conditions affecting health and safety and adversely impacting on the longevity of the unit, (2) inadequate durability of components, and (3) poor design and construction practice. Routine maintenance concerns are also included but are tabulated separately.

This is a problem oriented study which does not reflect the many mobile home owners who are happy with the performance of their units. The number of mobile homes included is small when compared to the total number of mobile homes in use in the United States. While the results of this study may not be statistically applicable to mobile homes in general, it is believed that the problems documented are representative of those encountered with mobile homes in this country.

^{1/} Siting encompasses placement and leveling the mobile home on its foundation, installation, steps, skirting and connection of utilities.

^{2/} References are listed at end of paper.

1.2 SUMMARY COMMENTS. The data presented in this report and in references [2], [3] and [4] represent a significant base of information from which the project objectives can be addressed. While the study does include data on 4105 mobile homes, this number is small when compared to the total number of units now occupied in the United States. It is felt that the problems identified in the study are typical of mobile homes now in use; however, it is not intended that the data can be statistically extrapolated to the total mobile home population in the United States.

Problem data were separated into five different categories; (1) inadequacies or omissions in the ANSI Al19.1 Standard for Mobile Homes, (2) deficiencies in the mobile home enforcement process, (3) routine maintenance problems, (4) mechanical/electrical appliance problems, and (5) miscellaneous or undefined problems. Sections 3.0, 4.0 and 5.0 present detailed discussion of the various problems in these categories.

Problems in the ANSI Al19.1 category are organized within the construction, plumbing, heating and electrical systems. The major problem areas in the construction system were rain leaks, failure of interior paneling attachment, inadequate bottomboard durability, corrosion of exterior fasteners, and excessive metal roof membrance flexibility (roof rumble.) Plumbing problems included questionable quality of fixtures, loose fixture connections, watertightness of shower enclosures, and freezing of piping. Heating and electrical problems consisted of questionable location of furnace thermostat and inadequate fastening of electrical boxes.

The mobile home enforcement category included problems which indicated deficiencies in the mobile home regulatory process (plan and specification review, certification, and in-plant inspection). In the construction area, this included instances where thermal insulation in the walls and roof were found missing or improperly installed. Typical problems in the plumbing area included piping water leaks, inadequate grade (slope) of drain pipe, water heater relief valve drain problems, and corrosion of piping. Heating system problems included use of unlisted or inadequately installed components, inadequate accessibility of appliances, joints of supply and vent systems not airtight, inadequate separation of combustion air system, inadequate marking of appliances and improper flexible gas connector usage. Electrical problems included lack of durability and long-term performance of devices, improper location of receptacles and devices, inadequate number of branch circuits, and problems related to workmanship such as insufficient cable support, inadequate cable protection, etc.

Problems related to durability of mobile home components are discussed in Section 5.0 which includes most of the items in the Mechanical/Electrical Appliance category.

Many specific recommendations are made in the body of the report for revisions to the ANSI All9.1 Standard and improvements in the mobile home enforcement process. The following areas were identified for additional mobile home work.

- A. The effect of transportation and site set-up.
- B. The effect of wind forces both during transportation and on site.
- C. Durability of mobile home components.
- D. Application of the performance approach to the development of mobile home standards.
- E. Pre-occupancy inspection of mobile home after set-up.

1.3 OVERVIEW OF MOBILE HOMES

1.3.1 Mobile Home Industry. Mobile homes have risen to a position of importance in housing in the United States representing approximately one-fifth of all new housing starts in each of the past five years - 1970 through 1974 (Figure 1). Considering only the single family housing classification, mobile homes have provided 30 percent of the total during the same period (Figure 2). The production of mobile homes increased dramatically from 103,700 units in 1960 to 566,920 in 1973; however, consistent with trends in conventional housing, production fell to 329,300 units in 1974 (Figure 3). Mobile homes represented 94% of the houses produced in 1974 in the under \$20,000 new housing market as shown in Figure 4.

1.3.2 <u>Standards Development</u>. The mobile home industry is unique within the building industry in that there is a single model standard, ANSI Al19.1 Standard for Mobile Homes [1], which covers the major aspects of the mobile home building process; i.e., construction, plumbing, heating and electrical. Park considerations are included in ANSI Al19.3 Standard for Mobile Home Parks [5]. These standards are developed using the concensus process by ANSI Committee Al19 on Mobile Homes and Recreational Vehicles.

States that have legislated mobile home construction requirements have most frequently adopted ANSI A119.1 as a whole or have used it as a model upon which to base their standards. As of June 1, 1974, 45 States had adopted or were in the process of adopting ANSI A119.1 or portions thereof. An NBS publication by Cooke, Zelenka, and Tejuja [6] presents deviations various States have made in the ANSI A119.1 Standard when modifying it for use in their regulatory programs.

1.3.3 Enforcement Process. Enforcement of a mobile home standard is primarily the responsibility of the State in which the mobile home is manufactured and generally includes certification of the design by that State's regulatory agency and in-plant inspection to insure compliance to the approved design. Generally, when a mobile home is transported and sold in a State other than in which it was manufactured, standard compliance becomes the responsibility of the State in which it is sold and is subject to that State's regulatory process.

There are two basic enforcement programs which are used separately or in combination by the States. Some States set up mobile home agencies to enforce mobile home regulations while others utilize independent third-party organizations to perform such services in their behalf. A typical combination would be for the State to set up an in-house agency for plan certification while employing a third party to perform in-plant inspection. An NBS publication by Cooke, Tejuja, Dikkers and Zelenka [7] outlines the various programs in use by the 50 States as of early 1974.

2.0 MOBILE HOME PERFORMANCE DATA

- 2.1 MOBILE HOME PERFORMANCE DATA ACQUISITION. The three major mobile home performance data sources were: (1) data accumulated by HUD as a result of using mobile homes as temporary housing following Hurricane Agnes, (2) data collected from State regulatory agencies and federal sources, and (3) data resulting from the field inspection of Hurricane Agnes units, private sector units and units being used by other government agencies. These data bases are referred to as the HUD Sample, Private Sample and Field Sample.
- 2.1.1 <u>HUD Sample</u>. The Department of Housing and Urban Development purchased approximately 18,000 mobile homes that were used as temporary housing for victims of the Hurricane Agnes disaster which occurred in June 1972. The largest concentration of these mobile homes was in the Wilkes-Barre, Pennsylvania area and totaled approximately 12,500 units. The urgent need for mobile homes following the hurricane was such that units were purchased from manufacturers and dealers from as far away as Texas and Florida and shipped to Wilkes-Barre. In many instances, the exigencies of time precluded specifying that the mobile homes meet the requirements of standards such as ANSI Al19.1 or the code of the State in which the home was purchased.

A large maintenance operation was established in Wilkes-Barre to make the units ready for occupancy and to maintain the units when occupied. The maintenance crews also refurbished homes between occupancies or prior to shipment to storage sites around the country.

Data for approximately 10,000 of the 12,500 units were brought to NBS from Wilkes-Barre on loan from HUD. Since it was not possible to evaluate data for the entire 10,000 units, a method of selecting a representative sample without bias was devised by the Statistical Engineering Section of the NBS Institute for Basic Standards. The resulting HUD Sample consisted of 2,881 randomly selected units chosen without regard to performance problems or attributes such as manufacturer, size, etc. Maintenance and refurbishment data were accumulated for these units.

This sample is unique since all the units were manufactured at approximately the same time (1971-1972) and were put into use under emergency conditions. The temporary nature of the mobile home parks and private site placements created problems that would not have been encountered under normal circumstances. The conditions were further complicated by the fact that the occupants were living in mobile homes by necessity and not by choice. In general, the mobile homes were treated as rental units with the HUD Maintenance Staff being called upon to perform all maintenance services. The mobile home performance data in the HUD Sample reflects a wide range of problems from routine maintenance to major component failures.

2.1.2 Private Sample. Acquisition of performance data on mobile homes from sources other than HUD was established as a basic requirement of the project.

States with large mobile home populations were selected to gain access to a quantity of mobile home performance data in an efficient manner. These agencies regulating mobile homes varied widely from State-to-State and were attached to building code, consumer affairs, community development, labor and motor vehicle organizations, etc. In addition to the State organizations, Federal agencies such as the Veterans Administration and Department of Defense, mobile home owners' organizations, privately owned mobile home parks with rental units, and various consumer groups were contacted. There were no attempts made to interview private mobile home owners on an individual basis. After a preliminary review of performance data available around the country, data from 14 sources listed in Table 1 were selected for detailed evaluation. Problem files for a total of 967 mobile home units were obtained from these sources making up the Private Sample.

- 2.1.3 <u>Field Sample</u>. Since the degree of problem detail obtained in Task I varied considerably, the field inspection of mobile homes was necessary to determine specific causes and consequence of the identified performance problems. A total of 257 units were inspected in the Field Sample and included mainly those used by HUD for temporary housing following the Hurricane Agnes disaster in addition to a small number of units from the private sector.
- 2.2 MOBILE HOME PERFORMANCE DATA CHARACTERISTICS. An attempt was made to gather all identifying attributes possible for each mobile home included in the three samples. Tables 2 through 5 summarize the State of manufacture, the year of manufacture, unit width data, and agency certifying seals for the units in the total combined sample.

With regard to the performance problems identified in the study, four major categories listed below were established to classify the problems. An additional miscellaneous category was used to tabulate a small number of problems of an undefined nature.

- A. Problems Related to deficiencies and inadequacies of the ANSI All9.1 Standard for Mobile Homes
- B. Problems Related to Mobile Home Enforcement Process
- C. Routine Maintenance Problems
- D. Mechanical Electrical Appliance Problems
- E. Miscellaneous Problems

This categorization of problems permits documentation of all mobile home performance problems obtained from the data sources or observed during the field inspections. Computer techniques are used to organize the data into tables (See Appendix A). Computer printouts showing the performance problem distribution are in Appendix B (HUD Sample), Appendix C (Private Sample), and Appendix D (Field Sample). The problem distribution in these four major categories for all data samples in percent of total problems is summarized in Table 6.

Table 7 shows the rank ordered distribution of problems relative to the five categories for the Private Sample data. The rank ordered problem distribution within each of the four major categories are shown in Tables 8 through 11.

Table 12 shows the rank ordered distribution of problems relative to the five categories for the Field Sample data. The rank ordered problem distribution within each of the four

major categories are shown in Tables 13 through 16.

Table 17 shows the rank ordered distribution of problems relative to the five categories for the HUD Sample data. The rank ordered problem distribution within each of the four major categories are shown in Tables 18 through 21.

2.2.1 Problem Data Characteristics. Since each of the three data samples exhibit unique problem distributions, as seen in Tables 6 through 21, it is necessary to consider the characteristics of the data in each sample in evaluating the severity of the various problems.

Since the mobile homes in the HUD Sample were generally treated as rental units by the occupants, a large portion of the problems were routine maintenance in nature of the type that a home owner would normally repair on his own rather than seeking professional assistance.

Private Sample data generally consisted of consumer complaints and the resulting on-site inspection reports of enforcement officials. The data would tend to be of a more severe nature than the HUD Sample since the mobile home owner would generally not go to the enforcement agency for assistance with problems of a routine maintenance nature. Also, enforcement official inspections generally concentrated on problems associated with code violations and enforcement program inadequacies.

The inspection procedures used in accumulating the Field Sample data were structured to concentrate on problems related to Standard violations and enforcement program inadequacies. Since most of the mobile homes were unoccupied at the time of the inspections, problems with appliances of a routine maintenance nature were less prominent.

The various characteristics of the three data samples should be considered in evaluating the problems discussed in Sections 3.0, 4.0 and 5.0 of this report.

3.0 EVALUATION OF PROBLEMS RELATED TO THE ANSI ALIO, I STANDARD

3.1 CONSTRUCTION (PART B) - The following problems are taken from the data presented in Appendices B, C and D. The percentage of mobile homes in each sample which have the problem is tabulated along with the pertinent paragraphs of the 1974 and 1975 editions of the ANSI Al19.1 Standard for Mobile Homes (NFPA 501B-1973 and 1974 editions). A discussion of the problem is included with recommendations for changes in the Standard and other phases of the mobile home supply process where appropriate.

3.1.1 ROOF SYSTEM-RAIN LEAKS (RLWR) 3/

Sample	% of Mcbile Homes in Sample with Problem
HUD	17.4
Private	27.9
Field	40.1

Pertinent ANSI All9.1 References (1974 and 1975)4/

Principle No. 7. To provide against the entrance of water and winds at all joints, connections, and openings in exterior surfaces.

B7.1 Weather Resistance. Exterior covering shall be of moisture and weather resistive materials attached with corrosion resistant fasteners to resist wind and rain. Metal coverings shall be of corrosion resistant materials.

<u>Discussion</u> - Roof membrane rain leaks were generally evidenced by staining of ceiling panels. The leaks appeared to be caused by one or more of the following factors:

- a. Flexibility of the metal roofing membrane.
- b. Lack of effective sealants.
- c. Inadequate joint constructions in the metal roofing.
- d. Flashing procedures at roof penetrations.
- e. Ineffective joint design details of roof-exterior wall interface.

Other factors impacting the severity of this problem include transportation induced forces and deflections, and improper site set-up and leveling procedures. Also, the roof leak problem can be aggravated by persons walking on the roof for purposes of repair or maintenance which can affect the integrity of the roof membrane joints. The ANSI Al19.1 Standard states, in general performance terms, that the mobile home shall be moisture resistant. However, there is no way for enforcement officials to completely evaluate a mobile home design to determine the expected performance in this area.

 $[\]frac{3}{2}$ Symbol refers to computer code used to identify the problem (Appendices B, C and D).

^{4/} Excerpted and reprinted with permission from NFPA 501B, Standard for Mobile Homes, Copyright 1973 and 1974, National Fire Protection Association, Boston, Massachusetts.

Recommendations

- 1. A method of evaluation should be developed and included in the Standard if enforcement officials are to determine if the moisture resistant performance specified in B7.1 is provided by the manufacturer.
- Manufacturers should provide the mobile home owner with instructions for routine preventative maintenance of the roof. This could include coating of all roof membrane joints at specified intervals.
- 3. There should be provided at least a one-year warranty on roof leakage.
- 4. Inspection for rain leaks should be part of a pre-occupancy inspection program and the area of any leaks should be repaired before occupancy of the unit is authorized.

3.1.2 PARTITION WALLS AND SIDEWALLS - FAILURE OF ATTACHMENT OF INTERIOR PANELING TO WALL FRAMING (INSSI.)

The higher percentage of this problem in the Field Sample may have been due to the frequent occurrence of water leaks causing wood panel buckling.

Sample	% of Mobile Homes in Sample with Problem
HUD	15.2
Private	25.4
Field	38.1

Pertinent ANSI All9.1 References

1974

- B6.7 Interior Partition. Whenever an interior partition is designed to serve as a secondary structural member, it shall be constructed with adequate strength for the purpose intended.
- B6.10 <u>Design Load Deflections</u>. When a structural assembly is subjected to total design live loads, the deflection shall not exceed the following:

Floor L/240

Roof and Ceiling L/180 (see Appendix II)

Sidewalls L/180

Where L = the clear span between supports or two times the length of a cantilever.

1975

B6.7 Interior Walls. Interior walls shall be constructed with structural capacity adequate for the intended purpose and shall be capable of resisting a horizontal load of not less than five pounds per square foot.

B6.10 Design Load Deflection. When a structural assembly is subjected to total design live loads, the deflection for structural framing members shall not exceed the following:

Floor L/240

Roof and Ceiling L/180 (See Appendix, Part B)

Headers, Beams, Girders L/180 (Vertical Loads Only)

where L = the clear span between supports or two times the length of a cantilever.

Discussion - This problem represents a failure of the attachment of the wood wall paneling to wall framing. Field inspection revealed that paneling is often attached with smooth staples which appear to provide inadequate fastening strength. The use of adhesive attachment in conjunction with staples was seldom found in the field investigation, and when it was encountered, continuous glue lines between the paneling and studs were rarely observed. The use of 1/8 inch and 3/16 inch thickness interior wood paneling provides questionable flexural rigidity between wall studs. Field observations indicated that some of the paneling appeared susceptible to dimensional changes due to moisture which could account for the buckling observed in conjunction with rain leaks.

The structural function of interior wall paneling is to aid in resisting forces due to transportation, site set-up, wind, and occupancy. These data bring into question the adequacy of the wall construction in resisting these forces; especially since the ANSI All9.1 Standard does not provide specific design criteria for transportation and site set-up.

The ANSI All9.1 Standard does not adequately define performance criteria that would insure successful attachment of paneling to the framing members. The ANSI All9.1-1975 was improved to require interior walls to be designed for 5 psf horizontal load; however, the sidewall deflection limit of L/180 in the 1974 edition (B6.10) was deleted in 1975.

Recommendations

- B6.10 should be modified to again incorporate a deflection limit on walls subjected to design loads. Consideration should be given to reimposing the L/180 limit as in ANSI Al19.1-1974 or adopting L/240 as required in paragraph 601-lle of FHA Minimum Property Standards [8].
- The effects of wind loads and forces resulting from transportation and site set-up should be studied to develop additional design criteria for wall design.
- Adhesive bonding should be used with mechanical fasteners in attaching wood paneling to the wall framing.

3.1.3 EXTERIOR WALLS - RAIN LEAKS (EXWR)

The high occurence of window leaks (paragraph 3.1.5) and door leaks (paragraph 3.1.6) in the Private Sample should also be considered in evaluating these data.

Sample	% of Mobile Homes in Sample with Problem
HUD	15.9
Private	6.4
Field	14.4

Pertinent ANSI All9.1 Reference (1974 and 1975)

B7.1 Weather Resistance. Exterior covering shall be of moisture and weather resistive materials attached with corrosion resistant fasteners to resist wind and rain. Metal coverings shall be of corrosion resistant materials.

<u>Discussion</u> - Penetration of rain water is the predominate problem with exterior walls. These leaks occurred through the exterior siding and at windows, doors, and other penetrations. The rain leaks at windows and doors occurred at the juncture with the exterior wall. Rain leaks through windows and doors are discussed in paragraphs 3.1.5 and 3.1.6. The usual manufacturing procedure is to attach the siding material to the wall framing, cut out openings for windows and doors and install windows and doors over the exterior siding. Caulking must be used where the frame of these components mate with the siding in order to prevent rain water penetration.

Lack of effective sealing of joints in exterior walls can be caused by:

- Excessive distortion of the walls due to transportation and set-up. The resulting differential movement between the window/door frame and exterior wall covering can disturb the caulking seal applied in the factory.
- 2. Manufacturing procedures of installing window and door frames over exterior siding which is not good flashing practice.
- 3. Poor workmanship characterized by improper application of sealant, the omission of sealant in some areas around frames, etc.
- 4. Inferior caulking that becomes brittle and cracks in a relatively short time.

Recommendations

- 1. A water penetration test procedure should be established for exterior wall assemblies similar to that adopted for windows (MHMA Specification 1-71-Rev. 1973). The test should include simulation of the effects of transportation.
- 2. The use of sealants between components of wall assemblies should be required to meet one or more of the following Federal Specifications:

TT-S-00230

TT-S-001657

TT-S-001543A

TT-S-00227E

- 3. Paragraph B7.1 of ANSI Al19.1 should be revised as follows:
 - B7.1 Exterior covering <u>and component joints</u> shall be of moisture and weather resistive materials attached with corrosion resistant fasteners to resist wind and rain. Metal coverings shall be of corrosion resistant materials.
- 3.1.4 EXTERIOR WALL SYSTEM FAILURE OF ATTACHMENT OF EXTERIOR COVERING TO WALL FRAMING (EXSS1.)

Sample	% of Mobile Homes in Sample with Problem
HUD	6.9
Private	12.0
Field	17.1

Pertinent ANSI A119.1 Reference (1974 and 1975)

B6.6 Walls. The walls shall be of sufficient strength to withstand the load requirements as defined in 6.3.1, 6.3.2 and 6.4 of this Part, without exceeding the deflections as

specified in 6.10. The connections between the bearing walls, floor, and roof framework members shall be fabricated in such a manner as to provide support for the material used to enclose the mobile home and to provide for transfer of all lateral and vertical loads to the floor and chassis.

<u>Discussion</u> - Typical of these problems was pulling of the fastener head through the metal siding and loosening of the fasteners. These problems could be related to excessive vibration and racking during transportation and site set-up of the unit. Wind induced forces could also cause connection loosening and fastener pull through problems.

Recommendation - A research study should be initiated to investigate the acceleration forces and stresses induced by transportation and site set-up in mobile homes. A study of wind effects on exterior wall connections, over an extended period of time, should also be initiated. The results of these studies would form the basis for the development of more realistic design criteria for incorporation into the current Standard.

3.1.5 WINDOWS - RAIN LEAKS (WNWR)

Sample	% of Mobile Homes in Sample with Problem
HUD	2.7
Private	13.9
Field	3.9

Pertinent ANSI Al19.1 References

1974

- B7.1 <u>Weather Resistance</u>. Exterior covering shall be of moisture and weather resistive materials attached with corrosion resistant fasteners to resist wind and rain. Metal coverings shall be of corrosion resistant materials.
- B8.5.1 Windows. All windows shall comply with requirements set forth in Table B-2 and, in addition, shall meet the reqirements for windows as detailed in the "Window Specifications for Utilization in Mobile and Factory-Built Homes (MHMA Spec. No. 1-71 Rev. 1972).

1975

- B7.1 Same as 1974.
- B8.5.1 <u>Windows</u>. All windows shall meet the requirements for windows as detailed in the Window Specifications for Utilization in Mobile and Factory-Built Housing, (MHMA Spec. No. 1-71-Rev. 1973).

<u>Discussion</u> - These problems are concerned with the penetration of rain water through windows. Rain leaks at the juncture of the window frame and the wall are discussed in 3.1.3. The referenced Mobile Home Manufacturers Association (MHMA) Spec No. 1-71 includes a wind-driven rain test which appears adequate in evaluating window performance. This specification was first included in the 1973 edition of ANSI Al19.1. A large majority of the mobile homes in this study were 1972 models, or older, and may have used windows which did not meet the MHMA Specification.

Recommendation - Use of windows which meet the latest revision of MHMA Spec. No. 1-71 may alleviate the rain leak problem.

3.1.6 EXTERIOR DOORS - RAIN LEAKS (DEWR)

Sample	% of Mobile Homes in Sample with Problem
HUD	3.2
Private	13.0
Field	3.1

Pertinent ANSI Al19.1 Reference (1974 and 1975)

B7.1 Weather Resistance. Exterior covering shall be of moisture and weather resistive materials attached with corrosion resistant fasteners to resist wind and rain. Metal coverings shall be of corrosion resistant materials.

<u>Discussion</u> - This problem concerns the penetration of rain water through exterior doors. Rain leaks at the juncture of the door frame and the exterior wall are discussed in 3.1.3. ANSI Al19.1-1975 does not include a wind-driven rain test for exterior doors. MHMA Spec. 3-74 "Exterior Passage Door Specifications for Utilization in Mobile and Factory Built Housing" is weak in the area of water penetration as indicated by the following from paragraph 1.4.4:

"No leakage shall pass interior face of the test specimen at a test pressure of 9 psf when tested in accordance with ASTM E-331. Note: The development of this standard was primarily instituted to answer energy conservation requirements. Insufficient time to establish further water penetration criteria was allowed; therefore, the MHMA Door Subcommittee is presently effecting further testing and criteria for revision to this standard at a later date."

Recommendation - MHMA Spec. 3-74 appears to be a step in the right direction. Work on the development of additional water penetration criteria to augment this specification should be undertaken.

3.1.7 FLOOR SYSTEM - INADEQUATE BOTTOMBOARD WEATHER AND RODENT RESISTANCE (FLWR, FLRR, PREQ5., HGPG1.)

blems*	Sample
	HUD Private
	Private Field

*Table represents a summation of problems in the Construction, Plumbing and Heating Parts of All9.1 relative to bottomboard durability.

Pertinent ANSI Al19.1 References (1974 and 1975)

- B7.1 Weather Resistance. Exterior covering shall be of moisture and weather resistive materials attached with corrosion resistant fasteners to resist wind and rain. Metal coverings shall be of corrosion resistant materials.
- B7.4 Rodent Resistance. Exterior surfaces shall be sealed to resist the entrance of rodents.
- C5.2.5 Rodent Resistance. All exterior openings around piping and equipment shall be sealed to resist the entrance of rodents.
- D5.1.1.1 Rodent Resistance. All exterior openings around piping, ducts, plenums or vents shall be sealed to resist the entrance of rodents.

<u>Discussion</u> - The problems grouped in this category concern penetrations in the bottomboard material (underside covering material) which affects the weather and rodent resistance of the mobile home. As illustrated in the referenced paragraphs of the ANSI Al19.1 Standard, Part B (Construction), Part C (Plumbing) and Part D (Heating) contain essentially the same requirement against rodent penetration. A summation of these problems for the three samples represents 7.2% of all ANSI Al19.1 related problems.

The failure of the bottomboard barrier could lead to penetration of the underside of the home by wind, rain, rodents, insects and dust. The low tear and puncture strength characteristics of most bottomboard materials presently being used allows them to be easily damaged. In many

cases, the attachment of the bottomboard material to the main floor frame failed, possibly as a result of low "wet strength" or due to forces imposed during transportation and site set-up.

The referenced ANSI Al19.1 Standard paragraphs give the required performance of the bottom-board in general terms without specifying methods for enforcement officials to determine if the performance of a material is acceptable. This problem can be attributed to the Standard which does not provide specific performance requirements for the strength and durability of the bottomboard along with methods to evaluate the adequacy of the barrier.

Recommendations

- 1. The bottomboard construction of mobile homes should be upgraded.
- Performance requirements for mobile home bottomboard materials and attachment methods should be developed and incorporated in the ANSI All9.1 Standard. These requirements should include tear resistance, puncture resistance, wet strength and water penetration resistance.

3.1.8 EXTERIOR WALLS - CORROSION OF EXTERIOR FASTENERS (EXDR)

Exterior fasteners were routinely inspected in the Field Sample Survey. Mobile home occupants (HUD and Private Samples) did not generally consider this a major problem.

Sample	% of Mobile Homes in Sample with Problem
HUD Private Field	 1.3 49.4

Pertinent ANSI All9.1 Reference (1974 and 1975)

B7.1 Weather Resistance. Exterior covering shall be of moisture and weather resistive materials attached with corrosion resistant fasteners to resist wind and rain. Metal coverings shall be of corrosion resistant materials.

<u>Discussion</u> - In many cases, corrosion of exterior fasteners were noted on mobile homes less than two years old. While this initially may be only an aesthetic problem, it could eventually lead to a loss of the structural attachment of the exterior covering. The ANSI A119.1 Standard specifies "corrosion resistant fasteners;" however, it gives no level of performance for enforcement officials to evaluate the adequacy of a proposed fastener.

Recommendations

- 1. The ANSI Al19.1 Standard should include performance specifications that would insure long-term durability of exterior fasteners.
- The specification should be such that hot-dip galvanized, electro-galvanized, aluminized steel, stainless steel, double cadmium plated, aluminum screws, or any other corrosion-resistant fastener type could be considered for use by the manufacturers.

3.1.9 ROOF SYSTEM - FAILURE OF ATTACHMENT OF CEILING MATERIAL TO TRUSS (RFSS4.)

Sample	% of Mobile Homes in Sample with Problem
HUD	0.1
Private Field	6.3
11610	

Pertinent ANSI Al19.1 References (1974 and 1975)

Principle No. 3. To provide structural strength and rigidity sufficient for design loads, both in transit and on site.

B5.3 Structural Analysis. The strength and rigidity of the component parts and/or the integrated structure shall be determined by engineering analysis or by suitable load tests to simulate the actual loads and conditions of application that occur on site.

<u>Discussion</u> - The loss of attachment between ceiling material and roof trusses occurred almost totally in the Private Sample. This problem can be related to transportation forces, site set-up and occupancy. Another contributing factor would be the excessive occurrence of roof rain leaks and the resulting water damage to ceiling material which generally exhibits a lack of wet strength. Except for the referenced paragraphs which call for good engineering design, ANSI Al19.1 does not give specific design criteria for the attachment.

Recommendations

- 1. The susceptibility of mobile home roofs to rain leaks should be reduced which would help alleviate the incidence of ceiling material attachment failure.
- Results from a study of the effects of transportation and site set-up on mobile homes could be used to develop design criteria for the ceiling system.

3.1.10 ROOF SYSTEM - EXCESSIVE METAL MEMBRANE DEFLECTION AND ROOF RUMBLE (RDEF)

As expected, these data are predominantly in the Private Sample where mobile home owners were unhappy with the excessive noise. The HUD Sample units were occupied on a temporary basis while the majority of the Field Sample units were unoccupied.

Sample	% of Mobile Homes in Sample with Problem
HUD	
Private	4.7
Field	0.4

Pertinent ANSI All9.1 References (1974 and 1975)

Principal No. 3. To provide structural strength and rigidity sufficient for design loads, both in transit and on site.

B5.3. Structural Analysis. The strength and rigidity of the component parts and/or the integrated structure shall be determined by engineering analysis or by suitable load tests to simulate the actual loads and conditions of application that occur on site.

Discussion - This problem primarily consisted of excessive noise or "roof rumble" during windy weather conditions. The basic cause of the problem is the lack of rigidity of the metal roof membrane. Typical roof construction consists of a sheet metal installed over the wood trusses attached only around the outside perimeter edges of the mobile home. This method of attachment allows deflection of the roof membrane between trusses under the oscillating wind conditions. A sheathing material and/or insulation is sometimes placed between the metal membrane and the roof trusses. Roof rumble occurs when the metal roofing "slaps" against the roof trusses or sheathing material or the metal itself "oil cans" under wind loading. While walking on the roof is not recommended, it may be necessary to do so when performing routine maintenance. This could damage the metal membrane because of its lack of rigidity between roof trusses.

Recommendations

- Establish criteria to limit the deflection of metal roofing membrane between trusses.
 This would impart rigidity to the membrane and greatly reduce the occurrence of "roof rumble."
- 2. The manufacturer should alert the mobile home owner to the fact that "roof rumble" may occur and caution against walking on the roof.

3.1.11 FLOOR SYSTEM - FAILURE OF ATTACHMENT OF DECKING TO FLOOR JOISTS (FASS1.)

Sample	% of Mobile Homes in Sample with Problem
HUD Private	0.1
Field	

Pertinent ANSI Al19.1 References

1974

B6.9 Floors. Floor assemblies shall be designed in accordance with accepted engineering practice to support a uniform live load of 40 lb/ft2, plus the dead load of the materials. In addition (but not simultaneously), floors shall be able to support a 200-pound concentrated load on a 2-inch diameter disc at the most critical location with a maximum deflection not to exceed 1/8 inch relative to floor framing.

1975

B6.9 Floors

(a) Floor assemblies shall be designed in accordance with accepted engineering practice standards to support a minumum uniform live load of 40 lb/ft2 plus the dead load of the materials. In addition (but not simultaneously), floors shall be able to support a 200-pound concentrated load on a two-inch diameter disc at the most critical location with the maximum deflection not to exceed 1/8 inch relative to floor framing. Perimeter joists of more than six inches depth shall be stabilized against overlurning from superimposed loads as follows: at ends by solid blocking not less than two-inch thickness by full depth of joists, or by connecting to a continuous header not less than two inch thickness and not less than the depth of the joist with connecting device; at eight feet maximum intermediate spacing by solid blocking or by wood cross-bridging of not less thean one inch by three inches, metal cross-bridging of equal strength, or by other approved methods.

(b) Wood floors or subfloors in kitchens, bathrooms (including toilet compartments), laundry rooms, water heater compartments, and any other areas subject to excessive moisture shall be moisture resistant or shall be made moisture resistant by sealing or by an overlay of nonabsorbent material applied with water-resistant adhesive.

<u>Discussion</u> - This problem is concerned with inadequate attachment of the decking to the floor joists. Attachment is generally by staples or nails and adhesive bonding. The fasteners often pull through particle board floor decking commonly used in mobile homes, especially if it should become water soaked from plumbing or rain leaks. The requirements as presented for floors in the referenced ANSI Al19.1 Standard paragraphs are consistent with most codes and standards that exist for conventional housing. However, conventional housing is not subject to the dynamic forces of transportation and site set-up that are imposed on mobile homes. Therefore, consideration for these special conditions should be made during the design process. As presently written, the Standard does not provide design criteria for these special load conditions.

Recommendations

- 1. Develop design criteria for floors which take into account the effects of transportation and site set-up. This could result from a program to determine the magnitude of dynamic forces to which mobile homes are subjected during transit and set-up.
- 2. A performance criteria should be developed using these measured dynamic loads to assure adequate attachment strength for floor decking to floor joists.
- 3. A test procedure could be developed and specified so that regulating agencies can evaluate compliance with the criteria.

3.1.12 DOUBLEWIDE MISALIGNMENT (RFSS5.)

There were no doublewide units in the HUD and Field Sample Data.

Sample	% of Mobile Homes in Sample with Problem
HUD Private Field	2.9

Pertinent ANSI All9.1 Reference (1974 and 1975)

<u>Principle No. 7 (Part B)</u>. To provide against the entrance of water and wind at all joints, connections, and openings in exterior surfaces.

<u>Discussion</u> - Misalignment of the two sections forming a doublewide mobile home generally resulted in a rain water leak.

This problem can be attributed primarily to two causes: (1) failure of the manufacturer to hold dimensional tolerances during the fabrication phase, and (2) improper leveling and blocking of the two halves during site set-up. Except for general requirements of Principle No. 7, the ANSI Al19.1 Standard does not include guidance for dimensional tolerance requirements to be used by the manufacturer in the production of doublewide units. ANSI Al19.3 Standard for Mobile Home Parks [5] does not include dimensional tolerance requirements for mobile home set-up.

Recommendations

- 1. The ANSI Al19.1 Standard should include a section on dimensional tolerances of mobile home construction with particular attention given to doublewide units.
- A mobile home installation guide should be supplied with each mobile home by the manufacturer.
- 3. The ANSI Al19 Committee on Mobile Homes should undertake further study of the installation problems.

Note: In response to this need, ANSI Committee Al19 has established a new Sectional Committee on Mobile Home Installation with the following scope, "to develop standards or recommend practices for the proper placement of mobile homes on any lot, covering such items as piers, skirting, removal of running gear and any additional provisions for tiedowns and connections to utilities not covered in either the ANSI Al19.1 Standard for Mobile Homes or the ANSI Al19.3 Standard for Mobile Home Parks." The successful completion of this effort should help alleviate this problem with doublewides which are providing an ever increasing share of the mobile home market.

3.1.13 ROOF SYSTEM - CUTTING STRUCTURAL ROOF COMPONENTS TO ALLOW FOR INSTALLATION OF VENT PIPES OR STACKS (RLCC)

Where possible, roof trusses over the furnace were inspected in the field study. The mobile home occupant would not generally know of this problem as evidenced by the low frequency of occurrence in the HUD and Private Samples.

Sample	% of Mobile Homes in Sample with Problem
HUD Private Field	0.3 1.9

Pertinent ANSI Al19.1 References (1974 and 1975)

- B5.2 <u>Construction</u>. All construction methods shall be in conformance with accepted engineering practices to insure durable, livable, and safe housing. Exposed metal structural members shall be protected to resist corrosion.
- B5.3 <u>Structural Analysis</u>. The strength and rigidity of the component parts and/or the integrated structure shall be determined by engineering analysis or by suitable load tests to simulate the actual loads and conditions of application that occur on site.

<u>Discussion</u> - This problem was observed over furnace compartments where roof trusses were cut to allow for installation of roof jacks. Even though there were a small number of instances, it is serious enough to warrant a revision in the Standard. The basic cause of this problem was a result of poor design of the mobile home and/or inadequate plant inspection. Although the referenced ANSI All9.1 paragraphs cover this type of violation in a general sense, it is believed that there should be specific wording in the Standard that would prevent the cutting of major structural roof components without justification by engineering analysis.

Recommendation - Add the following requirement to ANSI Al19.1:

"Cutting of roof truss components for passage of electrical, plumbing or mechanical systems are not permitted without justification by engineering analysis."

3.1.14 TIEDOWNS - IMPROPERLY LOCATED BETWEEN ROOF TRUSSES (TIDN2.)

Inspection for this problem was possible only in the field inspection study.

Sample	% of Mobile Homes in Sample with Problem
HUD Private Field	1.0

Pertinent ANSI Al19.1 Reference (1974 and 1975)

B6.5.1 Tiedowns. All mobile homes shall have tiedowns with provisions for distributing the load of these tiedowns and provisions for the attachment to ground anchors so as to resist wind overturning and sliding as imposed by the respective design loads of this part.

<u>Discussion</u> - It was noted in the field inspection task that over-the-roof hurricane straps were sometimes located between roof trusses and not at a truss where a path of load transfer from wall to wall is provided.

ANSI Al19.1-1975 does not specifically address this point other than calling for good design. The proposed Tentative Interim Admendment (TIA) on Windstorm Protection for the ANSI Al19.1 Standard has the following requirement:

"6.6.1.2(c) When continuous straps are provided as vertical ties, such ties shall by positioned at rafters and studs."

Recommendation - Adoption of Windstorm Protection TIA should alleviate this problem.

3.2 <u>PLUMBING SYSTEMS (PART C)</u> - The following problems are taken from the data presented in Appendices B, C and D. The percentage of mobile homes in each sample with the problem is tabulated along with the pertinent paragraphs of the 1974 and 1975 editions of the ANSI Al19.1 Standard for Mobile Homes (NFPA 501B-1973 and 1974 editions). A discussion of the problem is included with recommendations for changes in the Standard and other phases of the mobile home supply process where appropriate.

3.2.1 QUALITY OF FIXTURES - DURABILITY OF FAUCET ASSEMBLIES (PFGR1.)

Sample	% of Mobile Homes in Sample with Problem
HUD	15.6
Private	11.1
Field	13.6

Pertinent ANSI All9.1 References

1974

C6.1 Minimum Standards. Materials, fixtures, or devises used or entering into the construction of plumbing systems in any mobile home shall be free from defects and shall conform to approved standards or the applicable standards listed in the Appendix of this Part, Table C-1.

1975

C6.1 Minimum Standards. Materials, fixtures, or devices used or entering into the construction of plumbing systems in any mobile home shall be free from defects and shall conform to approved standards.

Note: See Appendix for Reference Table for Standards on Plumbing System Components.

<u>Discussion</u> - The majority of these problems concerned early faucet failures requiring replacement. The replacement of faucet washers (routine maintenance) is not included in these data. The ANSI All9.1 Standard is deficient with regards to specifying a minimum quality of faucet; therefore, a large percentage of faucet assemblies did not perform adequately.

Recommendations

- 1. The ANSI All9.1 Standard should include performance criteria on faucet assemblies that would insure the owner of some useful life (in years).
- The Appendix to Part C of ANSI Al19.1 should include acceptable durability standards for faucet assemblies.
- A requirement for permanently marking the faucet assemblies with the manufacturers' name and model number should be adopted to enable enforcement officials to check for compliance.
- 3.2.2 TOILET FLUSHING DEVICES REPAIR OR REPLACEMENT OF TOILET FLUSHING DEVICES (TØIL2.)

Sample	% of Mobile Homes in Sample with Problem
HUD Private Field	5.9 5.6 5.4

Pertinent ANSI All9.1 Reference (1974 and 1975)

C9.2.1.2 Toilet flushing devices shall be designed to replace the water seal in the bowl after each operation. Flush valves, flushometer valves, and ball cocks shall operate automatically to shut off at the end of each flush or when the tank is filled to operating capacity.

<u>Discussion</u> - The general quality of toilet assemblies installed by mobile home manufacturers appears to be equivalent to those used in conventional housing. When the effects of transportation are considered, however, these data indicate that the toilet flushing device may not be adequate for the forces and vibrations encountered.

Recommendations

- The effect of transport induced forces on plumbing fixtures including toilet flushing devices should be examined in an overall study of transportation induced forces on mobile homes.
- 2. From these studies, performance criteria could be developed for plumbing fixtures (including toilet flushing devices) that would insure the owner of the mobile home reduced maintenance costs and extended life for these devices.

3.2.3 TOILET - LOOSE TOILET TO FLOOR CONNECTIONS (TØIL5.)

Sample	% of Mobile Homes in Sample with Problem
HUD	4.1
Private	8.2
Field	9.3

Pertinent ANSI Al19.1 References

1974

C9.2.1.5 Floor Connection. Toilets shall be securely bolted to the floor by means of an approved flange or other approved fitting. Bolts and screws, when used, shall be of solid brass or other corrosive-resistant material and shall be not less than 1/4 inch in diameter. A watertight seal shall be made between the toilet and flange or other approved fitting by use of a gasket or sealing compound.

1975

C9.2.1.5 Floor Connection. Toilets shall be securely bolted to an approved flange or other approved fitting which is secured to the floor by means of corrosion-resistant plated screws. The bolts shall be of solid brass or other corrosion-resistant material and shall be not less than 1/4 inch in diameter. A watertight seal shall be made between the toilet and flange or other approved fitting by use of a gasket or sealing compound. (See also Paragraph 6.9(b) of Part B.)

<u>Discussion</u> - This problem concerns the connection of the toilet assembly to the floor of the mobile home. The toilets frequently become loose and require tightening or seal replacement. In some cases, this looseness resulted in waste water leakage (which can cause deterioration of the bathroom floor) and the release of sewer gases and odors into the home. Since toilets are normally tightened down on the seal in the factory, it is likely that the vibrations due to transportation and set-up account for the loosening of many connections. This toilet connection method is the same as that used in conventional housing; however, mobile homes are subjected to these additional transit induced forces which do not appear to be adequately taken into consideration during the design and fabrication process.

Recommendations

- 1. The effect of transport induced forces on the floor connection of the toilet should be included in an overall study of transportation forces on mobile homes.
- 2. The feasibility of transporting the mobile home with the toilet loose and temporarily shimmed to be tightened after set-up should be considered.
- 3. Tightening of all plumbing fixtures should be part of a pre-occupancy inspection.
- 4. The following clarifying statement should be added to the Standard:

"Attachment to Structure. Plumbing fixtures shall be securely attached to the mobile home to resist transportation, set-up and normal use forces. Piping shall not be used to support the weight of the fixtures."

3.2.4 WATERTIGHTNESS OF TUB/SHOWER ENCLOSURES - WATER LEAKAGE AT JOINTS OF SHOWER ENCLOSURES (SHRR3.)

This problem could not readily be evaluated in the field study since unoccupied mobile homes were generally inspected.

Sample	% of Mobile Homes in Sample with Problem
HUD	1.7
Private	13.8
Field	2.3

Pertinent ANSI Al19.1 Reference

1974

C9.2.2.1 - Each shower stall shall be provided with an approved watertight receptor with sides and back extending 1 inch above the finished dam or threshold. In no case shall the depth of a shower receptor be less than 2 inches or more than 9 inches measured from the top of the finished dam or threshold to the top of the drain. The wall area in shower compartments shall be constructed of smooth, noncorrosive, and nonabsorbent waterproof materials to a height not less than 6 feet above the floor level. Such walls shall form a watertight joint with each other and with the receptor or shower floor. The floor shall slope uniformly to the drain at not less than one-fourth nor more than one-half inch per foot.

1975

C9.2.2.1 - Each compartment stall shall be provided with an approved watertight receptor with sides and back extending 1 inch above the finished dam or threshold. In no case shall the depth of a shower receptor be less than 2 inches or more than 9 inches measured from the top of the finished dam or threshold to the top of the drain. The wall area shall be constructed of smooth, noncorrosive, and nonabsorbent waterproof materials to a height not less than 6 feet above the compartment floor level. Such walls shall form a watertight joint with each other and with the receptor or shower floor. The floor of the compartment shall slope uniformly to the drain at not less than one-fourth nor more than one-half inch per foot.

Note: See also Appendix to Part B on Selection of Material and Installation of Wood Product Based Wall Surfacing for Tub and Shower Enclosures.

<u>Discussion</u> - The problem of leaking shower enclosures can be attributed primarily to the breakdown of the moisture seal at corners, edges and joints of the enclosure material. The 1975 edition of the ANSI Al19.1 Standard includes a new appendix that specifies material and installation requirements for wood product based wall surfacing materials for tub and shower enclosures. However, this new appendix does not include specific requirements relative to the materials to use when caulking and sealing corners and edges to prevent water leakage. Even if shower enclosure joints are sealed against moisture in the factory, transportation and set-up forces can damage the joints causing leakage. Aging of sealants is also a concern.

Recommendations

- 1. The ANSI All9.1 Standard should be amended to include the use of the sealants meeting Federal Specification Nos. TT-S-00230, TT-S-001543A, and TT-S-00227E when the design of of a shower stall enclosure requires sealing.
- 2. A pre-occupancy check should include an evaluation of the seals of shower enclosure joints.
- 3.2.5 WATERTIGHTNESS OF JOINT AT DRAIN SHOWER DRAIN LEAKAGE (SHRS2.)

Sample	% of Mobile Homes in Sample with Problem
HUD	4.2
Private	3.7
Field	3.5

Pertinent ANSI Al19.1 References

1974

- C9.2.2.2 The joint around the drain connection and around the toilet outlet in combination compartments shall be made watertight by a flange, clamping ring, or other approved or listed means.
- C14.4 Shower Stalls. Nonmetallic shower stalls and receptors shall be tested for leaks prior to being covered by finish material. Each pan shall be filled with water to the top of the dam for not less than 15 minutes.

1975

- C9.2.2.2 The joint around the drain connection shall be made watertight by a flange, clamping ring, or other approved listed means.
- C14.4 Shower Compartments. Nonmetallic shower compartments and receptors shall be tested for leaks prior to being covered by finish material. Each pan shall be filled with water to the top of the dam for not less than 15 minutes.

<u>Discussion</u> - This general problem may be related to forces or vibrations induced as a result of transportation and set-up. The connections used are similar to those used in conventional housing.

Recommendations

- 1. The effect of dynamic loads on plumbing piping connections should be included in an overall study of transportation and set-up forces on mobile homes.
- 2. A pre-occupancy check should include an evaluation of the tightness of the plumbing piping system.

3.2.6 PROTECTIVE REQUIREMENT: FREEZING OF WATER SUPPLY PIPING (PREQ4.)

Most of these problems occurred in HUD Agnes units (HUD and Field Samples).

Sample	% of Mobile Homes in Sample with Problem
HUD Private Field	3.3 0.1 4.7

Pertinent ANSI All9.1 Reference (1974 and 1975)

C5.2.4 <u>Freezing</u>. All piping and fixtures subject to freezing temperatures shall be insulated or protected to prevent freezing under normal occupancy.

Discussion - The predominance of these data in the HUD and Field Samples indicated that conditions unique to the HUD Wilkes-Barre operation may be responsible for many of these problems. In many cases, it is known that due to the emergency conditions following the Agnes disaster, some mobile homes awaiting occupancy were unheated resulting in freezing of pipes. A contributing factor was the difficulty in draining the water supply and drain systems. Also, there were malfunctions of heat tape which allowed piping within the floor cavity to freeze. Cases of inadequate insulation were noted but the HUD procured mobile homes may have been manufactured for southern climates and not for Central Pennsylvania.

Recommendations

1. The following sentence should be added to Section C5.2.4:

"The plumbing system shall be designed for convenient drainage of both the water supply and drain systems."

- The plan review and plant inspection aspects of the enforcement process should be tightened to insure that plumbing piping is adequately insulated for the intended climate.
- 3. There is a potential weakness in the mobile home design where reliance is place on heat tape to prevent freezing of plumbing pipe. Heat tapes wear out requiring periodic replacement and the typical mobile home occupant normally will not be alerted to the failure until pipes are frozen.

3.2.7 VENT TERMINAL - VENT CAPS - REMOVAL POTENTIAL (VVTL3.)

Vent pipe terminations on roofs were routinely inspected during the field study. Mobile home occupants would not normally be aware of the problem.

Sample	% of Mobile Homes in Sample with Problem
HUD Private Field	0.1 7.4

Pertinent ANSI All9.1 References

1974

C13.5.3 <u>Vent Caps</u>. All vent caps shall be of a removable type to permit testing under Paragraph 14.2.

1975

C13.7 Vent Caps. Vent caps, if provided, shall be of the removable type (without removing the flashing from the roof) where required to perform the tests under Paragraph 14.2.1 and 14.2.2 or when the vent is used as a clean out.

<u>Discussion</u> - These data are related to the necessity of removing permanent flashing from around roof penetrations in order to test or maintain plumbing vent systems as required in C14.2. The 1975 revision requires that vent caps be the removable type "without removing the flashing from the roof" which is an improvement.

Recommendation - For testing and maintenance of the mobile home plumbing systems (according to C14), it is important that plumbing vents be identified. The following addition to Section C13.7 should be considered:

"When vent caps used for roof space ventilation are identical to the vent caps used for the plumbing system, plumbing system caps shall be identified with permanent markings."

5.3 HEATING SYSTEMS (PART D) - The following problems are taken from the data presented in Appendices B, C and D. The percentage of mobile homes in each sample with the problem is tabulated along with the pertinent paragraphs of the 1974 and 1975 editions of the ANSI Al19.1 Standard for Mobile Homes (NFPA 501B-1973 and 1974 editions). A discussion of the problem is included with recommendations for changes in the Standard and other phases of the mobile home supply process where appropriate.

3.3.1 APPLIANCES - QUESTIONABLE LOCATION OF FURNACE THERMOSTAT (HAIM1.)

The location of the thermostat was routinely checked in the field study. Mobile home occupants generally did not recognize this as a problem.

Sample	% of Mobile Homes in Sample with Problem
HUD Private Field	0.4 8.6

Pertinent ANSI All9.1 Reference (1974 and 1975)

Not covered in ANSI A119.1-1974 or 1975.

<u>Discussion</u> - This category involved the location of furnace thermostats on walls adjacent to the furnace. In some cases, the thermostat was attached to a wall common to the furnace compartment or on an exterior wall. This proximity to the furnace or to a cold exterior wall has an adverse effect on the operation of the thermostatic control.

"The furnace thermostat shall be placed a minimum of three (3) feet from the vertical edge of the furnace compartment door. It shall not be located on an exterior wall or on a wall separating the furnace compartment from a habitable room."

3.4 ELECTRICAL SYSTEMS (PART E) - The following problems are taken from the data presented in Appendices B, C and D. The percentage of mobile homes in each sample with the problem is listed along with the pertinent paragraphs of the 1974 and 1975 editions of the ANSI Al19.1 Standard for Mobile Homes (NFPA 501B - 1973 and 1974 editions). A discussion of the problem is included with recommendations for changes in the Standard and other phases of the mobile home supply process where appropriate.

3.4.1 WIRING METHODS - FASTENING BOXES, FITTINGS, CABINETS (EWFB)

Boxes were routinely inspected for tightness in the field study. Mobile home occupants would not generally recognize this as a problem (Private and HUD Samples).

Sample	% of Mobile Homes in Sample with Problem
HUD Private Field	5.6 26.8

Pertinent ANSI All9.1 Reference (1974 and 1975)

E8.13 - Boxes, fittings and cabinets shall be securely fastened in place. Exception: Snapin type boxes or boxes provided with special wall or ceiling brackets that securely fasten boxes in walls and ceilings may be used (E11.5 in 1974).

<u>Discussion</u> - The basic problem was that switch boxes, duplex outlet boxes and boxes that serviced ceiling fixtures were not adequately attached to their surroundings. Where mechanical fastenings of boxes to wall paneling was used (screws, nails, or staples) and the wall paneling was less than 1/4 inch thick, the paneling did not offer a sufficient thickness of material to adequately anchor the boxes. Where snap-in boxes were used, the clearance between box and paneling becomes critical and in the majority of cases these clearances were excessive resulting in inadequately anchored boxes.

Loose ceiling fixtures were noted where snap-in type boxes were used in vegetable fiber-board ceiling materials. Some of these ceiling materials do not have the necessary degree of structural integrity to provide proper anchorage for snap-in type boxes or mechanically fastened boxes. As in the case of snap-in boxes anchored to wall paneling, the dimensions of the cutouts into which the box fits are critical. The cutout dimensions are specially critical when vegetable fiberboard ceiling materials are used.

Another possible cause for the loosening of the mechanical fasteners used to attach boxes and fittings are the vibrations induced during transportation of the mobile home.

These observed problems can be related to an inadequacy in the ANSI Al19.1 Standard that simply states that "boxes, fittings and cabinets shall be securely fastened in place," and does not define "securely fastened in place" or indicate how it can be evaluated in the enforcement process.

Recommendations

1. A solution to this problem could be to adopt the National Electrical Code (N.E.C.) requirements for support of boxes that require attachment to structural members directly, or to approved metal or wooden braces that are attached to structural members. The pertinent paragraph in N.E.C. is 370-13 "Supports" which states that:

"Boxes shall be securely and rigidly fastened to the surface upon which they are mounted, or securely and rigidly embedded in concrete or masonry. Boxes shall be supported from a structural member of the building either directly or by using a substantial and approved metal or wooden brace, or shall be supported as is otherwise provided in this Section. If of wood, the brace shall not be less than one-inch thickness. If of metal, it shall be corrosion-resistant and shall not be less than No. 24 MSG.

Where mounted in new walls in which no structural members are provided or in existing walls in previously occupied buildings, boxes not over 100 cubic inches in size, specifically approved for the purpose, shall be affixed with approved anchors or clamps so as to provide a rigid and secure installation."

2. An alternative to adoption of the N.E.C. prescriptive requirement would be to develop a performance specification giving strength and rigidity requirements for box and fitting attachments to ceiling and wall components.

3.4.2 LIGHTING FIXTURES - DURABILITY OF LIGHTING FIXTURES (EXUR)

Sample	% of Mobile Homes in Sample with Problem
HUD	3.5
Private	5.5
Field	4.7

Pertinent ANSI Al19.1 References

1974

E5.1 - Electrical materials, devices, appliances, fittings and other equipment installed, intended for use in, or attached to the mobile home shall be listed by a nationally recognized testing agency and shall be connected in an approved manner when in service. Facilities shall be provided to securely fasten appliances when the mobile home is in transit (see Section 23 for provisons on grounding).

1975

E7.1 - Electrical materials, devices, appliances, fittings and other equipment installed, intended for use in, or attached to the mobile home shall be approved for the application and shall be connected in an approved manner when in service. Facilities shall be provided to securely fasten appliances when the mobile home is in transit (see Section 9 for provisions on grounding).

<u>Discussion</u> - Poor durability performance of lighting fixtures was a general problem found in the study. Although the fixtures had been approved for use "by nationally recognized testing agencies" many were of a low quality and required frequent repair or replacement. It is difficult for the enforcement officials to require some useful life of the fixtures since the ANSI All9.1 Standard (like most of the housing standards) does not address durability other than in general terms.

Recommendation - A study of durability of electrical devices, including lighting fixtures, should be initiated for all types of housing.

3.4.3 OUTDOOR OUTLETS, FIXTURES, ETC. - LACK OF WATERPROOFING (EBTF)

% of Mobile Homes in Sample with Problem
1.3 1.9 2.7

Pertinent ANSI All9.1 References

1974

E22.1 - Outdoor fixtures and equipment shall be recognized for outdoor use. Outdoor receptacles or convenience outlets shall be of gasketed-cover type.

1975

E13.1 - Same as E22.1 - 1974.

<u>Discussion</u> - The majority of problems were caused by convenience outlets that did not remain waterproof or by the use of non-waterproof outlets in exterior applications. The Standard does not require mobile homes to have exterior convenience outlets but does state that if they are provided, they must be waterproof.

The mobile home manufacturers cannot be held responsible in the many instances where mobile homes delivered to the Wilkes-Barre area in the aftermath of Hurricane Agnes had to be equipped with outside outlets for heat tape connections and weatherproof fixtures were not available for installation; non-waterproof outlets were used in these cases. This does point out a problem if the mobile home occupant should require use of heat tape and an exterior outlet is not available on the unit.

Recommendation - The ANSI Standard should be amended to require at least one weatherproof outlet on a separate fused circuit in the vicinity of the water inlet pipe for heat tape use.

4.0 EVALUATION OF PROBLEMS RELATED TO THE MOBILE HOME ENFORCEMENT PROCESS

4.1 CONSTRUCTION - The following problems are taken from the data presented in Appendices B, C and D. The percentage of mobile homes which have the problem is listed along with the pertinent paragraphs of the 1974 and 1975 editions of the ANSI Al19.1 Standard for Mobile Homes (NFPA 501B - 1973 and 1974 editions). A discussion of the problem is included with recommendations for changes in the enforcement process or other phases of the mobile home supply process where appropriate.

4.1.1 EXTERIOR WALLS - EXCESSIVE HEAT LOSS (EXHL)

Wall cavities of mobile homes in the Field Study were generally not inspected for sufficient amounts of insulation since it would require removal of permanent construction. Data in the HUD and Private Samples resulted from occupant complaints.

Sample	% of Mobile Homes in Sample with Problem
HUD	5.5
Private	1.7
Field	0.4

Pertinent ANSI All9.1 Reference (1974 and 1975)

B7.5 <u>Heat Loss</u>. The total calculated heat loss of the living unit at the outdoor design temperature as certified in 7.5.1 of this Part shall not exceed 40 $Btu/hr/ft^2$ of the total floor area or 275 Btu/hr lineal ft. of the perimeter of the space to be heated to $70^{\circ}F$, whichever is greater. The minimum total resistance value (R), excluding framing, of the wall (less windows and doors), ceiling and floor shall not be less than:

Wall	8.0
Ceiling	16.0
Floor	10.0

<u>Discussion</u> - Problems recorded in this category were generally indications of missing or inadequate amounts of thermal insulation in portions of exterior walls including hot water heater compartment doors. The frequent problem of insufficient insulation in the HUD mobile homes may be explained in part, at least, by the fact that some probably were not insulated for the Central Pennsylvania climate. Missing insulation is an indication of an inadequate enforcement program (plant inspection).

Recommendations

- 1. In-plant monitoring of the construction process must be improved to eliminate the possibility of insufficient or missing insulation or the application of insulation that is cut too short for the intended purpose or not properly fitted.
- 2. Adoption of the Tentative Interim Admendment on Energy Conservation being developed by the ANSI Al19.1 Committee is recommended.

4.1.2 ROOF SYSTEM - EXCESSIVE HEAT LOSS (RHLS)

The Field Sample data are quite significant since of the 20 units inspected in the roof cavity for missing insulation or insulation cut short, three (1.2% of Field Sample) were found to have insulation deficiences.

Sample	% of Mobile Homes in Sample with Problems
HUD	0.1
Private	0.9
Field	1.2

Pertinent ANSI Al19.1 Reference (1974 and 1975)

B7.5 Heat Loss. The total calculated heat loss of the living unit at the outdoor design temperature as certified in 7.5.1 of this Part shall not exceed 40 $Btu/hr/ft^2$ of the total floor area or 275 Btu/hr lineal ft. of the perimeter of the space to be heated to $70^\circ F$, whichever is greater. The minimum total resistance value (R), excluding framing, of the wall (less windows and doors), ceiling and floor shall not be less than:

wall		•		•	•			٠	•	۰				۰	•	۰	•	٠	۰	8.0	
Ceiling		٠	•					۰					•							16.0	
Floor									٠	۰	٠									10.0	

<u>Discussion</u> - Thermal insulation between roof trusses were found to be missing or cut short of the wall resulting in the potential for excessive heat loss. Inadequate in-plant inspection probably accounted for most of these construction deficiencies.

<u>Recommendation</u> - Improved in-plant inspection during the manufacturing process is needed to insure that the required thermal insulation is used.

4.2 PLUMBING SYSTEMS - The following problems are taken from the data presented in Appendices B, C and D. The percentage of mobile homes which have the problem is listed along with the pertinent paragraphs of the 1974 and 1975 editions of the ANSI Al19.1 Standard for Mobile Homes (NFPA 501B - 1973 and 1974 editions). A discussion of the problem is included with the recommendations for changes in the enforcement process or other phases of the mobile home supply process where appropriate.

4.2.1 PLUMBING PIPING - WATER LEAKS (JCT1.)

Sample	% of Mobile Homes in Sample with Problem
HUD	23.3
Private	17.7
Field	22.6

Pertinent ANSI All9.1 Reference (1974 and 1975)

C7.1 Tightness. Joints and connections in the plumbing system shall be gastight and water-tight for the pressures required under testing procedures.

<u>Discussion</u> - These problems include plumbing piping joint leaks of supply, drain and vent systems. This category includes all piping problems not related to freezing, material defects or corrosion. Possible reasons for approximately one-fifth of the mobile homes in the study exhibiting plumbing leaks are: (1) poor workmanship, (2) inadequate in-plant inspection, and (3) inadequate design for forces induced during transit and site set-up.

Recommendations

- Improved in-plant inspection of the manufacturing process is needed to insure that workmanship standards are maintained.
- 2. An evaluation of the dynamic loading effects of transportation and site set-up on joints and piping should be conducted.

4.2.2 DRAINAGE SYSTEM - INADEQUATE GRADE OF HORIZONTAL PIPING (DSGR)

Sample	% of Mobile Homes in Sample with Problem
HUD	0.1
Private	5.7
Field	0.4

Pertinent ANSI Al19.1 References

1974

Same as 1975 except the phrase "Except for fixture connections on the inlet side of the trap," is deleted.

1975

C12.7 Grade of Horizontal Drainage Piping. Except for fixture connections on the inlet side of the trap, horizontal drainage piping shall be run in practical alignment and have a uniform grade of not less than 1/4 inch per foot toward the mobile home drain outlet. Where it is impractical, due to the structural features or arrangement of any mobile home, to obtain a grade of 1/4 inch per foot, the pipe or piping may have a grade of not less than 1/8 inch per foot, when a full size cleanout is installed at the upper end.

 $\underline{\text{Discussion}}$ - The inadequate slope of horizontal drain piping is an enforcement problem in that the ANSI All9.1 Standard is very specific as to minimum slope requirements.

Recommendation - The in-plant inspection process should be improved in the area of plumbing piping for Standard compliance.

4.2.3 WATER DISTRIBUTION SYSTEM - PROBLEMS WITH WATER HEATER RELIEF VALVE DRAINS (WIRV3.)

Hot water heater relief valve drains were routinely inspected during the field study. Occupants of units included in the HUD and Private Samples would not generally consider this a problem.

Sample	% of Mobile Sample with	
HUD	0.1	,
Private	0.8	
Field	15.6	
1		

Pertinent ANSI All9.1 References (1974 and 1975)

1974

C11.3.1.3 - Relief values shall be provided with full-sized drains which shall extend outside directed downward and terminate beneath the mobile home. Drain lines shall be of a material listed for hot water distribution and shall drain fully by gravity, shall not be trapped and shall not have their outlets threaded.

1975

C11.3.1.3 - Relief values shall be provided with full-size drains which shall be directed downward and discharged beneath the mobile home. Drain lines shall be of a material listed for hot water distribution and shall drain fully by gravity, shall not be trapped, and shall not have their outlets threaded.

<u>Discussion</u> - Most of these data occurred in HUD Agnes units and could have resulted from field replacement or repair of hot water heaters. The problems are of three general types which are violations of C11.3.1.3; (1) relief valve terminates above the floor or in the floor and does not directly "discharge beneath the mobile homes," (2) relief valve drain end threaded, and (3) relief valve drain undersize as compared to the relief valve outlet. These observed violations would only result in a problem if a water heater malfunction occurred requiring the relief valve drain to function. Violation (1) would result in water discharge into the mobile home damaging flooring, carpeting, floor insulation, etc. Violations (2) and (3) could result in a life-safety hazard, such as pressure build-up and explosion of the hot water heater, if a threaded-end drain were capped or an undersized drain installed.

Recommendations

1. Excluding hot water heater problems caused by modifications in the field, the standard violations indicate an inadequate enforcement program (in-plant inspection).

2. As a clarification, revise C11.3.1.3 as follows (revised portion underlined):

"Relief valves shall be provided with drains of <u>cross sectional area equivalent to that of the relief valve outlet</u> and be directed downward and discharge beneath the mobile home. Drain lines shall be of a material listed for hot water distribution and shall drain fully by gravity, shall not be trapped, shall not have their outlets threaded, and the end of the drain shall be visible for inspection."

4.2.4 PLUMBING PIPING - INADEQUATE HANGERS AND SUPPORTS (PHAS)

Sample	% of Mobile Homes in Sample with Problem
HUD	2.1
Private	2.8
Field	0.8

Pertinent ANSI Al19.1 References (1974 and 1975)

C.10. Hangers and Supports

- C10.1 Strains and Stresses. Piping in a plumbing system shall be installed without undue strains and stresses, and provision shall be made for expansion, contraction, and structural settlement.
- C10.2 Piping Supports. Piping shall be secured at sufficiently close intervals to keep the pipe in alignment and carry the weight of the pipe and contents.

C10.3 Hangers and Anchors

- C10.3.1 Hangers and anchors shall be of sufficient strength to support their proportional share of the pipe alignments and prevent rattling.
- C10.3.2 Piping shall be securely attached to the structure by proper hangers, clamps or brackets which provide protection against motion, vibration, road shock, torque in the chassis, or other unusual conditions.

<u>Discussion</u> - Plumbing piping support criteria in ANSI All9.1 are presented in a performance format with requirements such as "secured at sufficiently close intervals," "sufficient strength," and "securely fastened." Clo.3.2 specifically requires design for the anticipated forces of transportation and site set-up. This would appear to be adequate as long as the enforcement agency requires the manufacturer to provide documentation showing such compliance.

Recommendations

- 1. The enforcement process (plan review and in-plant inspection) should be improved to insure adequate support of the plumbing piping.
- 2. A study of the effects of transportation on mobile homes should include its impact on the plumbing system.

4.2.5 FITTINGS - CORROSION OF WATER SUPPLY PIPING (WDML)

Water piping was routinely inspected during the field study. Corrosion of piping would generally not be reported as a problem by mobile home occupants (HUD and Private Samples) unless it resulted in a water leak.

Sample	% of Mobile Homes in Sample with Problem
HUD	
Private	0.3
Field	8.6

Pertinent ANSI Al19.1 References

1974

C11.4.2 <u>Fittings</u>. Appropriate fittings shall be used for all changes in direction or size and where pipes are joined. The material and design of fittings shall conform to the type of piping used.

1975

C11.4.2 <u>Fittings</u>. Appropriate fittings shall be used for all changes in size and where pipes are joined. The material and design of fittings shall conform to the type of piping used.

<u>Discussion</u> - Corrosion of water distribution piping was observed with systems composed of similar metals as well as those of dissimilar metals (copper to galvanized steel). The All9.1 Standard requires special consideration for the design of fittings when piping materials are joined.

Recommendations

- 1. The enforcement process should be improved at the plan review stage to insure that necessary precautions are taken to prevent corrosion of piping at fittings.
- In-plant inspection procedures should verify that these precautions are implemented in the manufacturing process.
- 3. As a clarification of good practice, Cll.4.2 should be modified as follows:

"Fittings - Appropriate fittings shall be used for all changes in size and where pipes are joined. The material and design of fittings shall conform to the type of piping used. Special consideration shall be given to prevent corrosion when dissimilar metals are joined."

4.2.6 PLUMBING FIXTURE MALFUNCTIONS (VVGL)

Sample	% of Mobile Homes in Sample with Problem
HUD Private Field	1.2 0.1

Pertinent ANSI All9.1 Reference (1974 and 1975)

C13.1 General. Each plumbing fixture trap shall be protected against siphonage and back pressure, and air circulation shall be insured throughout all parts of the drainage system by means of vents installed in accordance with the requirements of this section and as otherwise required by this standard.

<u>Discussion</u> - These problems are related to poorly functioning plumbing fixtures or reported sewer gas odors in the mobile home. Even though the amount of data is small with most occurring in the Private Sample, it is significant because of the potential life-safety hazard if sewer gas should back up into the mobile home. Plumbing systems which were inadequately sealed or vents which were plugged could have caused this problem. Even if the plumbing piping is sealed correctly in the factory, joints could become loose during transportation and site set-up.

Recommendations

- Adequate plant workmanship and conformance with the ANSI All9.1 Standard should be verified by improved in-plant inspections as part of the enforcement process.
- The drainage system, vent system and plumbing fixtures should be tested prior to occupancy to insure tightness of the system which may have been affected by transportation and set-up.

4.2.7 TOILET FLUSH TANKS - USE OF NONAPPROVED FLUSHING DEVICES (WØSC6.)

The ball cock was routinely inspected in the field study. Mobile home occupants (HUD and Private Samples) would not report this as a problem unless a malfunction occurred.

Sample	% of Mobile Homes in Sample with Problem
HUD	
Private	
Field	3.9

Pertinent ANSI All9.1 Reference (1974 and 1975)

C11.2.6 Flush Tanks. Toilet flush tanks shall be equipped with an approved anti-siphon ball cock which shall be installed and maintained with its outlet or critical level mark not less than 1 inch above the full opening of the overflow pipe.

<u>Discussion</u> - These problems concern the use of a submerged ball cock flushing devices in violation of C11.2.6. These devices could allow flushing tank water to back flow into the potable water supply.

Recommendation - Improved plan review and in-plant inspection is required.

4.2.8 VENT PIPE PENETRATION PROBLEM (VVTL1.)

Although only a limited number of roof vents were inspected during the field study, this problem was observed with sufficient frequency to warrant discussion here.

Sample	% of Mobile Homes in Sample with Problem
HUD	
Private	0.5
Field	0.8

Pertinent ANSI All9.1 Reference (1974 and 1975)

C13.6.1 Roof Extension. Each vent pipe shall extend through its flashing and terminate vertically, undiminished in size, not less than 2 inches above the roof. Vent openings shall not be less than 3 feet, 0 inches away from any motor-driven air intake that opens into habitable areas.

<u>Discussion</u> - These problems are concerned with extension of the vent pipe 2 inches above the roof as required by C13.6.1. Vents were observed which terminated within the roof cavity, at the roof level or the vent opening was blocked by insulation which could cause trap seal failure.

Recommendation - The required extension of vents above the roof is quite specific in C13.6.1 and the violations would indicate a problem with the enforcement process (in-plant inspection).

4.3 HEATING SYSTEMS - The following problems are taken from the data presented in Appendices B, C and D. The percentage of mobile homes in each sample with the problem is listed along with the pertinent paragraphs of the 1974 and 1975 editions of the ANSI All9.1 Standard for Mobile Homes (NFPA 501B - 1973 and 1974 editions). A discussion of the problem is included with recommendations for changes in the Enforcement Process or other phases of the mobile home supply process where appropriate.

4.3.1 VENT SYSTEM - USE OF UNLISTED APPLIANCE COMPONENTS OR INADEQUATELY INSTALLED COMPONENTS (HAVE)

Sample	% of Mobile Homes in Sample with Problem
HUD	2.5
Private	14.6
Field	12.5

Pertinent ANSI All9.1 Reference (1974 and 1975)

96.4.1 - The venting as required by 6.1.2 shall be accomplished by one or more of the methods given in (a) and (b) below:

- (a) An integral vent system listed or certified as part of the appliance.
- (b) A venting system consisting entirely of listed components, including roof jack, installed in accordance with the terms of the appliance listing and appliance manufacturer's instructions (see 6.3.2).

<u>Discussion</u> - These problems concern the vent systems of heating appliances (furnace and hot water heater) which do not consist entirely of listed components or were not installed in accordance with the terms of the appliance listing or the manufacturer's instructions. The cause of this problem appears to be regulatory in nature with the inspection process allowing the installation of venting systems which do not conform to D6.4.1.

Recommendation - The plan and specification review and plant inspection phases of the enforcement process should be improved to insure that vent systems conform to D6.4.1.

4.3.2 APPLIANCES - INADEQUATE ACCESSIBILITY FOR REPAIR AND REPLACEMENT (HAAC)

Appliance accessibility was routinely inspected during the field study. Mobile Home occupants (HUD and Private Samples) would not generally recognize this as a problem.

Sample	% of Mobile Homes in Sample with Problem
HUD	3.5
Private	1.3
Field	19.5

Pertinent ANSI All9.1 Reference (1974 and 1975)

D6.7 Accessibility. Every appliance shall be accessible for inspection, service, repair, and replacement without removing permanent construction. Sufficient room shall be available to enable the operator to observe the burner, control, and ignition means while starting the appliance.

<u>Discussion</u> - Accessibility to hot water heaters for replacement or repair was quite limited in many cases. D6.7 is quite specific in requiring "accessibility for inspection, service, repair and replacement without removing permanent construction." The placement within permanent kitchen cabinet construction makes it difficult to repair and impossible to replace without removing permanent construction. The location adjacent to living areas or closets often requires the removal of wall paneling for access.

Recommendation - The enforcement process (plan review and in-plant inspection) should be improved to insure accessibility to appliances as required by D6.7.

4.3.3 VENT SYSTEM - LOOSE VENT PIPING (HAVE3.)

Sample	% of Mobile Homes in Sample with Problem
HUD	0.8
Private	9.1
Field	10.5

Pertinent ANSI Al19.1 Reference (1974 and 1975)

D6.4.2 - Venting and combustion air systems shall be installed in accordance with the following:

- (a) Components shall be securely assembled and properly aligned using the method shown in the appliance manufacturer's instructions.
- (b) Draft hood connectors shall be firmly attached to draft hood outlets or flue collars by sheet metal screws or by an equivalent means.
- (c) Every joint of a vent, vent connector, exhaust duct and combustion air intake shall be secure and in alignment.

<u>Discussion</u> - Problems listed in this category are related to loose piping in the venting and combustion air systems for gas and oil furnaces and gas hot water heaters. This could be a life-safety hazard if flue gases should discharge into an appliance compartment which shares a common atmosphere with the living area. In describing the type of vent connections required, D6.4.2 (b) specifies required performance attributes such as "firmly attached" and "by an equivalent means" which could present difficulties in obtaining uniform enforcement. It is also possible that the vent system attachment may meet the requirements of the Standard as the mobile home leaves the plant but forces induced during transportation and site set-up could have a deteriorating effect on the attachments.

Recommendations

- 1. Because of the life-safety implications, the enforcement process (plan review and in-plant inspection) should provide thorough evaluation of the joints of the fuel burning vent system.
- A pre-occupancy check should be required including an inspection of the venting and combustion air system.
- 3. A study of the dynamic effects of transportation and set-up on mobile homes should include an evaluation of these effects on venting and combustion air system joints.
- 4. Clarify the intent of D6.4.2(b) as follows:

"D6.4.2(b) - Draft hood connectors shall be firmly attached to draft hood outlets or flue collars by sheet metal screws or by equivalent effective mechanical fasteners."

4.3.4 SUPPLY AIR SYSTEM - JOINTS AND SEAMS NOT AIRTIGHT (HARG)

Duct risers to floor registers were routinely inspected during the field study.

Sample	% of Mobile Homes in Sample with Problem
HUD	
Private	6.5
Field	19.5

Pertinent ANSI Al19.1 References

1974

- D6.10.3 <u>Joints and Seams</u>. Joints and seams of ducts shall be securely fastened and made substantially airtight. Slip joints shall have a lap of at least 1 inch and shall be individually fastened. Tape or caulking compound may be used for sealing mechanically secure joints. Where used, tape or caulking compound shall not be subject to deterioration under long exposures to temperatures up to 200°F and to conditions of high humidity, excessive moisture, or mildew.
- D6.10.5 Registers. Fittings connecting the registers to the duct system shall be constructed of metal or material which complies with the requirements of Class 1 or 2 ducts under UL Standard 181. Registers shall be constructed of metal or conform with the following:
- D6.10.5.1 Be made of a material classified SE-O or SE-I when tested as described in Underwriters' Laboratories, Inc. Standard for Tests of Flammability of Plastic Materials, UL94-1972.

1975

- D6.10.3 Same as 1974.
- D6.10.5 Registers or Grills. Fittings connecting the registers or grills to the duct system shall be constructed of metal or material which complies with the requirements of Class 1 or 2 ducts under Underwriters' Laboratories, Inc. Standard for Air Ducts, UL181-1972. Registers or grills shall be constructed of metal or conform with the following:
- 06.10.5.1 Same as 1974 except SE-0 changed to 94VE-0 and SE-1 changed to 94VE-1.

<u>Discussion</u> - The problems grouped in this category are of three distinct types: (1) riser from the horizontal air supply duct to the floor register is either missing or constructed of duct tape, (2) debris in the duct such as trash, flooring covering, etc., and (3) restriction of air flow through the floor register. The use of duct tape risers is a violation of D6.10.5 where the riser material must meet the requirements of UL 181-1972. The absence of a riser and the presence of construction debris in the duct are workmanship problems reflecting on the in-plant inspection process. The restriction of air flow from the duct to the floor register can be caused by undersize floor openings, sheet metal bent into the air flow of the duct, or improper workmanship associated with the installation of floor covering.

 $\frac{\text{Recommendation}}{\text{of the Standard.}} - \text{In-plant inspection should be improved to eliminate obvious violations}$

4.3.5 FUEL-BURNING APPLIANCES - INADEQUATE SEPARATION OF COMBUSTION AIR SYSTEM FROM ATMOSPHERE OF MOBILE HOME (HAMS)

The major portion of these data resulted from the mobile home inspections by state enforcement officials (Private Sample).

Samp1e	% of Mobile Homes in Sample with Problem	1
HUD Private Field	 5.8 0.4	1

Pertinent ANSI All9.1 References

1974

- D6.3.2 All fuel-burning appliances, except ranges, ovens, illuminating appliances and clothes dryers, shall be installed to provide for the complete separation of the combustion system from the interior atmosphere of the mobile home. Combustion air inlets and flue gas outlets shall be listed or certified as components of the appliance. The required separation may be obtained by:
 - (a) The installation of direct vent system (sealed combustion system) appliances, or
 - (b) The installation of appliances within enclosures so as to separate the appliance combustion system and venting system from the interior atmosphere of the mobile home. There shall not be any door, removable access panel, or other opening into the enclosure from the inside of the mobile home. Any opening for ducts, piping, wiring, etc., shall be sealed.

1975

- D6.3.2 All fuel-burning appliances, except ranges, ovens, illuminating appliances, clothes dryers, solid fuel-burning fireplaces and solid fuel-burning fireplace stoves, shall be installed to provide for the complete separation of the combustion system from the interior atmosphere of the mobile home. Combustion air inlets and flue gas outlets shall be listed or certified as components of the appliance. The required separation may be obtained by:
 - (a) Same as 1974.
 - (b) Same as 1974.

<u>Discussion</u> - Some of these problems were violations of D6.3.2(b) where the furnace and water heater compartments were not adequately sealed from the atmosphere of the mobile home. Others resulted when the direct vent systems of sealed combustion system appliances [D6.3.2 (a)] were not sealed adequately due to manufacturing problems or separation caused by transit and set-up. This could be a life-safety problem if combustion air was taken from the interior atmosphere of the mobile home depleting oxygen available to the occupants.

Recommendations

- 1. Because of safety-related concerns, the in-plant inspection of sealed combustion systems for appliances listed in D6.3.2 should be more thorough.
- A check of the sealed combustion system for these appliances should be part of a preoccupancy inspection to insure that a dangerous condition does not exist.
- 4.3.6 GAS SUPPLY CONNECTION INADEQUATE PERMANENT MARKING (HGID)

The presence of a gas identification tag was routinely checked in the field study. Mobile home occupants (HUD and Private Samples) would not generally recognize this as a problem.

Sample	% of Mobile Homes in Sample with Problem
HUD	
Private	0.7
Field	17.9

Pertinent ANSI All9.1 References

1974

D5.1.11 Identification of Gas Supply Connections. Each mobile home shall have permanently affixed to the exterior skin at or near each gas supply connection or the end of the pipe, a tag of 3 inches by 1-3/4 inches minimum size, made of etched, metal-stamped or embossed brass, stainless steel, anodized or alclad aluminum not less than 0.020 inch thick, or other approved material (e.g., 0.005 inch plastic laminates), which reads (as appropriate) either:

1975

D5.1.11 Identification of Gas Supply Connections. Each mobile home shall have permanently affixed to the exterior skin at or near each gas supply connection or the end of the pipe, a tag of 3 inches by 1-3/4 inches minimum size, made of etched, metal-stamped or embossed brass, stainless steel, anodized or alclad aluminum not less than 0.020 inch thick, or other approved material (e.g., 0.005 inch plastic laminates), which reads (as appropriate) in accordance with one of the following label designs depending upon the fuel used. The connector capacity indicated on this tag shall be equal to or greater than the total Btuh rating of all intended gas appliances.

<u>Discussion</u> - The absence of a gas supply connection identification tag was noted mostly on HUD Agnes units. It is possible that the tags were on the units when manufactured but were lost or removed later. However, this would be contrary to the intent of D5.1.11 which requires that the tag be "permanently affixed to the exterior skin." This would indicate that something more than a "paste-on" tag should be used. The change in the 1975 editions of the ANSI Al19.1 as compared to 1974 is related to the wording on the tag and not the attachment method.

Recommendations

- 1. The enforcement program (plan review and in-plant inspection) should include the requirement that the manufacturer use permanently attached identification tags. The "paste-on" type which can be easily removed should not be accepted.
- 2. As a clarification, D5.1.11 (1975 edition) should be revised as follows (addition underlined):

"D5.1.11 - Each mobile home shall have permanently affixed to the exterior skin with mechanical fasteners at or near each gas supply connection or the end of the pipe, a tag of 3 inches by 1-3/4 inches minimum size, made of etched, metal stamped or embossed brass, stainless steel, anodized or alclad aluminum not less than 0.020 inch thick, or other approved material (e.g., 0.005 inch plastic laminates), which reads (as appropriate) in accordance with one of the following label designs depending upon the fuel used. The connector capacity indicated on this tag shall be equal to or greater than the total Btuh rating of all intended gas appliances."

4.3.7 GAS PIPING - INADEQUATE HANGERS AND SUPPORTS (HGHS)

Gas piping support was routinely checked in the field study. Mobile home occupants (HUD and Private Samples) would not generally recognize this as a problem.

Sample	% of Mobile Homes in Sample with Problem
HUD Private Field	2.2 10.5

Pertinent ANSI All9.1 Reference (1974 and 1975)

P5.1.18 Hangers and Supports. All gas piping shall be adequately supported by galvanized or equivalently protected metal straps or hangers at intervals of not more than 4 feet, except where adequate support and protection is provided by structural members. Solid-iron-pipe gas supply connections(s) shall be rigidly anchored to a structural member within 6 inches of the supply connections(s).

<u>Discussion</u> - An inadequate number of hangers for gas piping is related to the enforcement process since D5.1.18 is quite specific as to minimum spacing requirements.

Recommendation - Improve plan and specification review and in-plant inspection to assure compliance with the requirements of D5.1.18.

4.3.8 SUPPLY DUCT SYSTEM - SYSTEM NOT AIR TIGHT (HACS3.)

Sample	% of Mobile Homes in Sample with Problem
HUD Private Field	4.1 0.4

Pertinent ANSI All9.1 Reference (1974 and 1975)

D6.10.1.3 Airtightness of Supply Duct Systems. A supply duct system shall be considered substantially airtight when the static pressure in the duct system, with all registers sealed and with the furnace air circulator at high speed, is at least 80 percent of the static pressure measured in the furnace casing, with its outlets sealed and the furnace air circulator operating at high speed. For the purpose of this paragraph and 6.10.2 pressures shall be measured with a water manometer or equivalent device calibrated to read in increments not greater than 1/10 inch water column.

<u>Discussion</u> - These problems were recorded from visual observations of enforcement officials investigating consumer complaints (Private Sample) and do not necessarily reflect the failure of the supply air system to pass the test requirements of D6.10.1.3. Assuming the supply system was adequately sealed at the factory, it is possible that effects of transportation and site set-up could loosen the system causing excessive leakage.

Recommendations

- 1. In-plant inspection should insure that testing according to D6.10.1.3 is conducted.
- The airtightness of the supply duct system should be verified as part of a pre-occupancy inspection.

4.3.9 APPLIANCES - INADEQUATE MARKINGS (HAMK)

Required markings on appliances were routinely inspected in the field study. Mobile home occupants (HUD and Private Sample) would not generally recognize this as a problem.

Sample	% of Mobile Homes in Sample with Problem
HUD Private Field	0.2 10.9

Pertinent ANSI Al19.1 References (1974 and 1975)

D6.6 Marking

D6.6.1 - Information on clearances, input rating, lighting and shutdown shall be attached to the appliances with the same permanence as the nameplate, and so located that it is easily readable when the appliance is properly installed.

D6.6.2 - Each fuel-burning appliance shall bear permanent marking designating the type(s) of fuel for which it is listed.

<u>Discussion</u> - The bulk of these data are related to the absence of required appliance markings. Possible explanations for the missing markings are (1) markings may not have been attached when manufactured, or (2) they may have been removed by occupants or maintenance personnel.

<u>Recommendation</u> - While there can be little control over what happens to the mobile home after it is occupied, in-plant inspections must verify that required markings are permanently attached to the appliances.

4.3.10 APPLIANCE CONNECTIONS - INADEQUATE FLEXIBLE GAS CONNECTOR APPLICATIONS (HGAC)

Flexible gas connectors were inspected during the field study. Unless a malfunction occurred, mobile home occupants would not generally recognize this as a problem.

Sample	% of Mobile Homes in Sample with Problem
HUD Private Field	0.4 4.3

Pertinent ANSI Al19.1 References

1974

D5.1.13 Appliance Connections. All gas-burning appliances shall be connected to the fuel piping with materials as provided in 5.1.2 of this Part or with listed appliance connectors. Listed appliance connectors when used shall not run through walls, floors, ceilings or partitions. Connectors of aluminum shall not be used outdoors.

1975

D5.1.13 Appliance Connections. All gas burning appliances shall be connected to the fuel piping. Materials as provided in Section 5.1.2 of this Part or listed appliance connectors shall be used. Listed appliance connectors when used shall not run through walls, floors, ceilings or partitions. Connectors of aluminum shall not be used outdoors.

<u>Discussion</u> - The problems in this category consist of two types: (1) flexible gas connectors running through the floor to the underside of the mobile home in violation of D5.1.13, and (2) flexible connectors installed on appliances with excessively sharp bends. The second is an example of poor workmanship with the sharp bend being an area of potential gas leak. In many of the instances observed, it was not possible to determine whether they originated in the factory or were related to repair or replacement of the heating units after the mobile home was placed in service.

Recommendation - These examples of poor practice associated with flexible gas connectors which originate during the manufacturing process should be caught by in-plant inspection.

4.3.11 VENTING SYSTEM - TERMINATION BENEATH THE MOBILE HOME (HAVE5.)

Sample	% of Mobile Homes in Sample with Problem
HUD Private Field	1.2 0.4

Pertinent ANSI All9.1 References (1974 and 1975)

- D6.2.3 The exhaust duct shall not terminate beneath the mobile home.
- D6.4.3 Venting Systems shall not terminate underneath a mobile home.

<u>Discussion</u> - Most of these problems involved the venting of dryers through the floor to the underside of the mobile home. It could not be determined if this was done by the manufacturer or the occupant; however, it is fair to assume that the occupants were responsible for a great deal of these violations of the ANSI Al19.1 Standard. A space provided for a dryer was not always accompained by a venting system. If the manufacturer provides space for a clothes dryer, he should provide an approved venting system and not rely on the mobile home occupant to improvise.

Recommendations

- 1. The enforcement process (plan review and in-plant inspection) should be improved to prevent dryer vent systems provided by the manufacturer from terminating under the mobile home.
- 2. Additionally, revise D6.2.3 as follows:
 - D6.2.3 If space for a clothes dryer is provided, provision for an exhaust duct, which does not terminate beneath the mobile home, shall be installed.
- 4.4 ELECTRICAL SYSTEMS The following problems are taken from the data presented in Appendices B, C and D. The percentage of mobile home units in each data sample with the problem is listed along with the pertinent paragraphs of the 1974 and 1975 editions of the ANSI Al19.1 Standard for Mobile Homes (NFPA 501B 1973 and 1974 editions). A discussion of each problem is included with recommendations for changes in the enforcement process or other phases of the mobile home supply process as appropriate.

4.4.1 RECEPTACLE OUTLETS - POOR INSTALLATION WORKMANSHIP AND DURABILITY (EFIN)

Sample	% of Mobile Homes in Sample with Problem
HUD	2.5
Private	1.8
Field	1.2

Pertinent ANSI All9.1 References

1974

E19.1 Receptacle Outlets. All receptacle outlets shall be of the grounding type and shall be installed in accordance with Sections 210-7 and 210-21.b of the National Electrical Code (ANSI C1-1971; NFPA No. 70-1971).

1975

- E6.1 All receptacle outlets shall be:
 - (a) of grounding type;
 - (b) installed according to Section 210-7 of the National Electrical Code (NFPA No. 70-1974; ANSI C1-1974); and
 - (c) except when supplying specific appliances, be parallel-blade, 15 ampere, 125-volt, either single or duplex.

Note: For ground-fault circuit interrupter requirements, refer to Section 210-8(a) of the National Electrical Code (NFPA No. 70-1974; ANSI C1-1974).

<u>Discussion</u> - The problems associated with receptacle outlets can be classified into two categories: installation workmanship and durability. The substandard workmanship problems are related to inadequate electrical inspection during manufacturing. The Standard (E5.1-1974 Edition) simply states that devices "shall be listed by a nationally recognized testing agency" which does not necessarily insure long-term durability. This problem of inadequate durability is not unique to mobile homes within the housing area.

Recommendations

1. Improved in-plant inspection is required to reduce workmanship problems.

2. A study of durability of electrical devices, including receptacle outlets, should be initiated for all types of housing.

4.4.2 SERVICE GROUNDING - FAULTY INSTALLATION (EGSE)

This problem occurred predominately in the HUD Agnes units (HUD and Field Samples). It can possibly be attributed to the emergency conditions encountered with these units.

Sample	% of Mobile Homes in Sample with Problem
HUD	1.7
Private	0.6
Field	0.8

Pertinent ANSI Al19.1 References

1974

- E23.1 Service Grounding. Service grounding shall be accomplished as follows:
 - E23.1.1 The green-colored grounding wire in the supply cord or permanent feeder wiring shall be connected to the grounding bus in the distribution panelboard or disconnecting means.
 - E23.1.2 The distribution panelboard shall have a grounding bus, or approved grounding means for the various grounding connections.
 - E23.1.3 The grounding bus shall have sufficient terminals for all grounding conductors.

1975

E9.1 General. Grounding of both electrical and nonelectrical metal parts in the mobile home shall be through connection to a grounding bus in the mobile home distribution panelboard. The grounding bus shall be grounded through the green-colored conductor in the supply cord or the feeder wiring to the service ground in the service-entrance equipment located adjacent to the mobile home location. Neither the frame of the mobile home nor the frame of any appliance shall be connected to the neutral conductor in the mobile home.

<u>Discussion</u> - Service grounding problems may be the result of improper initial installation of service wiring in mobile homes at the site. The possibility of loose connectors at the load center caused by vibration during transportation also exists. The ANSI Al19.1 Standard appears to be adequate in this regard.

Recommendation - A pre-occupancy inspection of mobile homes should include a check of the load center to make sure that all electrical connections are properly made.

4.4.3 RECEPTACLE OUTLETS - IMPROPER WALL LOCATION (ERLW)

The location of wall receptacles was routinely inspected in the field study. Mobile home occupants (HUD and Private Sample) would not generally recognize this as a problem.

Sample	% of Mobile Homes in Sample with Problem
HUD Private Field	1.8 10.9

Pertinent ANSI Al19.1 References

1974

E6.1 - Except in the bath and hall areas, receptacle outlets shall be installed at wall spaces 2 feet wide or more, so that no point along the floor line is more than 6 feet, measured horizontally, from an outlet in that space. Except as explained in the following, receptacle outlets are not required for wall spaces occupied by kitchen or wardrobe cabinets. In addition, a receptacle outlet shall be installed:

- (a) Over or adjacent to counter tops in the kitchen (at least one on each side of the sink if counter tops are on each side and 12 inches or over in width).
- (b) Adjacent to the refrigerator and free-standing gas-range space.
- (c) At counter top spaces for built-in vanities.
- (d) At counter top spaces under wall-mounted cabinets.

1975

E6.3 - Same as E6.1 (1974).

<u>Discussion</u> - This problem concerns the location of receptacle outlets which do not conform to the requirements of the Standard. It is strictly enforcement related (plan review and in-plant inspection).

Recommendation - Improve plan review and in-plant inspection.

4.4.4 BRANCH CIRCUITS REQUIRED - INADEQUATE CAPACITY FOR GENERAL APPLIANCES (EBCR3.)

Sample	% of Mobile Homes in Sample with Problem
HUD Private Field	5.3

Pertinent ANSI All9.1 References

1974

- E7.1.3 General Appliances (including Furnace, Water Heater, Range, and Central or Room Air Conditioner, etc.). There shall be one or more circuits of adequate rating in accordance with the following:
 - (a) Ampere rating of fixed appliances not over 50 percent of circuit rating if lighting outlets (receptacles, other than kitchen, dining area, and laundry, considered as lighting outlets) are on same circuit;
 - (b) For fixed appliances on a circuit without lighting outlets, the sum of rated amperes shall not exceed the branch-circuit rating for other than motor loads or 80 percent of the branch-circuit rating for air conditioning or other motor loads;
 - (c) The rating of a single portable appliance on a circuit having no other outlets shall not exceed 80 percent of the circuit rating;
 - (d) The rating of range branch circuit shall be based on the range demand as specified for ranges in Section 8 of this Part;
 - (e) Where laundry facilities are provided in a mobile home, a 20 ampere branch circuit shall be provided with a 20 ampere outlet within six feet of the intended location of the appliance.

1975

- E4.10 A 15-ampere multiple receptacle shall be acceptable when connected to a 20-ampere laundry circuit.
- E5.1.3 Same as E7.1.3 (1974).

<u>Discussion</u> - All reported problems in this category resulted from consumer complaints in the Private Sample. The majority of these problems are attributed to inadequate circuit ampere rating for general appliances. The problems with laundry facility circuitry was either that the circuit was nonexistent, was too low an amperage rating or the provided outlet was not within the specified distance from the laundry appliance. The ANSI All9.1 Standard is clear in this regard and the problems can be attributed to inadequate electrical inspection during the manufacturing process or inadequate plan review prior to manufacturing.

Recommendation - The Standard should be enforced by improved plan review and in-plant inspection procedures.

4.4.5 WALL SWITCHES - IMPROPER CONNECTION AND INADEQUATE DURABILITY (ESWL)

Sample	% of Mobile Homes in Sample with Problem
HUD	1.0
Private	1.3
Field	0.8

Pertinent ANSI Al19.1 References

1974

E5.1 - Electrical materials, devices, appliances, fittings and other equipment installed, intended for use in, or attached to the mobile home shall be listed by a nationally recognized testing agency and shall be connected in an approved manner when in service. Facilities shall be provided to securely fasten appliances when the mobile home is in transit. (See Section 23 for provisions on grounding.)

E18.1 - Switches shall be rated as follows:

- (a) For lighting circuits, switches shall be rated not less than 10 amperes-125 volts and in no case less than the connected load.
- (b) For motors or other loads, switches shall have ampere or horsepower ratings or both adequate for loads controlled (An "AC general use" snap switch may control a motor 2 horsepower or less with full-load current not over 80 percent of the switch ampere rating.)

1975

E7.1 - Electrical materials, devices, appliances, fittings, and other equipment installed, intended for use in, or attached to the mobile home shall be approved for the application and shall be connected in an approved manner when in service. Facilities shall be provided to securely fasten appliances when the mobile home is in transit. (See Section 9 for provisions on grounding.)

E8.8 - Switches shall be rated as follows:

- (a) For lighting circuits, switches shall have a 10-ampere, 120-125 volt rating; or higher if needed for the connected load.
- (b) For motors or other loads, switches shall have ampere or horsepower ratings, or both, adequate for loads controlled. (An "AC general-use" snap switch shall be permitted to control a motor 2 horsepower or less with full-load current not over 80 percent of the switch ampere rating.)

<u>Discussion</u> - Problems associated with switches can be classified into two categories, namely, workmanship (hook-up or connection) and durability. Workmanship problems can be attributed to inadequate electrical inspection during the manufacturing process. As to durability, the ANSI Al19.1 Standard simply states that devices "shall be listed by a nationally recognized testing laboratory" which does not necessarily assure durability.

Recommendations

- 1. The enforcement process (plan review and in-plant inspection) should be improved to insure that equipment is installed in a proper manner.
- 2. A study of durability of electrical devices, including switches, should be initiated for all types of housing.

4.4.6 CABLE SUPPORT - INSUFFICIENT CABLE SUPPORT (EWSU)

Sample	% of Mobile Homes in Sample with Problem
HUD Private Field	 2.7 5.8

Pertinent ANSI Al19.1 References

1974

E11.9 - Cables shall be supported within 12 inches of outlet boxes, the service entrance box, and splice boxes on appliances. Supports are required every 4-1/2 feet at other places.

1975

E8.1 - Except as specifically limited in this Part, the wiring methods and materials specified in the National Electrical Code (NFPA No. 70-1974; ANSI C1-1974) shall be used in mobile homes.

<u>Discussion</u> - These problems relate to cable support techniques which do not meet the requirements of Ell.9 (1974 edition.) The reference to NEC in E8.1 (1975 edition) removes specific cable support requirements by calling for good workmanship.

A specific problem observed during the field study related to cable support was the passing of electrical wiring and water supply piping through the same small wall penetration without any attempt at isolation of the two.

Recommendations

- 1. Improved in-plant inspection of electrical wiring methods are needed.
- 2. The ANSI Al19.1 Standard-1975 should be revised back to the same as it was in ANSI Al19.1-1974 which clearly defines support requirements for cables.
- 3. The following requirement should be added to Part C Plumbing Systems:
 - "C5.2.6 <u>Piping Location</u>. Piping and electrical wiring shall not pass through the same holes in walls, floor or roof. Plastic piping shall not be exposed to excessive heat or radiation from the flame of hot water heaters."

4.4.7 ELECTRICAL MARKING - IMPROPER MARKING OF FUSES AT DISTRIBUTION CENTER (EMKE)

Markings of distribution centers were not inspected during the field study or reported by occupants of units in the HUD Sample. Enforcement officials (Private Sample) did routinely inspect for proper marking.

Sample	% of Mobile Homes in Sample with Problem
HUD	
Private	3.6
Field	

Pertinent ANSI Al19.1 References

1974

- E25.1 The main circuit breakers or fuses shall be plainly marked "Main."
- E25.2 If a fused distribution panel is used, the maximum fuse size for the mains shall be plainly marked as follows, with lettering at least 1/4 inch high where visible when fuses are changed: "Maximum Main Fuses 40 (or 50) amp."

1975

E4.1 The branch-circuit equipment shall be permitted to be combined with the disconnecting means as a single assembly. Such a combination shall be permitted to be designated as a distribution panelboard. If a fused distribution panelboard is used, the maximum fuse size for the mains shall be plainly marked with lettering at least 1/4-inch high and visible when fuses are changed.

Note: See Section 110-22 of the National Electrical Code (NFPA No. 70-1974; ANSI C1-1974) concerning identification of each disconnecting means and each service, feeder, or branch circuit at the point where it originated and the type marking needed.

<u>Discussion</u> - This problem concerns inadequate marking of the maximum size of main fuses at the distribution center. These problems are an indication of inadequacies in the enforcement process (plan review or in-plant inspection) since the ANSI All9.1 Standard is clear as to the type and size of markings required.

Recommendation - The enforcement process (plan review and in-plant inspection) should be improved.

4.4.8 DISCONNECTION MEANS AND BRANCH CIRCUITS - MALFUNCTIONS AND IMPROPER MARKINGS AND INSTALLATION OF DISTRIBUTION PANELBOARDS (EDIS)

Sample	% of Mobile Homes in Sample with Problem
HUD Private Field	3.4 1.6

Pertinent ANSI All9.1 References

1974

E9.1 Mobile homes shall contain a distribution panelboard having a main overcurrent protective device rated not in excess of the current carrying capacity of the feeder assembly, installed with supply cord and branch circuits wired at the factory.

- E9.2 The distribution equipment, either circuit breaker or fuse type, shall be located a minimum of 24 inches from the floor level of the mobile, measured to the bottom of the equipment or shall be specifically approved for the purpose.
- E9.5 A distribution panelboard main circuit-breaker shall be rated 50 amperes and employ a 2-pole circuit breaker rated 40 amperes for a 40-ampere supply cord, or 50 amperes for a 50-ampere supply cord. A distribution panelboard employing a disconnect switch and fuses shall be rated 60 amperes and shall employ a single 2-pole, 60-ampere fuseholder with 40-or 50-ampere main fuses for 40- or 50-ampere supply cords, respectively. The outside of the distribution panelboard shall be plainly marked with the fuse size. The main circuit breakers or fuses shall be plainly marked "Main."
- E9.8 Overcurrent protection shall be provided for branch circuits and feeders in accordance with Article 240 of the National Electrical Code (ANSI C1-1971; NFPA No. 70-1971) as applicable. The branch circuit overcurrent devices shall be rated:
 - (a) not more than the circuit conductors; and
 - (b) not more than 150 percent of the rating of a single appliance rated 10 amperes or more which is supplied by an individual branch circuit but
 - (c) not more than the fuse size marked on the air conditioner or other motoroperated appliance.
- E 9.10 When circuit breakers are provided for branch-circuit protection, 230-volt circuits shall be protected by 2-pole common or companion trip, or handle-tied paired circuit breakers.

1975

E4.1 - The branch-circuit equipment shall be permitted to be combined with the disconnecting means as a single assembly. Such a combination shall be permitted to be designated as a distribution panelboard. If a fused distribution panelboard is used, the maximum fuse size for the mains shall be plainly marked with lettering at least 1/4-inch high and visible when fuses are changed.

Note: See Section 110-22 of the National Electrical Code (NFPA No. 70-1974; ANSI C1-1974) concerning identification of each disconnecting means and each service, feeder, or branch circuit at the point where it originated and the type marking needed.

- E4.6 A distribution panelboard main circuit breaker shall be rated 50 amperes and employ a 2-pole circuit breaker rated 40 amperes for a 40-ampere supply cord, or 50 amperes for a 50-ampere supply cord. A distribution panelboard employing a disconnect switch and fuses shall be rated 60 amperes and shall employ a single 2-pole, 60-ampere fuseholder with 40-or 50-ampere main fuses for 40- or 50-ampere supply cords, respectively, The outside of the distribution panelboard shall be plainly marked with the fuse size.
- E4.9 The branch circuit overcurrent devices shall be rated:
 - (a) not more than the circuit conductors; and
 - (b) not more than 150 percent of the rating of a single appliance rated 10 amperes or more which is supplied by an individual branch circuit; but
 - (c) not more than the fuse size marked on the air conditioner or other motor-operated appliance.
- E4.11 When circuit breakers are provided for branch-circuit protection, 230-volt circuits shall be protected by 2-pole common or companion trip, or handle-tied paired circuit breakers.

<u>Discussion</u> - The problems placed in this category were miscellaneous problems concerning the distribution panelboard, inadequately marked branch circuits and panelboards located too close to the floor. These are enforcement problems related to inadequate in-plant inspection since the ANSI Al19.1 Standard is quite specific in these areas.

Recommendation - More stringent in-plant inspection procedures for electrical installations should be implemented.

4.4.9 CABLE PROTECTION - INADEQUATE PROTECTION MEASURES (EWPR)

Units in the field study were routinely inspected for adequate cable protection as were most units in the Private Sample. Mobile home occupants (HUD Sample) would not generally recognize this as a problem.

Sample	% of Mobile Homes in Sample with Problem
HUD	
Private	2.6
Field	1.6

Pertinent ANSI Al19.1 References

1974

E11.12 - Normetallic cable located 15 inches or less above the floor, if exposed, shall be protected from physical damage by covering boards, guard strips, or conduit. Cable likely to be damaged by stowage shall be so protected in all cases.

1975

E8.3 - Same as E11.12 (1974).

<u>Discussion</u> - Since the Standard clearly states that cables must be protected if located within 15 inches of the floor, this problem may be attributed to inadequate electrical inspection during manufacturing (enforcement process) or improper design.

Recommendation - The in-plant inspection program for evaluating wiring methods should be improved.

4.4.10 PASSING OF CABLE THROUGH WALL STUDS - INADEQUATE PROTECTION (EWPS)

This item was routinely inspected during the field study.

Sample	% of Mobile Homes in Sample with Problem
HUD	
Private	0.4
Field	9.7

Pertinent ANSI All9.1 References

1974

E11.7 - Metal-clad and nonmetallic cables may be passed through the centers of the wide side of 2 by 4 studs. However, they shall be protected where they pass through 2 by 2 studs or at other studs or frames where the cable or armor would be less than 1-1/2 inches from the inside or outside surface. Steel plates on each side of the cable, or a tube, with not less than No. 16 manufacturer's standard gage wall thickness, are required to protect the cable. These plates or tubes shall be securely held in place.

1975

E8.4 - Metal-clad and nonmetallic cables shall be permitted to pass through the centers of the wide side of 2-inch by 4-inch studs. However, they shall be protected where they pass through 2-inch by 2-inch studs or at other studs or frames where the cable or armor would be less than 1-1/2 inches from the inside or outside surface. Steel plates on each side of the cable, or a tube, with not less than No. 16 MSG wall thickness shall be required to protect the cable. These plates or tubes shall be securely held in place.

<u>Discussion</u> - This problem involves inadequate protection of electrical cables passing through wall studs. The Standard is specific in this regard and the problem is a result of inadequate electrical inspection during manufacturing (enforcement process).

Recommendation - The in-plant inspection program for evaluating wiring methods should be improved.

4.4.11 LISTED AND APPROVED DEVICES - LOOSE CONNECTIONS (ERXY1.)

The tightness of electrical connections was routinely inspected in the field study.

Sample	% of Mobile Homes in Sample with Problem
HUD	
Prívate	0.2
Fíeld	7.4

Pertinent ANSI Al19.1 References

1974

- E5.1 Electrical materials, devices, appliances, fittings, and other equipment installed, intended for use in, or attached to the mobile home shall be listed by a nationally recognized testing agency and shall be connected in an approved manner when in service. Facilities shall be provided to securely fasten appliances when the mobile home is in transit. (See Section 23 for provisions on grounding.)
- E17.1 Connection of conductors to terminal parts shall ensure a thoroughly good connection without damaging the conductors and shall be made by means of pressure connectors (including set screw type), solder lugs, or splices to flexible leads. No. 8 or smaller solid connectors and No. 10 or smaller stranded conductors may be connected by means of clamps or screws with terminal plates having upturned lugs, or by means of approved screwless terminals. Terminals for more than one conductor shall be of a type approved for the purpose.

1975

- E7.1 Electrical materials, devices, appliances, fittings, and other equipment installed, intended for use in, or attached to the mobile home shall be approved for the application and shall be connected in an approved manner when in service. Facilities shall be provided to securely fasten appliances when the mobile home is in transit. (See Section 9 for provisions on grounding.)
- E8.1 Except as specifically limited in this Part, the wiring methods and materials specified in the National Electrical Code (NFPA No. 70-1974; ANSI C1-1974) shall be used in mobile homes.

<u>Discussion</u> - The loose connections occurred mainly at the wire connection to duplex outlets or switches that were made at the binding head screws. In some cases, it was obvious that little or no attempt was made to tighten the binding head screws on the devices which is not only poor workmanship, but also gross negligence.

Recommendation - The in-plant inspection part of the enforcement process should be improved to ensure that good electrical wiring practices are being used.

4.4.12 LISTED AND APPROVED - ALUMINUM/COPPER DEVICES USE WITH ALUMINUM WIRING (ERXY11.)

The compatibility of the electrical devices and wiring was routinely inspected in the field study.

Sample	% of Mobile Homes in Sample with Problem
HUD Private Field	0.1 7.0

Pertinent ANSI Al19.1 References

1974

E5.1 - Electrical materials, devices, appliances, fittings, and other equipment installed, intended for use in, or attached to the mobile home shall be listed by a nationally recognized testing agency and shall be connected in an approved manner when in service. Facilities shall be provided to securely fasten appliances when the mobile home is in transit. (See Section 23 for provisions on grounding.)

1975

E7.1 - Electrical materials, devices, appliances, fittings, and other equipment installed, intended for use in, or attached to the mobile home shall be approved for the application and shall be connected in an approved manner when in service. Facilities shall be provided to securely fasten appliances when the mobile home is in transit. (See Section 9 for provisions on grounding.)

<u>Discussion</u> - This problem is concerned with the practice of using electrical devices which are not specifically approved for use with aluminum wire.

Recommendation - Follow the expected lead of the National Electrical Code concerning the use of special devices with aluminum wire when their position on the subject is clarified.

4.4.13 WIRING PRACTICES - INADEQUATE CONTINUITY OF CABLE SHEATH (EWCS)

Sample	% of Mobile Homes in Sample with Problem
HUD	
Private	0.4
Field	1.9

Pertinent ANSI All9.1 References

1974

E11.6 - The sheath of nonmetallic cable or the armor of metal-enclosed cable shall be continuous between outlet boxes and other enclosures.

1975

E8.1 - Except as specifically limited in this Part, the wiring methods and materials specified in the National Electrical Code (NFPA No. 70-1974; ANSI C1-1974) shall be used in mobile homes.

<u>Discussion</u> - The ANSI Al19.1-1974 Standard clearly states that cable sheath "shall be continuous between outlet boxes and other enclosures." The ANSI Al19.1-1975 is not as specific but refers to the National Electrical Code where the requirements are similar. The problem is related to the enforcement process (inadequate electrical inspection during manufacture). It is also an example of poor workmanship.

Recommendation - The in-plant inspection part of the enforcement process must be improved to ensure that good electrical wiring practices are being used.

5.0 DURABILITY RELATED PROBLEMS

Problems of a durability nature are quite prevalent in the mobile home performance data accumulated during this project. Many of these problems have already been discussed in Sections 3.0 and 4.0 since they are, in some cases, closely related to the four major problem subsections established to categorize the data (ANSI Al19.1, Enforcement Process, Mechanical/Electrical Appliances and Routine Maintenance).

5.1 WINDOW (NCWD) AND DOOR HARDWARE (NCXH AND NCPH)

	% of Mobile Homes in Sample with Problem		
Sample	Exterior Door	Partition Door	Window
HUD Private Field	26.2 8.3 24.5	3.4 7.9 5.4	6.8 12.2 5.8

<u>Discussion</u> - Data from the Routine Maintenance Subsection indicated that the most troublesome hardware problems were associated with exterior doors. Window closing mechanisms and latches exhibited the most problems followed by partition door hardware.

ANSI Al19.1-1975 does not include a reference specification for either exterior door locks or partition door hardware which may be a contributing factor to the poor performance indicated by the data. There is an existing specification for Locks and Lock Trim (ANSI Al56.2-1975) which could be referenced in ANSI Al19.1.

In the case of windows, ANSI Al19.1-1975 does reference (B8.5.1) MHMA Specification No. 1-71-Rev. 1973, "Window Specification for Utilization in Mobile and Factory Built Housing." This specification was developed primarily for energy conservation and weather resistance concerns. Performance requirements which would insure window hardware durability are not included. There is a proposed American National Standard, ANSI Al34.5, "Specifications for Aluminum Mobile Home Windows" which does contain such performance requirements.

Recommendations

- 1. Reference ANSI A156.2-1975, "American National Standard for Locks and Lock Trim" in ANSI A119.1.
- 2. When approved as an American National Standard, reference ANSI Al34.5, "Specification for Aluminum Mobile Home Windows," in ANSI Al19.1.

5.2 FLOOR COVERING (FDUR1.)

As mobile home owners, occupants of Private Sample units would be more concerned with floor covering durability than the occupants of HUD or Field Sample units which were rented.

Sample	% of Mobile Homes in Sample with Problem
HUD	1.0
Private	13.3
Field	3.5

<u>Discussion</u> - Durability and workmanship problems were encountered with sheet vinyl floor coverings and carpeting. The sheet vinyl problems almost exclusively involved buckling of the floor covering at joints of the particle board decking. Carpeting problems, which comprised the greater percentage of the complaints, had to do with poor quality of materials. ANSI Al19.1 Standard does not include specifications which would insure minimum quality of floor coverings.

Recommendation - Floor covering specifications of HUD/FHA Minimum Property Stnadards (MPS) [8] should be incorporated into ANSI All9.1.

5.3 EXTERIOR DOORS (DEDU)

Sample	% of Mobile Homes in Sample with Problem
HUD	0.1
Private	3.6
Field	2.7

<u>Discussion</u> - The durability problems encountered involved deterioration and delamination of facing materials; including aluminum, wood, hardboard and vinyl. The majority of these problems were encountered in the Private and Field Samples. As discussed in 3.1.6, ANSI Al19.1-1975 does not include a door specification. Proposed MHMA Spec. 3-74, "Exterior Passage Door Specification for Utilization in Mobile and Factory Built Housing," does not include performance tests which would evaluate durability. It is similar to the performance criteria in the HUD/FHA Minimum Property Standards for doors, windows and glazing, which covers only air leakage, water infiltration, and physical load testing.

<u>Recommendation</u> - Methods should be developed for evaluating durability characteristics of exterior doors which would be applicable to all types of housing.

5.4 APPLIANCES AND MECHANICAL EQUIPMENT

5.4.1 <u>General</u>. Durability of appliances (furnace, range, refrigerator, hot water heater, etc.) is covered only very generally in the ANSI Al19.1 Standard with the statement that appliances shall be "listed or certified by a nationally recognized testing agency for use in mobile homes." The definition of "listed," given in Parts D and E of the Standard is, "Equipment or materials included in a list published by a nationally recognized testing laboratory that maintains periodic inspection of production of listed equipment or materials and whose listing states either that the equipment or material meets nationally recognized standards or has been tested and found suitable for use in a specified manner."

An in-depth analysis of existing standards for appliances in regard to durability is beyond the scope of this study. As a comparison, standards for furnaces, hot water heaters, ranges, refrigerators and clothes dryers, as outlined in the HUD/FHA MPS and ANSI All9.1, are presented in Table 22. The standards presented in ANSI All9.1 are more extensive than those in the MPS and no correlation between the two is evident for any of the appliances. This is understandable for furnaces since they are generally designed specifically for mobile homes and tend to differ considerable from those used in conventional housing. However, some correlation between MPS and ANSI All9.1 could be expected for hot water heaters since similar appliances are used in both types of housing.

The other major appliances found in mobile homes and conventional houses (ranges and refrigerators) are essentially not covered in either standard. ANSI All9.1 does give a specification for commercial cooking equipment and refrigerators using gas fuel, but not for refrigerators. The MPS does not cover standards for ranges or refrigerators.

5.4.2 Problem Distribution. Problems associated with mechanical/electrical appliances and equipment accounted for 5,508 (17.2%) of the total number of problems (31,982) categorized for all samples. The distribution of these 5,508 problems for the Private, Field and HUD Samples can be seen in Tables 11, 16 and 19. Mechanical/electrical appliance and equipment problems were found in 52.8% of all mobile homes in the three samples.

Table 23 presents the rank ordering of problem occurrence for the combined sample by component as follows: furnace, hot water heater, range, exhaust fan, refrigerator, smoke detector, and electrical baseboard heating units. A further breakdown of problem occurrences associated with the three most troublesome components (furnaces, hot water heaters and ranges) are presented in Figures 5, 6, 7 and 8.

6.0 SUMMARY COMMENTS AND RECOMMENDATIONS

This project was undertaken by the National Bureau of Standards at the request and sponsorship of the Division of Energy, Building Technology and Standards of the Department of Housing and Urban Development with the objective of documenting mobile home performance problems and relating them to possible inadequacies in the ANSI Al19.1 Standard for Mobile Homes and the mobile homes enforcement process. Additionally, the durability of mobile home components was a study objective for potential use in mortgage insurance evaluation.

The data presented in this report and in references [2], [3] and [4] represent a significant base of information from which the above objectives can be addressed. It should be pointed out that the number of mobile homes included in this study is small when compared to the total number of units now occupied in the United States. Also, the emphasis in this project, by design, was to concentrate on reported mobile home problems and does not reflect the large number of mobile home occupants who have been satisfied with the performance of their units. A problem oriented study of this type on conventional housing would probably be just as revealing.

Problem data were separated into five different categories, as described in Appendix A and presented in Appendices B, C and D, for the three data samples. These were related to (1) ANSI All9.1 Standard for Mobile Homes, (2) Mobile Home Enforcement Process, (3) Routine Maintenance, (4) Mechanical/Electrical Appliances, and (5) Miscellaneous. In many cases, a performance problem could be related to more than one of these categories. A judgment was made by the project staff as to which major category a problem should be placed. The problem discussions in Sections 3.0, 4.0 and 5.0 attempt to touch on the various reasons for the problem occurrence.

Problems placed in the ANSI All9.1 category indicated areas where the Standard was inadequate or where omissions were evident. The major problem areas in the Construction system were rain leaks, failure of interior paneling attachment, inadequate bottomboard durability, corrosion of exterior fasteners, and excessive metal roof membrance flexibility (roof rumble.) Plumbing problems included questionable quality of fixtures, loose fixture connections, watertightness of shower enclosures, and freezing of piping. Heating and electrical problems in the ANSI All9.1 category consisted of questionable location of furnace thermostat and inadequate fastening of electrical boxes.

The Mobile Home Enforcement category included problems which indicated deficiences in the mobile home regulatory process (plan and specification review, certification, and in-plant inspection.) In the Construction area, this included instances where thermal insulation in the walls and roof were found missing or improperly installed. Typical problems in the Plumbing area included piping water leaks, inadequate grade (slope) of drain pipe, water heater relief valve drain problems, and corrosion of piping. Heating system problems included use of unlisted or inadequately installed components, inadequate accessibility of appliances, joints of supply and vent systems not airtight, inadequate separation of combustion air system, inadequate marking of appliances and improper flexible gas connector usage. Electrical problems included lack of durability and long-term performance of devices, improper location of receptacles and devices, inadequate number of branch circuits, and problems related to workmanship such as insufficient cable support, inadequate cable protection, etc.

Problems related to durability of mobile home components are discussed in Section 5.0. Most of the problems in the Mechanical/Electrical Appliance category are included in this discussion. While many of the problems in the Routine Maintenance category were of a normal wear and tear nature, of the types expected in all types of housing, some were related to durability and were also included in Section 5.0.

The body of this report contains many specific recommendations on revisions to the ANSI All9.1 Standard for Mobile Homes and suggested improvements in the mobile home enforcement process. However, many of the identified problems point out that the state-of-the-art at this time will not permit a specific recommended solution. The following comments and recommendations are submitted in response to this obvious need for additional mobile home research:

- 1. The forces resulting from transportation and site set-up of the mobile home are not documented sufficiently to allow incorporation of specific design criteria into the ANSI All9.1 Standard for Mobile Homes. Throughout this report, the effect of these forces on the construction, plumbing, heating and electrical systems are implied but cannot be specifically substantiated. It is recommended that a research program be initiated to determine the effect of transportation and set-up on mobile home performance.
- 2. The effect of wind forces on mobile homes, both during transportation and on site, are unknown. The configuration of the mobile homes and siting conditions differ considerably from other structures making it difficult to apply results of available wind research. It is recommended that a research program be initiated to determine the magnitude and distribution of wind forces on mobile homes as well as the response of the structural system to expected wind forces. Available mobile home wind research data are quite limited.
- 3. Available data indicate that mobile homes are subjected to deteriorative forces after leaving the factory and prior to occupancy due to transportation and site set-up. It is recommended that a required inspection be considered for mobile homes after set-up and prior to occupancy to evaluate the adequacy of the construction, plumbing, heating and electrical systems. This could include an evaluation of the following which were documented in this study to be problem areas: tightness of the heating vent system; electrical system for shorts; plumbing system for gas, oil or water leaks; tie-down system; and the operation of plumbing fixtures and appliances. Since the enforcement process is generally accomplished at the state or local level, a handbook outlining this pre-occupancy inspection procedure should be developed for national use.
- 4. The problems related to the mobile home enforcement process were associated with inadequate plan/specification review or in-plant inspection. A uniform procedural guide for these phases of the process should be established for national use.

- 5. The data presented in this report suggests that durability of mobile home components is a problem. However, there are few existing standards available within the housing industry which provide for evaluation of long-term durability performance of components such as door hardware, plumbing fixtures, and electrical devices. The development of such standards should be encouraged.
- 6. The ANSI All9.1 Standard for Mobile Homes consists of a combination of performance and prescriptive type requirements. Prescriptive requirements are generally written around systems, components or materials that are currently in use. This approach tends to freeze technology and discourage the use of innovative concepts. The further application of the performance approach to mobile home standards could allow the mobile home industry, which is quite competitive and receptive to cost effective innovations to produce a quality product which could be purchased by a larger segment of the population.

References

- [1] ANSI All9.1 (NFPA 501B) "Standard for Mobile Homes," National Fire Protection Association, Boston, Massachusetts.
- [2] J.H. Pielert, W.E. Greene, L.F. Skoda, W.G. Street; Performance of Mobile Homes -Data Acquisition and Analysis Methodology; National Bureau of Standards (U.S.) NBSIR 75-641, February 1975 (NTIS Accession No. COM-75-11209).
- [3] W.G. Street, W.E. Greene, J.H. Pielert, L.F. Skoda; A Compilation of Problems Related to the Performance of Mobile Homes; National Bureau of Standards (U.S.) NBSIR 75-690, April 1975 (NTIS Accession No. COM-75-11207).
- [4] L.F. Skoda, J.H. Pielert, W.E. Greene, W.G. Street; Performance of Mobile Homes A Field Inspection Study; National Bureau of Standards (U.S.) NBSIR 75-688, June 1975 (NTIS Accession No. COM-75-11222).
- [5] ANSI All9.3 "Standard for Mobile Home Parks," National Fire Protection Association, Boston, Massachusetts.
- [6] P.W. Cooke, L.P Zelenka, H.K. Tejuja; Mobile Home Construction Standards Adopted by State Regulatory Programs - An Analysis; National Bureau of Standards (U.S.) NBSIR 75-680, March 1975 (NTIS Accession No. COM-75-10423).
- [7] P.W. Cooke, H.K. Tejuja, R.D. Dikkers, L.P. Zelenka; State Building Regulatory Programs for Mobile Homes and Manufactured Buildings A Summary; National Bureau of Standards (U.S.) Technical Note 853, September 1974.
- [8] HUD Minimum Property Standards Volume 1 (One and Two Family Dwellings), U. S. Department of Housing and Urban Development Publication 4900.1, 1973 Edition.

Acknowledgement

The authors are indebted to many persons for contributions and guidance that made this report possible. Special thanks are given to NBS staff members who participated in the regulatory and field inspection activities and provided invaluable assistance in the data reduction effort. Staff members from the Center for Building Technology included R. Beausoliel, T. Ray and W. Niessing. E. Budnick and J. Scott of the Center for Fire Research provided expertise in Fire Protection Engineering and J. Peebles of the Plant Division was responsible for the electrical discipline. M. Vogt of Technical Analysis Division prepared the computer programs used for data analysis. J. Finnan and T. Porter, working under outside contracts, provided valuable support to important project tasks.

The cooperation of the staff of the Office of Emergency Preparedness (OEP) of the Department of Housing and Urban Development, both in Washington, D.C. and at Wilkes-Barre, Pennsylvania, contributed significantly to the success of this project. Mr. James McCollom of HUD, Office of Policy Development and Research, provided liaison between NBS staff and OEP operations personnel, as well as valuable technical advise resulting from a previous HUD study of the Hurricane Agnes mobile homes.

The authors are particularly grateful to the many Federal, State and private organizations who cooperated with the NBS study team by making mobile homes available for field inspection, as well as providing mobile home performance data.

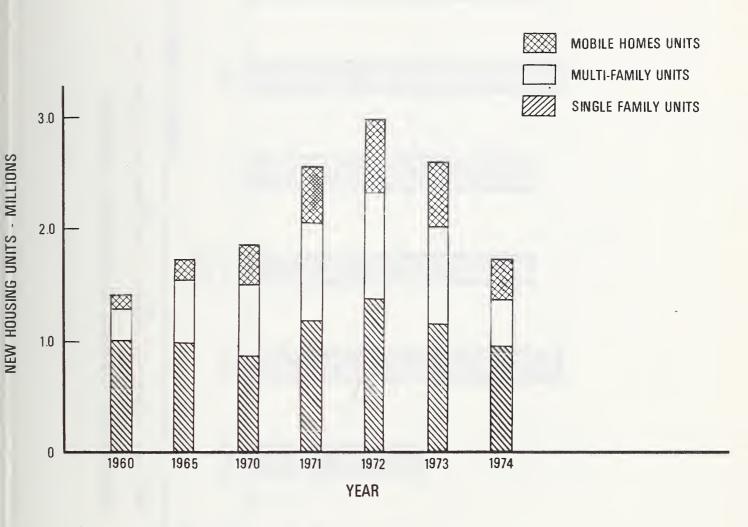


Figure 1 - New Housing Units Produced in U.S. Versus Year
Source: Bureau of the Census

Mobile Home Production as Percentage of New Single Family Housing Units Figure 2

SOURCE: U.S. CENSUS BUREAU

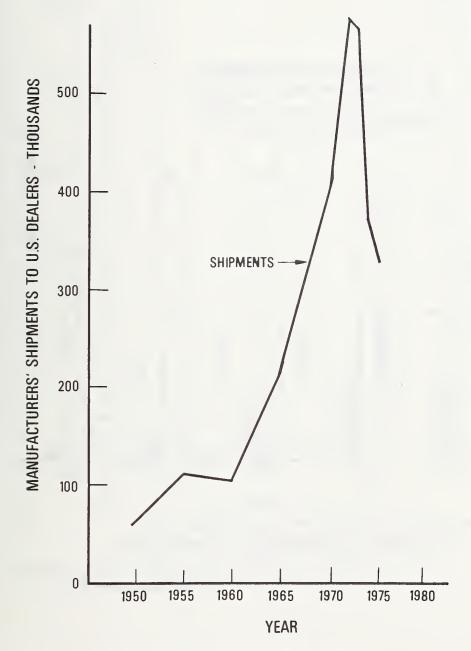


Figure 3 Mobile Home Shipments

Source: Manufactured Housing Institute "Quick Facts" 1974 Data

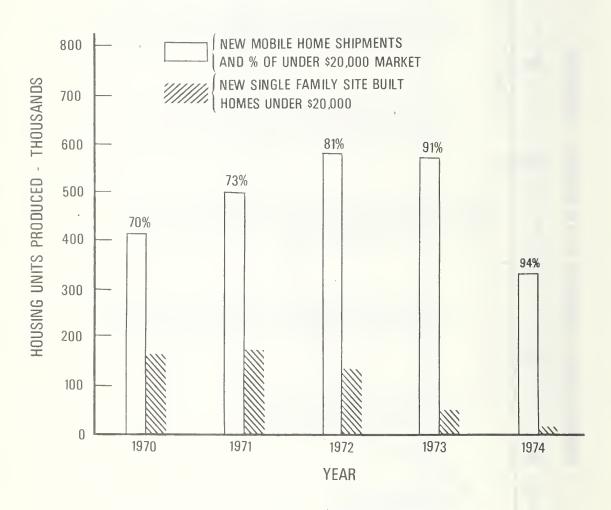


Figure 4 The Under \$20,000 New Home Market

Source: Manufactured Housing Institute
"Quick Facts" 1974 Data

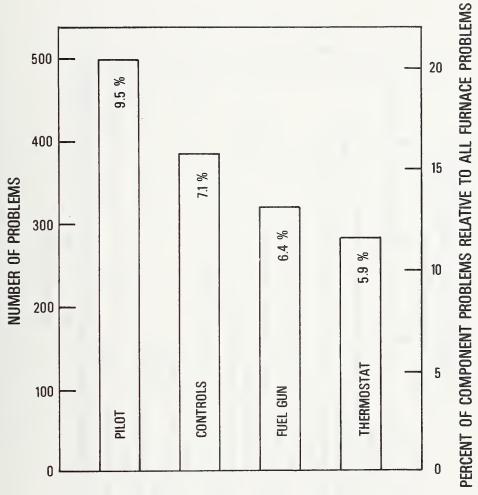


Figure 5 - Problem Distribution for Furnace Components (Total Sample)

- 1. Total sample includes HUD, Field, and Private Data
- Percentages in bars indicate portion of mobile homes in total sample with component problem

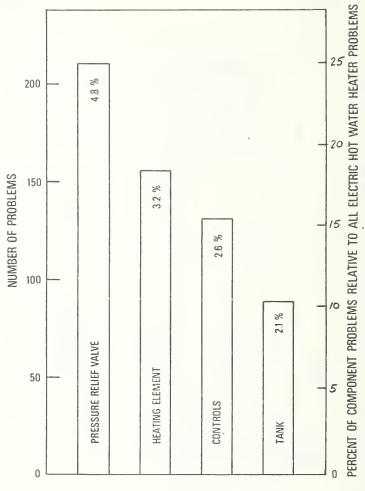


Figure 6 - Problem Distribution for Electric Water Heater Components (Total Sample)

- 1. Total sample includes HUD. Field, and Private Data
- Percentages in bars indicate portion of mobile homes in total sample with component problem

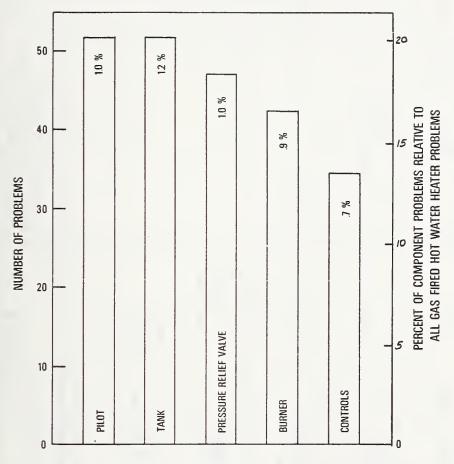


Figure 7 - Problem Distribution for Gas Fired Water Heaters (Total Sample)

- Total sample includes HUD, Field, and Private Data Percentages in bars indicate portion of mobile homes in total sample with component problem

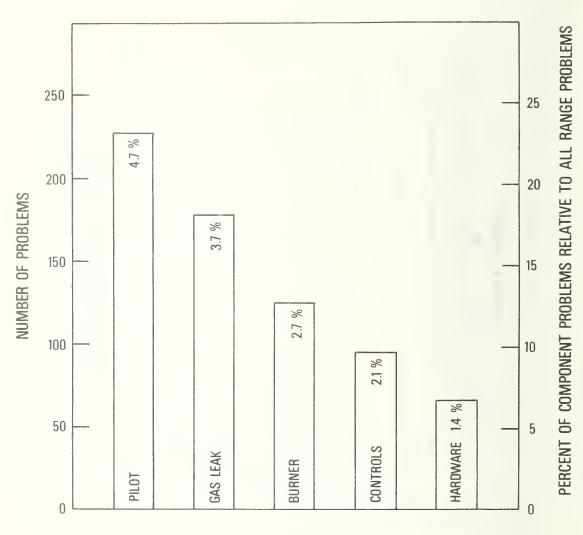


Figure 8 - Problem Distribution for Range Components (Total Sample)

- 1. Total sample includes HUD, Field, and Private Data
- Percentages in bars indicate portion of mobile homes in total sample with component problem

Table 1

Mobile Home Performance Problem Data Sources (PRIVATE SAMPLE)

Source and Location	Visit to Source Agency	Approximate Number of Mobile Home Cases Potentially Available (early 1974)	Number of Mobile Home Cases Obtained
Texas - Dept. of Labor and Standards - Mobile Home Div (Austin)	Yes	257	171
California - Dept. of Housing and Community Development - Div. of Codes and Standards - (Sacramento)	Yes	3,000	162
Arizona - Division of Building Codes - (Phoenix)	No	273	1
Florida - Dept. of Highway Safety and Motor Vehicles - (Tallahassee)	Yes	1,400	142
Virginia - Dept. of Agriculture and Commerce - Office of Consumer Affairs - (Richmond)	Yes	300	32
Georgia - Office of Comptroller General - State Fire Marshall - (Atlanta)	No	300	1
Louisiana - Office of the Governor - Office of Consumer Pro- tection - (Baton Rouge)	No	700	e e

Table 1 (con't)

Source and Location	Visit to Source Agency	Approximate Number of Mobile Home Cases Potentially Available (early 1974)	Number of Mobile Home Cases Obtained
Washington - Dept. of Labor and Industries - Mobile Home, Commercial Coach and Recreation- al Vehicle Section - (Seattle)	Yes	300	152
Veterans Administration Office - (Jacksonville, Florida)	Yes	250	47
Veterans Administration Regional Office - (Montgomery, Alabama)	Yes	125	70
Veterans Administration Center - (Jackson, Mississippi)	No	123	1
Alabama Farm Bureau - (Montgomery, Alabama)	Yes	200	199
American Mobilehome Association - (Lakewood, Colorado)	No	ĵ0	∞
Minnesota - Dept. of Administration - Building Code Division - (St. Paul)	No	25	6

 $\frac{\text{Table 2}}{\text{State of Manufacture and Number of Units}}$ For the Combined (HUD, Field and Private) $\frac{\text{Mobile Home Sample}}{\text{Mobile Home Sample}}$

State		Number of Units
Alabama		272
Alaska		2
Arizona		1
Arkansas		60
California		160
Colorado		4
Florida		168
Georgia		235
Idaho		31
Illinois		37
Indiana		329
Kansas		19
Kentucky		15
Louisiana		23
Maryland		4
Michigan		85
Minnesota		38
Mississippi		68
Missouri		6
New York		21
North Carolina		131
North Dakota		2
Ohio		65
Oklahoma		7
Oregon		61
Pennsylvania		307
South Carolina		52
South Dakota		2
Tennessee		40
Texas		151
Utah		2
Virginia		46
Washington		58
Wisconsin		6
Wyoming		1
Unknown	m - + - 1	1596
	Total	4105

<u>Table 3</u>

Year of Manufacture vs. Number of Units
Combined HUD, PRIVATE and FIELD SAMPLE

Year		No.	of	Units
•				
1974			32	
1973		,	382	
1972		17	791	
1971		2	208	
1970			18	
1969			4	
1968			1	
1965			2	
1962			2	
Unknown		16	665	
	Total	4	L05	

Table 4

Width vs. Number of Units
Combined HUD, PRIVATE and FIELD SAMPLE

Width		No. of Units
10.0 Feet		2
11.0 " 12.0 "		1
13.0 "		2366
14.0 "		84
16.0 "		1
20.0 " 24.0 "		17 284
Unknown		1348
	Total	4105

Table 5

Seals of Certifying Agency Combined HUD, PRIVATE and FIELD SAMPLE

Agency	Type of Agency	No. of Units with Seal
Alabama	State	336
Arkansas	11	1
California	11	161
Colorado	11	4
Delaware	11	ĺ
Florida	. 11	84
Georgia	· 11	75
Minnesota	11	8
Mississippi	11	12
Tennessee	11	14
Texas	11	124
Virginia	11	21
Washington	11	51
S		
	Total State Se	als 892
Pittsburgh Testing Lab. National Consumer Testing Lab.	Third Party	1 22
Underwriters Lab.	11 11	46
	m . 1 m . 1 m	
	Total Third Pa	erty 69
MHMA/TCA ½/	Trade Association	1326
HUD Specification 2/	Federal	449
Others (Misc.)		14
others (msc.)	Manufacturers, etc.	14
	Total Other Se	als 1789
	Total Seals	2750 3/
Units With	No Seals Attached $\frac{4}{5}$,	487
Units With	No Seal Information $\frac{5}{}$	1126

 $[\]frac{1}{2}$ Trade Association - Mobile Home Manufacturers Association and Trailer Coach Association.

 $[\]frac{2}{}$ HUD Purchase Contract required compliance with ANSI Al19.1

 $[\]frac{3}{2}$ Exceeds 2492 mobile homes with seals because some units have more than one seal.

Available data indicated that units had no attached seals.

 $[\]frac{5}{}$ No information available to indicate if mobile homes had seals.

TABLE 6

Problem Distributions Within All Samples*

Category of Problem	Private Sample	Field Sample	HUD Sample	
ANSI All9.1 Standard	36.7%	29.6%	19.1%	
Enforcement	28.9	30.5	10.3	
Routine Maintenance	24.0	26.5	45.7	
M/E Appliances & Equipment	5.9	10.6	21.4	
Miscellaneous	4.5	2.8	3.4	

 $\ensuremath{^{\star}}$ Percentages based on total number of problems in each sample.

TABLE 7

SUMMARY OF REPORTED MOBILE HOME PROBLEMS ALL CATEGORIES - PRIVATE DATA (967 UNITS)

CATEGORY OF		REPORTED		MOBILE HOME UNITS RE PROBLEMS IN CATEGORY	MOBILE HOME UNITS REPORTING PROBLEMS IN CATEGORY	AVERAGE NUMBER OF PROBLEMS PER UNIT IN SAMPLE
FROBLEM	Leve1	Number	% of Total	Number	% of Total Units	
ANSI STANDARD A119.1-1974	2	2280	36.7	808	83.6	2.36
ENFORCEMENT	2	1791	28.9	639	66.1	1.85
ROUTINE MAINTENANCE	2	1490	24.0	989	71.1	1.54
MECHANICAL/ELECTRICAL APPLIANCES AND EQUIPMENT	2	367	5.9	271	28.0	.38
MISCELLANEOUS	2	278	4.5	239	24.7	.29
(TOTAL)		(6206)	(100.0)	ţ	ı	6.42

TABLE 8
ANSI STANDARD A119.1 - 1974 RELATED PROBLEMS - PRIVATE DATA (967 UNITS)

ANSI STANDARD A119.1 - 1974 PART		ANSI STANDARD A119.1- 1974 RELATED PROBLEMS	DARD 974 ROBLEMS	MOBILE HOME UNITS WITH PROBLEMS	UNITS	AVERAGE NUMBER OF PROBLEMS PER UNIT IN SAMPLE
	Level	Level Number	% of Total	Number	% of Total Units	
PART B - Construction	3	1479	64.9	629	70.2	1.53
PART C - Plumbing	т	189	29.9	453	46.8	.71
PART E - Electrical	ю	61	2.7	54	5.6	90°
PART D - Heating	т	59	2.6	58	0.9	90°
(TOTAL)		(2280)	(100	1	1	2.36

TABLE 9

ENFORCEMENT RELATED MOBILE HOME PROBLEMS - PRIVATE DATA (967 UNITS)

ENFORCEMENT CATEGORY		ENFORCEMENT RELATED PROBLEMS	OBLEMS	MOBILE HOME UNITS WITH PROBLEMS	I UNITS	AVERAGE NUMBER OF PROBLEMS PER UNIT IN SAMPLE
	Level	Number	% of Total	Number	% of Total Units	
HEATING	е	533	29.8	302	31.2	.55
PLUMBING	æ	695	26.2	314	32.5	67*
ELECTRICAL	ю	463	25.9	299	30.9	.48
CONSTRUCTION	æ	326	18.2	235	24.3	.34
(TOTAL)		(1791)	(100.1)	ı	1	1.86

ROUTINE MAINTENANCE RELATED MOBILE HOME PROBLEMS - PRIVATE DATA (967 UNITS) TABLE 10

TABLE 11

MECHANICAL/ELECTRICAL APPLIANCES AND EQUIPMENT RELATED PROBLEMS - PRIVATE DATA (967 UNITS)

MECHANICAL/ELECTRICAL APPLIANCES AND EQUIPMENT COMPONENTS		MECHANICAL/ELECTR APPLIANCES AND EQUIPMENT RELATED PROBLEMS	MECHANICAL/ELECTRICAL APPLIANCES AND EQUIPMENT RELATED PROBLEMS	MOBILE HOME UI WITH PROBLEMS	MOBILE HOME UNITS WITH PROBLEMS	AVERAGE NUMBER OF PROBLEMS PER UNIT IN SAMPLE
	Level	Number	% of Total	Number	% of Total Units	
RANGE - GAS/ELECTRIC	3	112	30.5	97	10.0	.12
FURNACE, HOT AIR, GAS OR OIL	9	87	23.7	77	8.0	60°
EXHAUST FAN	3	72	19.6	7.1	7.3	.07
HOT WATER HEATERS	3	52	14.2	50	5.2	.05
REFRIGERATOR	3	32	8.7	28	2.9	.03
ELECTRIC BASEBOARD HEATING UNITS	3	П	ε.			00.
UNDEFINED	2	11	3.0	1	1	.01
(TOTAL)		(367)	(100.0)	Ī	t	.37

TABLE 12 SUMMARY OF REPORTED MOBILE HOME PROBLEMS - FIELD DATA (257 UNITS)

ALL CATEGORIES

CATEGORY		REPORTED	TED	MOBILE HOME UNITS REPORTING PROBLEMS IN CATEGORY	UNITS	AVERAGE NUMBER OF PROBLEMS PER UNIT IN SAMPLE
PROBLEM	Level	Number	% of Total	Number	% of Total Units	
ENFORCEMENT	2	1075	30.5	228	88.7	4.18
A NSI STANDARD A119.1-1974	2	1045	29.6	236	91.8	4.07
ROUTINE MAINTENANCE	2	934	26.5	169	65.8	3.63
MECHANICAL/ELECTRICAL APPLIANCES & EQUIPMENT	2	374	10.6	106	41.2	1.46
MISCELLANEOUS	2	100	2.8	53	20.6	.39
(TOTAL)		(3528)	(100.0)	ı	ı	13.73

TABLE 13

ENFORCEMENT RELATED MOBILE HOME PROBLEMS - FIELD DATA (257 UNITS)

ENFORCEMENT		ENFORCEMENT RELATED PROBLEMS	T	MOBILE HOME UNITS WITH PROBLEMS	ME UNITS LEMS	AVERAGE NUMBER OF PROBLEMS PER UNIT IN SAMPLE
CATEGORY	Level	Number	% of Total	Number	% of Total Units	
P LUMBING	9	493	45.9	183	71.2	1.92
HEATING	r	324	30.1	152	59.1	1.26
ELECTRICAL	m	189	17.6	114	4,4	.74
CONSTRUCTION	ю	69	6.4	61	23.7	.27
(TOTAL)		(1075)	(100.0)	ı	ı	4.19

TABLE 14

ANSI STANDARD A119.1 - 1974 RELATED PROBLEMS - FIELD DATA (257 UNITS)

ANSI STANDARD A119.1 - 1974 PART		ANSI STANDARD A119.1-1974 Related Proble	ANSI STANDARD A119.1-1974 Related Problems	MOBILE HOME UN WITH PROBLEMS	MOBILE HOME UNITS WITH PROBLEMS	AVERAGE NUMBER OF PROBLEMS PER UNIT IN SAMPLE
	Level	Number	% of Total	Number	% of Total Units	
PART B - Construction	3	199	63.3	228	88.7	2.57
PART C - Plumbing	3	208	19.9	108	42.0	.81
PART E - Electrical	es .	91	8.7	69	26.8	.35
PART D - Heating System	3	85	8.1	92	29.6	.33
(TOTAL)		(1045)	(100.0)	ı	ı	90°4

ROUTINE MAINTENANCE RELATED MOBILE HOME PROBLEMS - FIELD DATA (257 UNITS) TABLE 15

		ROUTINE M	ROUTINE MAINTENANCE	MOBILE HOME UNITS	UNITS	AVERAGE NUMBER OF
ROUTINE MAINTENANCE		RELATED PROBLEMS	ROBLEMS	WITH PROBLEMS	SME	PROBLEMS PER UNIT IN SAMPLE
C ATEGORY	Level	Level Number	% of Total	Number	% of Total Units	
CONSTRUCTION	3	550	58.9	143	55.6	2.14
P LUMBING	3	216	23.1	76	36.6	*8*
ELECTRICAL	3	124	13.3	74	28.8	87.
H EATING	3	44	4.7	34	13.2	.17
(TOTAL)		934	(100.0)	ı	ı	3,63

MECHANICAL/ELECTRICAL APPLIANCES AND EQUIPMENT RELATED PROBLEMS - FIELD DATA (257 UNITS) TABLE 16

AVERAGE NUMBER OF PROBLEMS PER UNIT IN SAMPLE		.70	.32	.28	.10	°04	.01	00°	1.45
Mobile Home Units With Problems	% of Total Units	30.0	20.2	14.0	5.4	3.5	1.2	7.	
Mobile Home U	Number	77	52	36	14	6	r	1	t
Mechanical/Electrical Appliances and Equipment Related Problems	% of Total	48,4	21.9	19.3	6.7	2.7	∞	ε,	(100.1)
Mechanical/Electr Appliances and Equipment Related Problems	Number	181	82	72	25	10	က	П	(374)
	Level	3	т	m	3	m	6	т	
MECHANICAL/ELECTRICAL APPLIANCES AND EQUIPMENT COMPONENTS		FURNACE, HOT AIR, GAS OR OIL	HOT WATER HEATERS	RANGE - GAS/ELECTRIC	EXHAUST FAN	REFRIGERATOR	SMOKE DETECTOR	ELECTRIC BASEBOARD HEATING UNITS	(TOTAL)

SUMMARY OF REPORTED MOBILE HOME PROBLEMS ALL CATEGORIES - HUD DATA (2881 UNITS) TABLE 17

CATEGORY		REPORTED PROBLEMS		MOBILE HOME UNITS RE PROBLEMS IN CATEGORY	MOBILE HOME UNITS REPORTING PROBLEMS IN CATEGORY	AVERAGE NUMBER OF PROBLEMS PER UNIT IN SAMPLE
PROBLEM	Level	Number	% of Total	Number	% of Total Units	
ROUTINE MAINTENANCE	2	10,178	45.7	2285	79.3	3.53
MECHANICAL/ELECTRICAL APPLIANCES AND EQUIPMENT	2	4767	21.4	1790	62.1	1.65
ANSI STANDARD A119.1-1974	2	4243	19.1	1628	56.5	1.47
ENFORCEMENT	2	2294	10.3	1265	43.9	08°
MISCELLANEOUS	2	766	3.4	527	18.3	.27
(TOTAL)		(22,248)	(6.99)	1	1	7.72

ROUTINE MAINTENANCE RELATED MOBILE HOME PROBLEMS - HUD DATA (2881 UNITS) TABLE 18

AVERAGE NUMBER OF PROBLEMS PER UNIT IN SAMPLE	tal	61.4 1.80	50.1 1.02	31.0	17.9	3.54
MOBILE HOME UNITS WITH PROBLEMS	% of Total Units	61	50	31	17	
MOBILE HOME UN WITH PROBLEMS	Number	1769	1443	893	515	1
INTENACE	% of Total	50.8	28.9	13.6	6.7	(100.0)
ROUTINE MAINTENACE RELATED PROBLEMS	Level Number	5175	2940	1382	681	(10,178)
	Level	3	3	3	6	
ROUTINE MAINTENANCE CATEGORY		CONSTRUCTION	PLUMBING	ELECTRICAL	HEATING	(TOTAL)

TABLE 19

MECHANICAL/ELECTRICAL APPLIANCES AND EQUIPMENT RELATED PROBLEMS - HUD DATA (2881 UNITS)

		-					1			
AVERAGE NUMBER OF PROBLEMS PER UNIT IN SAMPLE		.75	.50	.28	90°	.05	.01	00.	00.	1.65
E UNITS EMS	% of Total Units	39.3	32.6	18.9	2.8	9.4	1.2	7.	ı	ı
MOBILE HOME UNITS WITH PROBLEMS	Number	1133	686	544	168	133	35	12	-	1
MECHANICAL/ELECTRICAL APPLIANCES AND EQUIPMENT RELATED PROBLEMS	% of Total	45.0	30.3	16.6	3.8	3.2	8.	.3	0.	(100.0)
MECHANICAL/ELECTR APPLIANCES AND EQUIPMENT RELATED PROBLEMS	Number	2146	1444	792	180	153	37	13	2	(4767)
	Leve.1	3	3	3	3	3	3	3	2	
MECHANICAL/ELECTRICAL APPLIANCES AND EQUIPMENT	COMPONENTS	FURNACE, HOT AIR, GAS OR OIL	HOT WATER HEATERS	RANGE - GAS/ELECTRIC	EXHAUST FAN	REFRIGERATOR	SMOKE DETECTOR	ELECTRIC BASEBOARD HEATING UNITS	UNDEFINED	(TOTAL)

TABLE 20
ANSI STANDARD A119.1-1974 RELATED PROBLEMS - HUD DATA (2881 UNITS)

ANSI STANDARD A119.1-1974 PART		ANSI STANDARD A119.1-1974 RELATED PROBLEMS	DARD 74 ROBLEMS	MOBILE HOME UNITS WITH PROBLEMS	ME UNITS LEMS	AVERAGE NUMBER OF PROBLEMS PER UNIT IN SAMPLE
	Level	Number	% of Total	Number	% of Total Units	
PART B - Construction	3	2680	63.2	1236	42.9	.93
PART C - Plumbing	3	1563	36.8	959	33.3	.54
(TOTAL)		(4243)	(4243) (100.0)	ı	1	1.47

TABLE 21

ENFORCEMENT RELATED MOBILE HOME PROBLEMS - HUD DATA (2881 UNITS)

ENFORCEMENT CAT EGORY		ENFORCEMENT RELATED PROBLEMS	OBLEMS	MOBILE HOME UNITS WITH PROBLEMS	E UNITS EMS	AVERAGE NUMBER OF PROBLEMS PER UNIT IN SAMPLE
	Level	Number	% of Total	Number	% of Total Units	
PLUMBING	3	962	41.9	089	23.6	.33
CONSTRUCTION	3	623	27.2	473	16.4	.22
ELECTRICAL	3	490	21.4	391	13.6	.17
HEATING	3	219	9.5	201	7.0	80.
(TOTAL)		(2294)	(100.0)	I	ı	.80

Table 22 - Comparison of Appliance Standards Included in the Minimum Property Standards [8] and ANSI All9.1 Standard for Mobile Homes [1].

MPS A119.1 Furnaces UL-727 and 730 011 Liquid Fuel-Burning Heating UL 307(a) Appliances for Mobile 1969 Gas AGA Listed Homes and Travel Trailers Electric UL-573, NFPA-70 Gas-Heating Appliances for UL 307(a) Mobile Homes and Travel 1965 Trailers Gas-Fired Gravity and Forced Z21.47 Air Central Furnaces 1973 Gas-Fired Gravity and Fan Z21.48 Type Floor Furnace 1973 Gas-Fired Gravity and Fan Z21.44 Type Sealed Combustion 1973 System Wall Furnaces Installation of Oil Burning Z95.1 Equipment 1973 NFPA 31 1972 Installation of Gas Appliances, Z21.30 Gas Piping in Buildings 1964 NFPA 54 1969 Domestic Water Heaters UL-732 011 Commercial Gas-Fired and NSF-5 Electrically-Heated Hot 1959 Gas AGA Listed Water Generating Equipment Electric UL-174 Automatic Storage Type Water . Z21.10.1

Heaters with Input Less

than 75,000 BUTH

1971

Addenda

		
	Ranges	
NONE	Commercial Cooking and Warming Equipment	NSF-4 1967
	Household Cooking Gas Appliances	Z21.1 1972
	Refrigerators	
NONE	Refrigerators Using Gas- Fuel	Z21.19 1971
	Clothes Dryers	
NONE	Gas Clothes Dryers	A21.5.1 1972

TABLE 23

MECHANICAL/ELECTRICAL APPLIANCES - EQUIPMENT RELATED PROBLEMS - TOTAL SAMPLE (4105 UNITS)

MECHANICAL/ELECTRICAL APPLIANCES-EQUIPMENT COMPONENT		RELATED PROBLEMS	ROBLEMS	MOBILE HOME UNITS WITH PROBLEMS	ME UNITS LEMS	AVERAGE NUMBER OF PROBLEMS PER UNIT IN SAMPLE
	Level	Number	% of Total	Number	% of Total In Sample	
FURNACE, HOT AIR, GAS/OIL $1/$	ю	2414	43.8	1287	31.4	0.590
HOT WATER HEATERS $^{2/}$	3	1578	28.6	1041	25.4	0.380
RANGE – GAS/ELECTRIC $\frac{3}{}$	٣	976	17.7	677	16.5	0,240
EXHAUST FAN	9	277	5.0	253	6.2	0.070
REFRIGERATOR	٣	195	3.5	170	4.1	0.050
SMOKE DETECTOR	3	07	0.7	38	6.0	0.010
ELECTRIC BASEBOARD HEATING UNITS	3	15	0.3	14	0.3	0.004
UNDEFINED	2	13	0.2	ı	ı	
(TOTAL)		(5508)	(8.66)			1.344

 $\frac{1}{2}$ / For component problem distribution see Figure $\frac{5}{2}$. For component problem distributions see Figures $\frac{6}{2}$ and $\frac{7}{2}$.

Appendix A

Organization and Use of the Problem Summation Tables

Organization and Use of Problem Summation Tables

It was necessary to develop a data handling system using computer techniques because of the large quantity of data collected. The system devised consisted of a listing of performance problems, a coding technique to record the problems and computer programs to organize and present the data [2].

Organization of Problem Summation Tables

The Performance Problem List is organized around four major subsections and a miscellaneous subsection. The mobile home performance problems significant to the project are categorized under one of the four major subsections listed below and indicated in figure Al.

- A. Problems Related to ANSI All9.1 Standard for Mobile Homes
- B. Problems Related to Mobile Home Enforcement Process
- C. Routine Maintenance Problems
- D. Mechanical/Electrical Appliance Problems

This categorization of problems allows documentation of all mobile home performance problems obtained from the various sources.

The ANSI Al19.1 Standard for Mobile Homes subsection represents virtually the entire 1974 edition of the Standard [1], with coding symbols being assigned to appropriate paragraphs. In the case of the Plumbing (Part C), Heating (Part D) and Electrical (Part E) sections of the Standard, the paragraph numbers and key words appear just as they do in the Standard. Construction (Part B) differs in that it is organized around the major construction components such as roof, walls, doors, etc. Therefore, some Standard paragraph numbers which pertain to several components are repeated (example, weather resistance). The problems reported under the ANSI Standard Al19.1 subsection are related to inadequacies or omissions in the Standard.

The Mobile Home Enforcement Process subsection is organized similar to the ANSI Al19.1 subsection to document problems related to deficiencies in the mobile home regulatory process.

The Routine Maintenance subsection in the catalog is organized under the same general headings as the ANSI All9.1 Enforcement Process subsections; i.e., construction, plumbing, heating and electrical.

The Mechanical/Electrical Appliance subsection of the catalog is grouped by appliance; i.e., furnace, range, hot water heater, refrigerator, exhaust fan and smoke detector. Since components of each appliance are listed, it was possible to pinpoint the component problem where the detail of the data permitted.

Use of Problem Summation Tables

A problem level concept is employed in the Performance Problem List to organize and assist in the evaluation of the data. Figure Al illustrates problem levels 1, 2 and 3 and figure Al isolates ANSI Al19.1 (Construction) to illustrate levels 2 through 7. The problem summation tables in Appendices B, C and D show the problem level for each item in the last column and in some cases the problem list has been extended to an 8th level. The problem level concept was established as a tool to order the data and does not impart any degree of importance or significance to the individual problems as they relate to one another.

Using Tables A1, A2 and A3 as references, the use of the Problem Summation Tables is illustrated as follows.

Columns labeled (A), (B), (C), (D), (HOMES), (% Homes), and (Level) defined below are the same for Tables A1, A2 and A3.

- <u>Column (A)</u> The code assigned to identify a particular problem as recorded in the Performance Problem List.
- Column (B) A brief description of the problem or area of concern including the appropriate part of paragraph number in the ANSI Al19.1 Standard for Mobile Homes [1].
- Column (C) The number of problems that have been coded with the code identified on that line in Column A. Reported information on the problem has not allowed coding below the level of detail of the particular line (see column labeled "LEVEL.") For example, consider problem code NPLM on Table Al (Plumbing Routine Maintenance); 395 of the 3,379 problems were recorded under the general plumbing category, while problem definition allowed the remaining 2,984 (3,379 395) problems to be recorded with greater detail.
- Column (D) The summation of all problems at a discrete level. For example, the total number of problems associated with Routine Maintenance is 12,602 (Table Al) which is made up of the following summation of level 3 problems.

Construction		6,852
Plumbing		3,379
Electrical		1,637
Heating		732
Undefined (Column	C)	2
Total		12,602

The number of problems at a given level is the summation of problems at the next lower level. As another example, the number of level 1 problems (31,982) consists of the following level 2 problems: 12,602 Routine Maintenance problems; 7,568 ANSI Al19.1 problems; 5,508 Mechanical/Electrical Appliance problems, 5,160 Enforcement problems, and 1,144 Miscellaneous problems.

- <u>Column (HOMES)</u> The values in this column indicate the number of mobile homes in the sample that had one or more of the problems identified on each line (1,723 mobile homes with 3,379 Plumbing Routine Maintenance problems in Table A1).
- Column (% Homes) The entries in this column indicate the percentage of the total number of mobile homes reviewed in the sample which had the problem identified on each line. For example, under Plumbing Routine Maintenance in Table Al.

$$\frac{1,723 \text{ homes with problems}}{4,105 \text{ homes in sample}}$$
 X 100 = 42.0%

Column (Level) - These entries define the level of detail of the problem for each line.

Columns labeled (% 2nd and % 1st) in Table Al are defined below:

Consider the example of "Construction (CONS) - ANSI Standard Al19.1"

Column (% 2nd) - The entries in this column are the percentage of 2nd level problems that are contained at the third level of detail.

$$\frac{\text{Level 3 Problems}}{\text{Level 2 Problems}} = \frac{4,820}{7,568} \times 100 = 63.7\%$$

Column (% lst) - The entries in this column are the percentages of lst level problems that are contained at each lower level of detail.

$$\frac{\text{Level 3 Problems}}{\text{Level 1 Problems}} = \frac{4,820}{31,982} \times 100 = 15.1\%$$

Columns labeled (% 3rd), (% 2nd), and (% 1st) in Table A2 are defined below:

Consider the example of "Exterior Walls (EXTW) - Construction - ANSI Standard Al19.1."

Column (% 3rd) - The entries in this column are the percentages of 3rd level problems which are contained at each 4th level of detail.

$$\frac{\text{Level 4 Problems}}{\text{Level 3 Problems}} = \frac{995}{4,820} \times 100 = 20.6\%$$

Column (% 2nd) - Percentages relating 4th levels to the 2nd level of detail.

$$\frac{\text{Level 4 Problems}}{\text{Level 2 Problems}} = \frac{995}{7,568} \times 100 = 13.1\%$$

Column (% 1st) - Percentages relating 4th level to the 1st level.

$$\frac{\text{Level 4 Problems}}{\text{Level 1 Problems}} = \frac{995}{31,982} \times 100 = 3.1\%$$

Column labeled (% 7th), (% 6th), (% 5th), (% 4th), and (% 3rd) on Table A3 are defined below:

Consider the example of "Faucet Assembly (NPKA) - Water Supply Piping-Plumbing Routine Maintenance."

- Column (% 7th and 6th) Entries in these columns are percentages denoting the portions of the 7th and 6th level problems for each 8th and 7th level problem. These columns are blank on Table A3 since there are no 7th and 8th level problems shown on this page.
- Column (% 5th), (% 4th), (% 3rd) Entries in these columns related the number of problems at a given level to preceding levels (6, 5, 4 and 3).

$$\frac{\text{Level 6 Problems}}{\text{Level 5 Problems}} = \frac{131}{478} \times 100 = 27.4\% \text{ (Column \% 5th)}$$

$$\frac{\text{Level 7 Problems}}{\text{Level 4 Problems}} = \frac{131}{1,196} \times 100 = 11.0\% \text{ (Column % 4th)}$$

$$\frac{\text{Level 7 Problems}}{\text{Level 3 Problems}} = \frac{131}{3,379} \times 100 = 3.9\% \text{ (Column \% 3rd)}$$

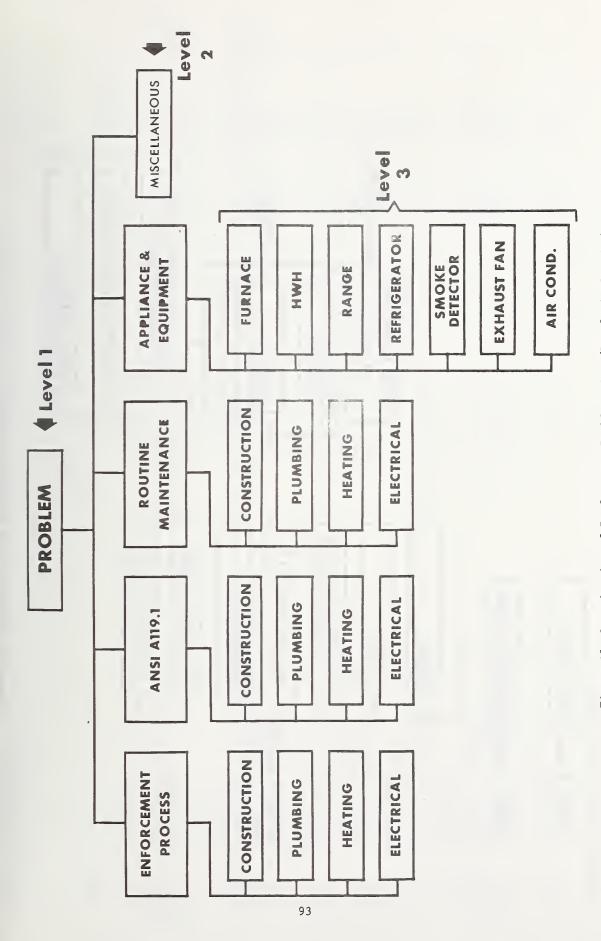


Figure Al Organization of Performance Problem List (Levels 1, 2 and 3)

Figure A2 Organization of Performance Problem List (Levels 2 through 7)

			TOTAL TOTAL	T_V						
FIRST L	LEVEL SUMMATION: NUMBER OF PROBLEMS			31982 	; 3 6 1 1 1 1			1	-	
(A)	(B)		(0)	(D)						
SECOND	AND THIRD LEVEL SUMMATIONS:			*CN	\$2 ND	K1ST	(HOMES)	(%HOMES)	(LEVEL)	
NANS	ROUTINE MAINTENANCE	_	2.1	12002		39.4	3142	76.5	2	
NCON NPL M NFL C	CONSTRUCTION PLUMBING ELECTRICAL HFATING			85 31 63 73	74°4 20°3 13°0 5°8	21.4 10.6 5.1 2.3	2491 1723 1079 556	60.7 42.0 26.3 13.5		53
ANSI	ANSI A119.1	_	6	7568			2672	65.1	2	
CONS PLUM ELEC HEAT	PART B CONSTRUCTION PART C PLUMBING PART E ELECTRICAL PART B HEATING SYSTEM		0000	4820 2452 152 144	63.7 32.4 2.0 1.9	15-1	2143 1520 123 134	37.0		~
APFO	MECHANICALZELECTRICAL APPLIANCES -EQUIPMENT	}	131	5508		. 0	2167	52.3	2	
AFHA ARKGF ACCF ACCF ASDF AFFB	FURNACE, HOT AIR, GAS OR UIL HOT WATER HEATERS RANGE - GAS/ELFCTRIC EXHAUST FAN REFPIGFRATOR SMUKF DECTUR ELECTRIC BASEBUARD HEATING UNITS		714) 501) 278) 157)		178.0 178.0 17.0 18.0 18.0	3.7.0	1287 1287 1041 677 253 170 38	1 -10004	ოოოოოო 	
ANSI	ENFORCEMENT	~	0	5160		10.1	2132	51.9	2	
PLUM ELEC HEAT CONS	PART C PLUMBING PART F ELECTRICAL PART B HEATING SYSTEM PART B CUNSTRUCTION		28)	1924 1142 1076 1018	37.3 22.1 20.9 19.7	8.0 8.0 8.0 8.2 8.2	1177 804 655 769	23.7 19.6 16.0 18.7	m m m m	
MISC	MISCELLANEOUS			1144	 	3.0	819	20.02	2	

4105 TOTAL NUMBER OF MOBILE HOMES REVIEWED = ---------

NOTE: Level 2 categories rank ordered by frequency of occurrence.

(A)			((4)						
	(B)	<u> </u>		(D)						
* * * * * * * * * * * * * * * * * * *	希腊安安尔特安全的基础安全的表现的基础存储的基础的基础存储的基础的基础的基础的基础存储的有限。 ROUTINE MAINTENANCE 非非常非常有效的基础表现的基础的 AS ROUTINE MAINTENANCE	*****	* * * * * * * * * * * * * * * * * * *	2602 4444	* * * * * * * * * * * * * * * * * * *	* * * * * * * * * * * * * * * * * * * *	70°4	************	76.5	****
NCON	CUNSTRUCTION	_	12)			54.4	21.4	_	60.7	m
NCXD	EXTERIOR DOOKS	i I	35	1 7	%	1 -	1 20	i >	36.7	4
NCWD	MIND()MS	_	2191	5		2 •		60	0	4
NCPD			69	0	1.			X		4
NCFS	EXTERIOR STAIRS			\sim				$\overline{}$	0	4
NCSM	SKIRTING							_		4
NCBL		<u> </u>	166)	383	2.0		0	324	0	7
	MOLEVALER HEALER COMPARIMENT	-		V				0.0	0	† <
J W J W	CNICA CONTRACTOR	-)	n d				VV	1 - 0	
NC TD	TIE DOWN STRAPS LOUSE, ETC			23	m	. 2		2.2	0 0	. +
NPLM	PLUMBING	ŭ	1969	3379				1723	45.0	6
	AATER SUPPLY PIPLS)	i۸	77	1	1 .		10	i -	7
NPFX	FIXTHERS	-		. 0	، ،	0			, (7
NPBT		-	4	4.5					6	. 4
NPPR	PRESSURE REGULATOR			300	1.0	, 50		ر ان ان	0	. 4
WWGN	WASHING MACHING	•		1,4						4
MODA	DISH WASHER	_	7)	1	• 2			7		7
NELC	ELECTRICAL	_	262)	1637		-	5.1	1079	25.3	m
NFDP	DISTRIBUTION PANEL BUARD		i ~	1 ~	10	į 🤘	i •	i -	į •	7
NERC		r trans	221	337	20.6			295	· ~	4
NFPP	PUWFR POLE/LIFELINE			love.	0			5		4
3002	SWITCHES	<u> </u>	105)	_	9					4
7 T T T T T T T T T T T T T T T T T T T	EXTENSION LIGHTING PLYTONES	_	\sim							4
NESK	SERVICE			5 71	- 5) n	51 6	. 2	† 4
NHTG	HEAT INC	i-mi	531	137						ĸ
			· i	- i -	1 (1	- 1		1	
	TAS SUPPLY PIPING				ή,	7.5				1 、
NHOP	UNI SUPPLT PIPING	J	91)	95	13.1	2. 3.	• • • •	→ C	1.d	† †
******* 1SNV *	x_3 x_4 x_4 x_4 x_5 x_4 x_5	*****	* * * * * * * * * * * * * * * * * * * *	7508	** ** **	* * * * * * * * * * * * * * * * * * * *	* * * * * * * * * * * * * * * * * * *	*******************************	************************	*******
CUNS	PART B CUNSTRUCTIUN		(0	4820		03.7	15.1	2143	55.2	~
F 00F	7		17		20	ယ	4.3	0		7
TALW			2)	\circ	o	3	3.1	20!	0	V 4
¥ - N-1	BAZEZ ELON WALLS		0	30		0	3°1	N		4
TRAN			5 5		o a		ر د ر	16.7	10.5	7 :
DEXT	/38	1	5 6	V :	9		1.0		0	+
			_	Ľ,	1		3	1		7

TABLE A-2

(A) ******* * NANS *****	(A) 希腊希腊 计设计设计设计设计设计设计设计设计设计设计设计设计设计设计设计设计设计设计设	(C) ******* { 2 ******	* - *	(D) 2602 ************************************	* *	* * *	* * * * * * * * * * * * * * * * * * *	****** 3142 *****	*************************	* * * * * * * * * * * * * * * * * * *
NCON	CONSTRUCTION	,		852				2491	1.03	8
NCXD	EXTERIOR DOURS	(43	5)	i on		i	39.4	0		7
NCXH	l l			.291		6-14	8	568	21.9	2
NCX.	STRUFFR FILE			2		, ,		0 7	•	v v
NCXR	STUKM REGLAZED			2 2				2) W
NCXS	SCREENS			Ω.				5.7		2
NCCD	CANOPY			55			30	10		2
NCSR	FROZEN		10	5 5			٠.	40	<u>.</u>	ς, ς,
NCWB	WINDOWS RECLAZED	17	1) 0 %		4		7 0		ታሪ
NC WH	HAKOWARE			394		24.6	 	329		, rv
NCWF	I MPROPER FII			2		4.		0		2
NCES	SCRFENS			0		2:		· 10		5
NC NC	DARTITIONS DOORS	40 7	6	9 4		င်		+ α		v 4
NC PF		7		၁၀		-		0 +	• 0	t in
NCPH	HARDWARE			2		28.9		က		. 5
NCES	EXTERIOR STAIRS			m .						4
NCSM	SKIRTING	-		- 3				-40		,
NCBE	SLUCKING FVELING	7	000	7 0		4		V		\$ (4
NC BR	RACKING UF DOOKS			- 4		11.7		1 .+		J 10
NCHH	HOT WATER HEATER COMPARTMENT	J	10	227			3.3	209		*
NCHO	COMPARTMENT DOOR			0		71.8		5		in:
NCH I	I NSULATION FI (10)	1		σ		0		5	•	v 4
NCFV	HEATING DUCT VENT	•		141		93.4	2.1	122		r 10
NCMG				4				4		#
NC 10	ILE DOWN SIRAPS LOUSE, EIC			23			٠ س	77		4
NPLM	PLUMBING	(39	51	5379				1723	42.0	3
SMdN	WATER SUPPLY PIPING	(442	2) 1	27			:	0	1 -	7
LMAN	EXTERIOR	25	161	3		65.3	4	4	5.	v
2 Z Z	FRUZEN		-	32	38.8	2	ô.	က္	-	φ,
Z Z Z	KITCHEN SINK	50	1 (2)	1 7 4 7	,	4.0 - 11		η –		7 1: 1
NPKA	FAUCET ASSEMBLY	1		131	4.	-	3.	126	3	V o
NPKF	FLANGE SEAL			34	7.1	2.8	1.0	33	80 1	7
NPFI	TOTLETS	_	(2)	 	n •	, ç		- 5	0 (ۍ ه
NPXX	CLOGGED DRAIN			130	4.2			112		n 0
TIGN	FLUSH TANK			\circ	34.4	χ	3.1	O	2.5	9
ATGA	TOTLET SEAT			35				32		0
NPBS		(12	(+)	31 222	1 • 1			29 201		o -v
NPBA	FAUCET ASSEMBLY			9			2.0	-0	1.5	0
NPBC Nppr	CLOGGED DRAIN		-	27	12.2		∞ •	25	9.	o
36 4				0	•	•	. 1	C		o

NO. STIN SOIN SOIN SOIN SOND (HUMES) (HUMES) (LEVEL)

FUNKIN INKUUUN EIGHIM LEVEL SUMMAIIUNS:

Appendix B Problem Summation Tables - HUD Sample

		HUD SAM	HUD SAMPLE DATA	Ì	l	l	Ì	ì
FIRST L	LEVEL SUPMATION: NUMBER OF PROBLEMS		- NO - 5 - 5 - 5 - 5 - 5 - 5 - 5 - 5 - 5 -					
1				 	 		 	1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1
SECOND	SECOND AND THIRD LEVEL SURMATIONS:		NO.	42MD	4151	H J™E S	8H JMES	LEVEL
SPAN	KUUTINE MAINIFNANCE	6	10178		7.0+	5527	79.3	A
NO N	CONSTRUCTION PLIMBING	11 3	5170	8.03 9.48	23.3	1709	6 i • 4	10°) 1
NELC	ELECTRICAL HE AT ING	2003		13.0	5 - 2 - 3 - 1 - 3 - 1 - 3 - 1 - 3 - 1 - 3 - 1 - 3 - 1 - 3 - 1 - 3 - 3	893 515	51.0 17.9	J 49 4 9
APEQ	APPLIANCES	(2)	1074		21.4	1790	02.1	C1
AFHA	FUENACE, HOT AIR, GAS OF DIL	(789)	2146	45° Ü	9.6	1133	35.3	
MMHV	HOT WATER HEATERS	(4591		30.3	6 • 5	439	32.6	77
A K C F	RAWGE - GANZELECTRIC EXHAUST FAN	(202)		30°C	ۍ ئ ئ	544	10.00 5.00	ig v
ACRF	REPRIGERATOR	(120)	15	3.2	1.	133	7 0	۲~۰
ASDE	SMUKE DECTOR		,Λ.	ထွ	. 2	35	1.2	3)
	CLICIATE DAVESTAND DESCRIVE CALLS	17	7	n •	7 •	7.7	\$ [*]	n
NV I	ANSI A119.1	(0)	4243		19.1	1628	54.5	۲,
CONS	PART R CONSTRUCTION PART C PLUMBING	(n)	2680 1563	63.2 36.8	12.0	1236	42.9 53.3	M B
ISNA	ENFORCEMENT	(0)	2234		10.3	1265	45.9	¢1

2881_

23.0 10.4 13.0 7.0

686 473 391 201

4.3 2.3 2.2

41.9 27.2 21.4 9.5

902 623 490 219

3000

PLUMBING CONSTRUCTION ELECTRICAL HEATING SYSTEM

9 в ш о PART PART PART PART

PLUM CONS FLEC HEAT

MISCELLANEOUS

MISC

18.3

527

3.4

705

										i
FOURTH LEVEL	EVEL SUMMATION:			0 N	%3R0	22 ND	\$15T	HOMES	2HOME S	LEVEL
* * * * * * * * * * * * * * * * * * *	未来存在大学在有关的存在中央中的企业与大学的设计的企业,并不是有一种的企业的企业的企业的企业的企业的企业的企业。 * NANS ROUTINE MAINTENANCE	***	* -		* * *	#+ #- #-	*****	*****	79.3	****
***	经非常的 医牙髓性 化二甲基苯酚 化二甲基甲基甲基甲基甲基甲基甲基甲基甲基甲基甲基甲基甲基甲基甲基甲基甲基甲基甲基	林	* * *	*	* * * *	* *	* *	* * * * * * * * * * * * * * * * * * * *	#	* * * * * * * * * * * * * * * * * * *
NCON	CONSTRUCTION	-	11)	5175		50.8	23.3	1769	61.4	
NCXD	EXTERIOR DOOKS	<u> </u>	345)	2167	41.9	21.3	7.6	1166	40.5	4 3
	MINDOMS FXTERIOR STAIRS	_	201	0 Z	, 5	. ,		200		† 7
NC PD		_	217)	1				٥	2 •	4
NCSM	SKIRTING			1	0			∞	6	4
NCBL	BLOCK ING		142)	1 dt				ml		4
I I	HOT WATER HEATER COMPARTMENT		<u>,</u>				no (2		7 4
NO FE	SITE GRADING	_	0	VV		0 (0 ~	5 4		+ 4
NCTO	TIF DOWN STRAPS LOOSE, ETC			14			• 1			4
NPLM	PLUMBING	Ų	3441	2940		28.9	13.2	1443	50.1	M
				j (į,	į,	1	i c	į	`
2 N	MALEK SUPPLY PIPING		107						22.5	† 4
Y BON	CENER CERS	-		n -	• 7			٦ ٦	• ·	1
NPPR	PRESSURE REGULATOR			23		. 2	• 1	212	7.	. 4
NPMW		_	6						e.	7
MOdN	DISH WASHER	_		7				2	• 1	4
NELC	EL ECTR ICAL	_	2001	1382		13.6	0.2	893	31.0	٣.
NEDP	DISTRIBUTION PANEL BOARD		i o	iα	2.			1 4	•	7
NERC	RECEPTICAL OUTLETS	_	14)	289				256		4
NEPP	POWER POLE/LIFELINE		,	5	* ~4			41		4、
Z L Z	SWITCHES INTERIOR STATIBLES		841)	4.0			87		J 1
N N		-	-	- 6	7.0	. 1	y 0°	† o	• • • •	7
NESR				7	• 5			7		4
NHTG	HEAT ING	Ų	451	681				515	17.9	M
NHGP	GAS SUPPLY PIPING			1	1 4		2.0			+
NHSP	INSTALLED SPACE HEATERS			101	15.7	1.1		96	3.3	4
dCHN	OIL SUPPLT PIPING	Ų	841	ာ	9		4.			7
* * * * * * * * * * * * * * * * * * *	**************************************	* * *	2)	***** 4767 ****	* * *	* * * * * * * * * * * * * * * * * * * *	21.4 21.4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4	******** 1790	************************	**************************************
АЕНА	FURNACE, HOT AIR, GAS OR OIL	_	637)	2146		45.0	9.6	1133	39.3	М
AFPL	PILOT/ELECTRONIC IGNITION	-	1 2	1 5	1:			1 50		4
AFCL	CONTROLS		m 0	m 0	ů,			9		4 1
AFWT	WALL THERMOSTAT		1661					205		r
AFBL	BLOWER ASSEMBLY	_	62	62	5.9	1.3	en (57	2.0	4
AFOR	GAS KEGULATUK FURNACE DOURS							3 B		t
		-						-	1	-

r	4		•	9	9	r		•		,	
1	31.1	703	4.9	33.7	91.6	1432	100	}	PUMBING FIXINES	63	PFIA
~	53.3	656	7.0	36.8		1503	00	,)	PLUMB ING	PART C	PLUM
4			0.					,		68-3-2/3	DINT
1 7						2 5			VOUNT W	R6/87/88	MONM
4 %		N 0	۵ 4			m.			FLOOR SYSTEMS	86/87	FLOR
4		~ (-	1.	(TRANSIT CONSIDERATIONS	8-APP.	TRAN
4	'n	4		· ~	0	10			PARTITION WALLS	18/99	MLNI
4 4		535	3.4	17.8	28.2	755	20		ROOF SYSTEM EXTERIOR WALLS	86/87 R6/87	ROUF
٠ ا	42.5		12.0	63.2		2037	5		CUNST RUC1 IUN	PART B	CONS
4.4.4.4.4.4.4.4.4.4.4.4.4.4.4.4.4.4.4.	**********	**************************************	10.1	* * * * * * * * * * * * * * * * * * *	* * *	424444444444444444444444444444444444444	* * * * * * * * * * * * * * * * * * * *	*******************	法保持的法律法律法律法法法法法法法法法法法法法法法法法法法法法法法法法法法法法法	**************************************	**************************************
4 4	w	ക ബ	0.0	.2	61.5	ao m	21	•	STAT	THERMOSTAT	AFST
 	4	12	1	6		13	7)	SASEBOARD HFATING UNITS	ELFCTRIC	AFEB
6	1.2	3.5	•2	20	,	37			DECTUR	SMUKE DE	ASDF
1		1				7 7		_		FAN	ACKX
* 4	~ ·		0.0) c	•		2		SSUR	COMPRESSUR	TOI A CRC
44		16	. 1	æ, ८,	10.5	16	10)	•	GASKFTING (DOORS	GASKETIN	ACP G ACP L
29	4.0	133	7 .	3.2		153	1201	•	4T!JR	REFRIGERATUR	ACPF
£	5.8	168	80	3.8		180			A A N	FXHAUST FAN	AEEX
7		J 40	40.		• •		ñ		AL WIRING	INTERNAL	ARIW
. 4 4	•	«	40	•	30 3	10 C	38)		LS	CONTECLS	ARCL
7 4 4	9 4 C	57. 57.	, r- 17	2.8	15.2	152	000		ΦK	GAS LEAK BURNER	ARGL ARBU
	i	1 1	Ĺ	1	1 .	i c	~			10 11 0	1000
m	18.9			16.0		192	2021	•	GAS/ELECTRIC	RANGE -	ARGE
7 7	17.7	510 175	3.4		51.7	746			ELECTRIC HOT WATER HEATER GAS HOT WATER HEATER	ELFCTRIC GAS HUT	AHEL
an.	32.0	686	ن و	30.3		1444	(654)	•	HOT WATEP HEATERS	HOT WATE	AHMM
7 7						3	9	•	BLOWER MOTOR	8LOWER	AFBM
4 4 4	6. 6.	25	0	y	1.2	26			AUFNEF ASSEMBLY FILTER FIEL SUPPLY CONNECTION	AUFNEF FILTER FIFE SI	AFTR
LEVEL	SHOME S	HOMES	%151	\$2.4D	23RD	-0N			TION:	LEVEL SUMMATION:	FOURTH LEVEL

DATA	
SAMPLE	
100	

FOURTH LEVEL	LEVEL SUMMATION:	TION:			0 N	23RU	62ND	%1ST	HOMES	%HOME S	LEVEL
PRED WOTN VANV	C5.2 C11 C13	PROTECTIVE REGUIREMENT WATER DISTRIBUTION SYSTEM VENTS AND VENTING		000	129 1 1	0 · 0 · 0 · 0 · 0 · 0 · 0 · 0 · 0 · 0 ·	000	\$ 0 0	116 1 1	000	444
******* ********	:*************************************	米拉格拉拉拉格拉拉拉拉拉拉拉拉拉拉拉拉拉拉拉拉拉拉拉拉拉拉拉拉拉拉拉拉拉拉拉	* * * * * *	* * * * * * * * * * * * * * * * * * * *	******* ******	* * *	* * *	10.3	1265	********	* * * * * * * * * * * * * * * * * * * *
ليد	PART C	PLUMBING	~	0			41.9	4.3	089	23.6	m
JCTI	C7 • 1	1		944)	946	98.1		j •	671		* ·
DSYS	C12 C9	DRAINAGE SYSTEM PLUMBING FIXTURES		00	ഗന	. ឃុំ	N ~4	00	7 m		* *
PFAP	C5 . 1 . 4	PROHIBITED FITTINGS AND PRACTICES		23	2	-2	۲,	0.	- (4
D ANC	200	HANGERS AND SIDDOWTS		000	7 ^	7.0) c	7 ^		† 4
N L C M	C1 1	WATER DISTRIBUTION SYSTEM		3 3	2 2	. 2		0	2		. 4
VANV	C13	VENTS AND VENTING)	2)	2	• 2	• 1			0.	4
CONS	PART B	CONST RUCT 10N	•	(0	623			2.8	473	10.4	C
EXTW	86/87	EXTERIOR WALLS	- - - -	(0	1 00	i •		1.7	j m	j •	1 4
DEXT	86/81/88	DOURS EXTERIOR	_	151)	152	4.	ô			5	7
MONM	86/81/88	WINDOWS)	53)	54	φ 9		• 2	54		न
ROOF	86/87	ROOF SYSIFM)	(0	16	2.6	. 7	• 1	14	. 5	4
FLOR	86/87	FLOOR SYSTEMS	_	2)	3 0			0•	S.		7
3 - 2 -	86/87	PARTITION WALLS .	_	<u></u>	9		• 3	٠ ٠	S	. 2	4
TRAN	B-APP.	TRANSIT CONSIDERATIONS	_	1)	-	• 2		0.	1		7
FLEC	PART E	ELECTRICAL	_	0)	055		21.4	2 - 2	391	13.0	~ 1
EWOR	E11	ING METH	_	0	9	4.			in		7
EXUR	E20	LIGHTING FIXTURES)	117)				• 5			7
FFRO	E19	RECEPTACLE OUTLETS)	0		7				0	7
EGNB	E23		_	0		ċ					2
ESWL	£22 €18	GUIDDOR GUILEIS. FIXTURFS. AIR-COOLING WALL SWITCHES		31)	34	э о э и	1.7	.1	37	1.3	4 7
HEAT	PART U	HEATING SYSTEM	_	0)	219		9.5	1.0	201	7.0	[C.]
HAPL HLPG HPSY	06 04.2.5 05	APPLIANCES LP GAS SAFETY DEVICES PIPING SYSTEM		(0	205 13	43.6 5.9	6 9 0	6.10	187	0 20	

40.5 11.8 2.1 1.0 26.4 11.9

2.7 2.4 19.5 5.9 1.0

108)

CLUGGED DRAIN

FLUSH TANK

FAUCET ASSEMBLY

CLUGGED DRAIN

NPKC NPFT NPXX NPTP

TOTLETS

FLANGL SFAL

FAUCET ASSEMBLY

NPT A NPBS NPBA NPBC NPBC

LAVORATORIES

CLUGGED DRAIN

TOILET SEAT

TANK TOP

30.5 9.1 2.7

45.1 35.0 10.3 9.1

VEL	0004444	m إ	ቀ ለ ለ ለ ለ ቀ ለ ሶ	0000440	444	*	# # K	411411000000000000000000000000000000000
S LEV	1376704	0	2 4 4 5 5 5 5 5 5 5 5 5 5 5 5 5 5 5 5 5	5 M S M S M S M S			3 * * * *	
4HOME		31.	10.11.11.11.11.11.11.11.11.11.11.11.11.1			12 12 3 3 3 5 7 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4	62° **** 37°	55.7 2 4 7 1 0 4
HUMES	111 29 15 340 21 21 22	643	238 238 49 33 25c	2000 6 4 4 2 10 10 141 141 700 700 700 700 700 700 700 700 700 70	4	300 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4	1750	
% 3K U	1					64.0 15.7 13.1 .7	*	21:2 17:4 16:7 16:7 16:7 16:4 16:4 16:4 16:4 16:4 16:4
%4 I H	12.5 3.1 1.7			70.4 20.0 20.0 20.0 20.0 20.0		9 *	* * * *	84.2 40.8 111.3 11.2 44.4 44.9
451H	2 2 1 1 3 5 5 5 5 5 5 5 5 5 5 5 5 5 5 5 5 5	1	i I	95.6 3.5 21.3		***	*	77.4 1.7 1.7 1.4 1.6 10.4 7.5
%6TH			 			**	* * * *	
ж7ТН			 			# # # # # # # # # # # # # # # # # # #	# 1 # 1 # 1	
DATA NO.	120 30 10 411 23 9	30	50 377 50 38 289 228	4 4 4 8	7	# TO 7 #	4767 ****** 2146	456 386 336 177 137 137 10 10 40 40 123 127
SAMPLE	74)	0	119)	37)	_	4 8 4	2) *****	23) 37) 16) 37)
HOD		_		-	_	* * * * * * * * * * * * * * * * * * * *	*	
FOURTH THROUGH EIGHTH LEVEL SUKMATIONS:	BATHTUB WITH SHUWERHEAU FAUCET ASSEMBLY CLÜGGED DRAIN SFWER PRESSÜRE REGULATOR WASHING MACHING	EL ECTRICAL	DISTRIBUTION PANEL BOARD FUSES CIRCUIT BREAKERS FUSTAT RECEPTICAL OUTLETS OUT DOOR	HEAT TAPE LIGHT FIXEURE INTERIOR FACEPLATE POWER POLE/LIFELINE SWITCHES FACEDIATE	INTERIOR LIGHTING FIXTURES EXTERIOR LIGHT FIXTURE SFRVICE		APFD MFCHANICAL/ELECTRICAL APPLIANCES — EDUIPMENT 本学年年本本本本本本本本本本本本本本本本本本本本本本本本本本本本本本本本本本	PILOT/ELECTRUNIC IGNITION RELIGHT PILOT CUNTROLS 9LOWER LIMIT SAITCH RESET BUTTON BURNER THERMOCOUPLE CONTROLS VALVE ELECTRODE CA.) CELLS RESET BUTTON INTERNAL WIAING ON/OFF EMERGENCY SWITCH FUEL GUN NOZZLE / OAIFICE
FOURTH	N N P P C B P P D D D D D D D D D D D D D D D D D	NELC	NEDP NEDF NECB NECB NECC	NELF NEPF NEPF NEPF NESF NESF	NESP NESP	NHTGP NHGP NHOP NHOP NHOP	# APFQ # * * * * * * * * * * * * * * * * * * *	AFPL AFPRI- AFFR AFFR AFFR AFFR AFFR AFFR AFFR AFF

LEVEL	0 10 10 10 10 10 10 10 10 10 10 10 10 10	e.	4	ט יט	. 2	9 9	0	יט ע	J.	10 4	\$ 1U	0 4	n 3	in i	5 4	o	9	0 0	n -0	·ο ·ο	in.	3	+	n φ	4	0 70	কণ	0
&HOME S	22	32.6		4 • 1				2.4	0 0		9 0	1 - 7				• •	7.	, e			• 1	10.9				1 • 1 • 5		
HOMES 4	20 3 3 5 5 5 5 5 5 5 5 5 5 5 5 5 5 5 5 5	939	1 ~ 0	185	0 4	16	11	69	9 0	3	200	54	32	39	37	r xo	ي ر	10	0	m 4	2	4 + 1	I ~ -	125	98	14	76	17
% 3RD	11 1 2 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4		51.7	, ,	6.7	1.2	1.0	4° c		-2	ရှိ ကိ	W .	5.5 7.5	3.0 0.0	2•8 1.9	9.	7.5	7.7	. 7	er e	•1		1 0		å,	1.0		
44 TH	23.0 5.30 1.1 1.1 1.1			6.87	9					7.	I.		0. 4	9 1	. 0	• •	•	ر. ٥		1.7			-	0 -	~	13.3	1	20.5
H16%	47.2		! ! !		-17	10.01	•	45.7	•			98.1	70.0		۲,	22.0	7	-	31.3	· \								
%етн] 																			,						
¥71 н																												
.08	24 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2	1444	1 4 (141	2	13	14	0/	9	236	. 3	51	2 0	7,7	75	0 0		12		4 W	7	192	200	152	0 4	15	 	17
	623	459)	2021		32)			3.		16.)	1)	113		Ē	3)		4	D				202)	73)		58)		38)	
			1 . 4																									
	-	_	,		_			_		_	. –	,	-		_		-	-				-	_		_		_	-
					_		٠	_		_		_			-		_	-				_	_		_		_	~
					_			-					-		_							•	•		_		_	
	g a							_							_			_)			_			
I UNS:	STALLED							_			. •																	
SUN MATIUNS:	ECTION (هي					X (3)					VALVE						¥	·							
-EVEL SUMMATIONS:	INITIALLY INSTALLED AK NK NK NR STAT FER MALY MBLY CONNECTION (CONNECTION					TON	ELEMENT		GULATUR	V ALVE HEATER				ELIEF VALVE		IFICE			NOT	GULATAR	↓ V ALV F)				_	1EP
	AS LEAK AS LEAK P P P MOTUR THE RANSTAT NSFORMER R ASSEMBLY E GUILAR R ASSEMBLY R ASSEMB			MENT	7 1 7 1	FI BUTTON	TING ELEMENT	~	URE REGULATOR			×	PILCT	URE RELIEF VALVE	- *	ZL E / OR I FICE	ULATOR	RMUSTAT	ET BUTTON	NER Ure Regulator	SIPHUN VALVE		10 11 4 11 91		χ.	FACE	ULS RMUSTAT	N BURNER
EIGHTH LEVEL	WFONG INITIALLY INSTALLED GAS LEAK PUMP OIL LEAK PUMP MOTUR WALL THERMUSTAT TRANSFORMER BLOWER ASSEMBLY UAS REGULATOR FURNACE DUATE BURNER ASSEMBLY FILTER FURNACE DUATE FURNACE DUATE FURNACE DUATE FURNACE DUATE FURNER ASSEMBLY FILTER			MENT		RESFT BUTTON	HEATING ELEMENT	LEAK	PRESSURE REGULATOR			LEAK PILIT	PILCT	PRESSURE RELIEF VALVE MIEMEE	LEAK	NJZZL E/ORIFICE	REGULATOR CONTROL S	THERMUSTAT	RESET BUTTON	PRESSURE REGULATOR	ANTI-SIPHON VALVE		PILOT RELIGHT DILOT	A K	BURNER	SURFACE	THERMUS TAT	OVEN BURNER
	WEONG INITIALLY INSTALLED GAS LEAK PUMP OIL LEAK OIL LEAK PUMP MOTOR WALL THERMUSTAT TRANSFORMER BUOWER ASSEMBLY GAS RECULATOR FURNACE DOUGS RUNACE DOUGS RUNACE ASSEMBLY FILTER FURNER ASSEMBLY FULNER ASSEMBLY FURNER ASSEMBLY FULNER RUNAL TONNECTION		ER	MENT	7 1 7 1	RESFT BUTTON	HEATING ELEMENT	LEAK	PRESSURE REGULATOR	ANTI-SIPHON VALVE GAS HOT WATER HEATER		×	PILCT		SURNET LFAK	NUZZLE/ORIFICE	REGULATOR CONTROLS	THERMUSTAT	RESET PUTTON		ANTI-SIPHON VALVE	RANGE - GAS/ELECTRIC	16.HJ	GAS LFAK	BURNER	SURFACE	THERMUSTAT	OVEN BURNER

LEVEL				£	전 전 전 전 전 전 전 전 전 전 2 2 2 2 2 2 2 3 2 3	+ ++ + ++ + ++ + ++ + ++	
%HOME S		0.0	0 4 0 1 1 0 0	1 . 2	• • • •	* * 50 * * * * * * * * * * * * * * * * *	
HCMES	1 5 3 1	168		35		1628	226000
\$3RD	1.5 2.1 1.6 5.1		10.5		61.5 46.2 23.1 23.1 23.1	\$ 45 5 45 6 46 5 46	282 282 282 282 283 283 283 283 283 283
84 TH	12.0 24.5 29.1		9.1		100.0	* * * * * *	21 21 21 21 22 22 22 22 22 22 22 22 22 2
X5TH			 			\$ 45 \$ 45 \$ 45 \$ 10 \$ 46	111.7 3.55 3.45 100.0 100.0 56.7 33.4 33.4 36.7 36.7
H19%			 			* * * * * * * * * * * * * * * * * * *	289.0 289.0 10.0 10.0
X7TH						\$ 45 \$ 46 \$ 45 \$ 45 \$ 46	
NC.	1 5 0 1	180	10 11 12 2 2 2 2 2 1 1 1 1 1 1 1 1 1 1 1	37	1 m w or at 1	4243 ***** 2000	259 259 259 259 259 259 259 259 259 259
	3	120)	101	(7	5 0	****	2 0 0 0 0
	_	l loaned	-	-		*	NE (CH & NALL I
FOURTH THROUGH EIGHTH LEVEL SUMMATIONS:	SURFACE BURNER HARDWARE OVEN DOORS KNUBS DRAWS INTERNAL WIRING	EXHAUST FAN 	GASKETING IDCORS CONTROLS SWITCHES COMPRESSUR REFRIGERANT SYSTEM FREEZER CUILS	SMÜKE DECTOR ELECTRIC BASEBUARD HEATING UNITS	j - }	******************	16/87 16/87 16/87 17.1 17.
ROUGH		R E		SP		* * 0	20 a 2 a a a a a a a a a a a a a a a a a

NEW PARTITION OF FAUNTHALE STREET 10 357 1	TOUR IN THRUDON ELONIN LEVEL										
Second S		PAKTITION WALLS	0	55				ೆ	554	5.	4
1. 1. 1. 1. 1. 1. 1. 1.		FASTENING UF STRUCTURAL SYSTEM	5 •	54				0	438	5.	3
No. Control		PANELING TO MALL FRA		4				o.	438	5.	ó
10 10 10 10 10 10 10 10		DURABILITY OF PANELING		œ.				.3	7	7.	5
Family F		EUAU CAFRYING CAPACITY	<u> </u>	in :			5.	-2	*	₹	S.
Fig. Tuber Louis Asserting Fig.		TANELING TOP DATIONS				2	,	2.	7		٠ د
Tries Frankly Reference Frankly Referenc		A FRAME ACCESS V	> ~	n -				0-17	817	0	\$ 4
R. P. THE STATE STATE REMIETS R. P. R. P. R. P. R. P. THE STATE STATE R. P. R. P. R. P. R. P. SPRINGS FRIENCE R. P. P. R. P. R. P. SPRINGS FRIENCE R. P. P. R. P. R. P. ALLE STATE STATE R. P. R. P. R. P. R. P. ALLE STATE STATE R. P. R. P. R. P. R. P. R. P. P. R. P. P. R. P. R. P. R. P. R. P. P. P. P. P. P. R. P. R. P. R. P. ALLO R. CHARLES R. P. P. R. P. R. P. R. P. R. P. P. P. P. P. P. P. P. R. P. R. P. P. R. P. R. P.		LONG THIS AND WEMBER		1 20		4	• •	- u	7+7		Ω,
R. B. FIFES R. B.	, 00	TRANSVERSE MEMARRS		7		9 6	• ~	, , ,	7 0		0 4
R-4 SPRINCES REAKES RANGELS		TIPES		. (7)					- 7º	•	3. 0
8-4 SPRING/SMING FANCE		BRAKES	0				, <	1.5	- cc	•	٠ ، ،
Box All the Restriction All the Restri		HANGER							0 0		, ıc
R-5 ACTION OF RECEASING Course R-5 Course								4	7 7 -		
BACKET COUNTRING MECHANISM Color Section Secti		AXIFS		, ,			0	, ,	7	•) 1
BOOK TO NET MENTRER RESISTANCE COLOR OF THE PRESISTANCE COLOR COVERNOR COLOR COVERN		COUPLING MECHANISM		- ທ				• ^	- <	• 5	٠ ١
87.1		ELITING SYSTEMS	10				0	• •	125	0	0 1
STIEND UNINGMENTH OF FLODR SYSTEM STIEND		WEATHER RESISTANCE					C	, ,	000	•	t u
PRINCE COMPANY CONTRICT CON		JEATH OF FLOOR SYSTE	1	30		7	• -	, , ,	0 0 0		Λ,
FLORE CUPERING FLOR	,		,	0 0		•	• 4 3	0 -	0 10		ی د
FLOWER COVERING TO DECKING			-	- o		u	0 -	† C	- 0		0
B6.5 FASTENING OF STRUCTURE STATES 1	•	CHACK INC. TO DEC		0 U		٠,	• ;	1÷0	Ω.,		0
Bolicy Fazering of Structural Systems Bolicy Boli	•	NERING TO DEC		Λ.		9		7.	ς :	- 5	٥
Botal		1				0		-	m .	-	ç
No.		AL SYSTEM	2					* •	1 1	4.	'n
No. OFFICE TIME No. OFFICE TIME No. OFFICE TIME OFFICE TIM		4 T T X		,		'n			7	• 2	Φ
100.0 0 0 0 0 0 0 0 0 0		TO FLUCIK JULSI	,			0		• 1	4	• 1	9
BOATON BOLDS EARING DIGUSTANCE DIGUSTA			<u> </u>				ဏ	O :	-	٥.	Ç
BR-3-27 DURABLILITY DURABLITY DURABLILITY DURABLITY DURABLITY DURABLITY DURABLITY DURABLITY DURABLITY DURA	. Bo.10		;	•		0.0	0.0	C •	-		Q.
Separation Continuer Con	87 1	MONS EXTERIOR MEATHER DESIGNATE - MATERIALE	5	٦,				5°0	16		+ 1
B8-3-2/3 DAMPHER RESISTANCE - MATER LEAK 0 9 9 3-6 7-7		MAIEN LTA					° .) o (27		ر د
PART C PLUMBING FIXTURES PARTITION PART C PLUMBING FIXTURES PART C		3	(0)	00			0	7 * *	† C		o ,
BB.322/3 D.URABILITY BB.322/3 D.URABILITY BB.322/3 D.URABILITY BB.322/3 D.URABILITY BB.322/3 D.URABILITY BB.322/3 D.UCKS. HARDARE C		S SEATHER LECTORANCE - SATER LEA		2 2					7 -	0	.
B8.3.2/3 Dudr Interior DURABILITY 3 75.0 .1 4 1.1 6 1.1 75.0 .1 3 1.1 6 1.1 75.0 .1 3 1.1 75.0 1.1 3 1.1 75.0 1.1 3 1.1 75.0 1.1 75.0 1.1 75.0 1.1 75.0 1.1 75.0 1.1 75.0 1.1 75.0 1.1 75.0 1.1 75.0 1.1 75.0 75.3 75.0 75.3 75.0 75.3 75.0 75		DIR AXILLIY		000)	20		Λ I
B8.3.2/3 LOCKS, HARDWARE 1 15.0 15.0 1 1 1 1 1 1 1 1 1			60				0		7 7		0
B8.3.2/3 LOCKS. HARDWARE 1 150.3 150.3 1 20.0 150.3 1 150.3 1 150.3 1 150.3 1 150.3 1 150.3 1 1 1 1 1 1 1 1 1							u	• 7	t r		Ť
PART C PLUMBING C9	88.3.2/3	LOCKS		`			, ,	7 (n -	⊣ (n ur
C92				4			•	•	4	•	`
C9 PLUMBING FIXTURES C9-2 FIXTURE 5 C9-2-1 TOILETS C9-2-1-2 TOILETS C9-2-1-2 TOILETS C9-2-1-3 TOILET PESTGN C9-2-1-3 TOILET DESIGN C9-2-1-3 TOILET DESIGN C9-2-1-3 TOILET DESIGN C9-2-2-3 MATERITIGHTNESS UF JUINT AT DRAIM L30 TO-7 9-0 d.8 119 4-1 C9-2-2-3 MATERITIGHTNESS UF JUINT AT DRAIM L30 TO-7 9-1 b.3 11-8 10-3 C9-2-2-3 MATERITIGHTNESS UF JUINT AT DRAIM C9-2-2-3 MATERITIGHTNESS UF JUINT AT DRAIM C9-1-1 GFNERAL REQUIREMENT C9-2-3 12-3 12-3 12-3 12-3 12-3 12-3 12-3	PART	PLUMBING	(0)	5					۵.	~	٣
C9-2 FIXTURES (314) 640 77.7 44.7 623 21.6 623 21.6 623 21.6 623 21.6 623 21.6 623 21.6 623 21.6 623 21.6 623 21.6 623 21.6 623 21.6 623 21.6 623 21.6 623 21.6 623 21.6 623 21.6 623 21.6 623 11.7 44.7 44.7 40.7 623 11.7 623 11.7 623 11.7 623 11.7 623 11.7 623 11.7 623 11.7 623 11.7 623 11.7 623 11.7 623 11.7 623 11.7 623 11.7 623 11.7 623 12.7 623 12.7 623 12.7 623 12.7 623 12.7 623 12.7 623 12.7 623 12.7 623 12.7 623 12.7 623		PLOMBING FIXICERS	(1)	143			1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	! -	1 0	1	
C9-2-1.2 TOILETS C9-2-1.2 TOILET FLUSHING DEVICES C9-2-1.2 TOILET FLUSHING DEVICES C9-2-1.2 TOILET FLUSHING DEVICES C9-2-1.2 TOILET CONNECTION C9-2-1.1 TOILET CONNECTION C9-2-1.2 TOILET CONNECTION C9-2-1.1 TOILET CONNECTION C9-2-2.2 MATERITIGHTNESS UF JUINT AT DRAIN C9-2-2.2 MATERITIGHTNESS UF JUINT AT DRAIN C9-2-2.2 MATERITIGHTNESS UF SHOWER/FENCE C9-2-2.3 MATERITIGHTNESS UF SHOWER/FENCE C9-2-2.3 MATERITIGHTNESS UF SHOWER/FENCE C9-2-2.3 MATERITIGHTNESS UF SHOWER/FENCE C9-2-2.3 MATERITIGHTNESS UF SHOWER/FENCE C9-2-3 MATERITICHTNESS UF SHOWER/FENCE C9-2-3 MAT		FIXTURES		5.24			7	٠, ر	, ,		† u
C9-2-1-2 TOLLET FLUSHING DEVICES C9-2-1-5 FLUCK CONNECTION C9-2-1-5 FLUCK CONNECTION C9-2-1-1 TOLLET CENNECTION C9-2-2-2 TOLNECTION C9-2-3 TOLNEC			-	40		7	• .5	10	J 🗀	0	0.0
C9-2-1-5 FLOUR CONNECTION C9-2-1-1 TOILET DESIGN C9-2-1-1 TOILET DESIGN C9-2-1-1 TOILET DESIGN C9-2-2-2 SHOWER STALLS C9-2-2-2 MATERIDHTNESS UF JUINT AT DRAIN C9-2-2-3 MATERIDHTNESS UF JUINT AT DRAIN C9-2-2-3 MATERIDHTNESS UF JUINT AT DRAIN C9-2-2-3 MATERIDHTNESS UF JUINT AT DRAIN C9-1-1 GENERAL REQUIREMENT C9-1-1 GOALITY OF FIXTURES C9-2-3 12-3 11-8 10-3 4-2 C9-2-2-3 MATERIDHTNESS UF JUINT AT DRAIN C9-1-1 GOALITY OF FIXTURES C9-2-3 12-3 11-8 10-3 4-2 C9-2-3 12-3 11-8 10-3 4-2 C9-2-3 12-3 11-8 10-3 4-2 C9-1-1 GOALITY OF FIXTURES C9-1-1 GOALITY OF FIXTURES C5-2-4 FREEZING C5-2-4 FREEZING C5-2-5 RODENT RESISTANCE C5-2-5 12-1 -1 -1 -1 C9-1-1 GOALITY OF FIXTURES C5-2-5 12-3 11-8 10-3 4-2 C5-2-5 12-3 11-8 10-3 4-2 C9-3 12-3 11-8 10-3 C9-3 11-8 10-3 C9-3 11-8 10-3 C9-3 11-8 10-3 C9-3 11-8 11-8 10-3 C9-3 11-8 11-8 10-3 C9-3 11-8 11-8 10-3 C9-3 11-8 11-8 11-8 C9-3 11-8 11-8 11-8 C9-3 11-8 11-8 C9-3 11-8 11-8 C9-3 11-8		TOILET FLUSHING DEVICE		18	5 <	. 22	اما ا	, <) 4		·
C9-2-1-1 TOILET DESIGN C9-2-2 SHOWER STALLS C9-2-2 SHOWER STALLS C9-2-2 SHOWER STALLS C9-2-2 SHOWER STALLS C9-2-2 MATERITIGHTNESS UF JUJINT AT DRAIN L3-0 13-0 12-3 11-8 10-3 5-7 C9-2-2-3 WATERITIGHTNESS UF JUJINT AT DRAIN C9-2-2-3 WATERITIGHTNESS UF JUJINT AT DRAIN C9-2-2-3 WATERITIGHTNESS UF JUJINT AT DRAIN C9-1 6-3 12-3 11-8 12-0 4-2 C9-2-2-3 MATERITIGHTNESS UF JUJINT AT DRAIN C9-1 0 0-3 3-3 3-5 C9-2-3 12-3 11-8 10-0 4-2 C9-2-3 12-3 11-8 10-0 4-2 C9-2-3 12-3 11-8 10-0 4-2 C9-1 0 0-3 11-0 4-2 C9-1 0 0-3 11-0 4-2 C9-1 0 0-3 11-0 4-2 C9-2-3 12-3 11-8 C9-2-3 1		FLOUR CONNECTION		7	21		0	, ~) -		
C9-2-2 SHOWER STALLS C9-2-2-2 WATERIGHTNESS UF JUINT AT DRAIN C9-2-2-2 WATERIGHTNESS UF JUINT AT DRAIN C9-2-2-2 WATERIGHTNESS UF JUINT AT DRAIN C9-2-2-3 WATERIGHTNESS UF JUINT AT DRAIN C9-1 GENERAL REQUIREMENT C9-1 GENERAL REQUIREMENT C9-1 GALLIY OF FIXURES C9-2-3 B-3 B-3 B-0 B						. 2.			4		_
C9-2-2-2 WATERTIGHTNESS UF JUINT AT DRAIN 130 70-7 15-6 9-1 6-3 12-0 4-2 C9-2-2-3 WATERTIGHTNESS UF JUINT AT DRAIN 130 70-7 15-6 9-1 6-3 12-0 4-2 1-7 C9-2-2-3 GENERAL REQUIREMENT (SHOWER STALLS	()	13		.22	. 2	-	۵		
C9-2-2-3 WATERIGHTNESS OF SHUWER/ENCL 54 29.3 5.0 3.5 5.0 1.7 C9-1 GFNERL REQUIREMENT (U) 608 42.5 38.9 44.0 15.0 C9-1 QUALITY OF FIXTURES (O) 129 44.0 15.0 C5.2 RODENT RESISTANCE (U) 1 C7 C5.2 RODENT RESISTANCE (U) 1 C7 C5.2 GSTRIBUTION SYSTEM (U) 1 C7 C5.2 GSTRIBUTION SY	C > - 5	WATERIIGHINESS OF JUINE		13		.7 15.	6	å	_^J		7
C9-1 GFNERAL REULIREMENT ()) 608 42.5 38.9 440 15.0 C9-1-1 QUALITY OF FIXTURES 603 100.0 42.5 33.9 440 15.0 C5-2 PROTECTIVE REQUIREMENT () 129 8.3 110 4.0 C5-2-4 FREEZING 6.8 95 95 3.3 C5-2-5 MATERISTRANCE 22 8.8 95 3.3 C11 WATER DISTRIBUTION SYSTEM ()) 1 1 44 22 8	- C9.2	WATER LIGHTNESS OF		54		٠٥ د.			3	0	7
C9-1-1 QUALITY OF FIXTURES C5-2 PROTECTIVE RECOUREMENT (0) 129 B-3 110 4.0 C5-2-4 FREEZING C5-2-5 RODENT RESISTANCE C11 WATER DISTRIBUTION SYSTEM C11 C11 C11 WATER DISTRIBUTION SYSTEM C11 WATER DISTRIBUTION SYSTEM C11 WATER DISTRIBUTION SYSTEM C11 WATER DISTRIBUTION SYSTEM			())			2.	å	+	5	5
C5-2 PROTECTIVE REGULIPEMENT (0) 129 8-3 110 4.0 C5-2-4 FREEZING 107 42.9 6.8 95 3.3 C5-2-5 RODENT RESISTANCE 22 17-1 1-4 22 -8 C11 WATER BUSTRESSIENCE (0) 1 -1 1 -0				0		°	2.	÷	4	5.	9
C5-2-4 FREEZING C5-2-5 FODENT RESISTANCE C11 WATER DISTRIBUTION SYSTEM C11 - WATER DISTRIBUTION SYSTEM C12 - WATER DISTRIBUTION SYSTEM C12 - WATER DISTRIBUTION SYSTEM C12 - WATER DISTRIBUTION SYSTEM C13 - WATER DISTRIBUTION SYSTEM C12 - WATER DISTRIBUTION SYSTEM C13 - WATER DISTRIBUTION SYSTEM C13 - WATER DISTRIBUTION SYSTEM C14 - WATER DISTRIBUTION SYSTEM C15 - WATER DISTRIBUTIO	15.67	PRUTECTIVE REQUIPEMENT	<u></u>	\sim				8.3	7		4
C5-2-5 RODENT RESISTANCE 22 .8 C11 WATER DISTRIBUTION SYSTEM .1 .0	C5.2	FREEZING)			2.	6.8	66		ζ
OIL WATER DISTRIBUTION STEEM (0) I . 0	.2.5.	RUDENI KESISIANCE		77			7.	1.4	77	20	Ċ
		V 1 L 3	3	-				• 1	7	0.	中

HUD SAMPLE DATA

LEVEL	04.00	* * * * * * * * * * * * * * * * * * * *	3	4 1	r 50	ক থ	0	30 4	0 4		S,	0 0	0 4	70	4	n 0	7			+ in	٥.	o vr	0	'n,	0 0	9	4 "	n 4	. 20	4.5	٥ ٥	ι υ .:	o -†	w.o
*HUMES	0000	# # # # # # # # # # # # # # # # # # #	23.6	23.3				· .			. 1	0		• 1	 	. 1	-	16.4	; į	11.8	0.7	7 . 4	5.5	. 2			5.3	200	0	· ·	* *	•1	• 5	30
HUMES %		1205	680		† 4	m c	7		- r-	2	2		7 (2	2	2	7 2	Ż	473		339 198	0	2	158	in (7 ~	1 -	152	1 54	; ~	14	71	2	2 2	
%3KD		* * *			٠.٠	m, c	. 2	-	. 2	• 2	• 5		• 2	7.	• 2	7 7.	~ ° ~	•	1.	62°U 35°5	*	•		ဆ	• (• 2	24.4	3.7	. 2	2.6	2.1	m, n	1.3	5.5
84TH	0 00 00	* * * * * * * * * * * * * * * * * * * *			100.0	4	9	33.3	ů		0	50.0 G. G.	•	100.0	;		0			-	96.0	-			. .	, e		•	1.9	7	: :	12.5	٠,	37.5
%21 H	0.00	* * * * * * * * * * * * * * * * * * *					100.0		0.001		,	50.0	,			00	100.0				1.16		100.0	(40.0	, ,					92.9	9		33.3
% P L P		4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4															100.0																	
%71H		* * * * * * * * *		 																														
02		2294	962	546	טיט	m r	2 2	ı	1 ~	2	2		7	· ~	2	2 2	2 .	2 609	ı i ı	386	-	4	160	5	7 ~		152	1 م		10			v 80	1 3
	00	* * * * * *	ĵ.	944)	5	00	3	(0	2.1	0)	0		0)	,	0	G G	(7	7		<u> </u>		11.	5	(0			151)	53)	1	0	1	0	2)	
		* * * * * *	~	-	_	- .	-	>	,		_		~		-		- -	-	-			-	-	_			-	~		- .	-	_	_	_
H LEVEL SUMMATIUNS:		维维格尔法拉拉格尔基格格格尔基甲基格格尔德尔格格格格格格格格格格格格格格格格格格格格格格格格格	PLUMBING	JOINTS + CONNECTIONS/TIGHT [GAS, WATER	ORATNAGE SYSTEM GRADE OF HURIZONTAL DRAINAGE PIPING		GENERAL REDOINEMENT FIXTURE CONNECTION	INSTALLATION OF PLUMBING FIXTURES	BRACKETS DROHIBITED FITTINGS AND PRACTICES	TOTAL CANT	TRAPS	TRAPS REGUIRED	HANGERS AND SUPPOPIS	PIPING SUPPORTS/INTERVALS	TEM	WATER HEATER SAFETY DEVICES RELIFE VALVES	RELIEF VALVE DRAIN			14.	~	ALL FRA	INSULATION	LUAD CARRYING CAPACITY	INTERIOR COVERING	WALL FRAMING		FINDS - AIR INFLIKATION	GLAZING	ROOF SYSTEM	CAULKING	HEAT LOSS	FLOOR SYSTEMS	HEAT LUSS INSULATION
=	> > SEN	ENT	P	٦		٩				1				1	- 1																_	_		
FOURTH THROUGH EIGHTH LEVEL	C11.3.2 VEN. C13.5 VEN. C13.5.3 VEN.	******* ENFORCEMENT *******	PART C PL		C12 D		69.1.3	C9.3	C9.3.3		C8.1	C8.1.1	C8.1.3	C10.2	C11	C11.3	C11-3-1-3	DADT B		86,87	86.5/6.6	86.5/6.6	87.5	86.6	30.0	.86.6	86/87/88	B6/87/88		86/87	1	67.5	86/87	87.5 87.5

			HUD S	SAMPLE DATA	TA								
F OUR TH	THROUGH EIG-	FOURTH THROUGH EIGHTH LEVEL SURMATIONS:		Z	NO. &	€7TH %6	%6TH %5	5IН .64	4 TH 6	43RD 1	HUMES	*HUMES	LEVEL
FDEF FDEF2.	86.10 86.10		<u> </u>	0	. 2 2 .		100.0	25	201	m m (00	6 2
FLCC1.	86.9	DECKING	_	<u> </u>			100	.0 12		2.5		30	v o
MINI	86/87	PARTITION WALLS	_ ~	6 6	9 1			0,1	5	J•1	in a	.2	4 0
INSS2.	86.5/6.7			5	· ~		50	٠ ,	20	.5	n ~	7	n ə
I NS S4.	86.5/6.7	DUUR FRAMING			ή,		50.	. ე 50.	0.	3.	'n	• 1	0
Y Y Y	<u> </u>	TRANSII CUNSIDERALIUNS	_	1	-					• 2	-	•	1
EL EC	PART E	ELECTRICAL	_	4 (0	06	1	1				591	13.6	6
EWOR	E11	WIRING METHODS	- 15		90				m	4.	153		4
EXUR	E20	LIGHTING FIXTURES)	117) 1	17				2	6.6	102		4
FFRO	E19	RECEPTACLE OUTLETS	J		94					7.	11		4
7 C	E19.1	INSTALLATION IN ACCURDANCE			84			100	C	7.1	71		5
E 608	F23	GRUCINDING AND BUNDIAG			15					0.4	20		4
1.60 m	E23.1		_ ,	51)	51			100.0		10.4	2 C		S
CATE	E22	TYPE OF MITHORS EIVINGES AND ENTROPERT	_		jn o					8°0	37	1.3	4 (
130	F1 × F1	INTORES AND EQUIPMEN		211	700			100.0) •	ე . ე (7		ς,
286	0 1	MALL SALICIES	_	110	7 €					0° 3	28	1.0	+
неат	PAKT D	HEATING SYSTEM	_	0) 2	219						201	7.0	3
HAPL	06	APPLI ANCES	-	01 2					6 	3.6	187	į e	4
HAAC	7. 90	ACCESSIBILITY - INSPECTION, SERVICE, E	J	0) 1	102			64		5.04	101		5
HAAC 2.	0.00	HOT WATER HEATER-PUOR ACCESS			0.2		100.	0	7	6.6	101	3.5	0
HAVA	06.4	VENTING. VENTILATION AND COMBUSTION	_		76				(1)	4.7	7.1		5
HAVE	06.4.1		_	ŝ	20		7		n	34.7	7.1		0
HAVE4.	7.4.7				50 I	· T	. 7		. 7	4.2	64		7
HAVES.	00 -4 - 1	ELEGNACE	_	11		230	5.6	8.9 10	_	0.0	22	ထ	7
HAVE32		HOT WATER HEATER			2 00	~ ~	. 0			7.0	ρ 7	•	10 n
HAVE2.	06.4.1	SYSTEM CONSISTING OF LISTED COMPON				, -	\ (\			- LC	n -	•	0 1
HACA	06.10			()	. m	4	1			7 7	¥ 5) · (٠.٢
HACS	06.10.1	SUPPLY SYSTEM	_				5				-	0	1 -4
HACS3.	06.10.1.3	AIP TIGHTNESS DI			-	100	0.	9	ć.		-		~
HAIC	06.3	IANCES	J	ີດ ດ	6			4		4.1	ဆ	E)	5
HANP	06.3.3	NEGATIVE PRESSURE CREATED BY AIR	J	0)	6					4.1	ω	.3	'n
HANPZ.	06.3.3.2	LUCALION OF A			6 ;	100	.0 100.0	4 0	*, *	4.1	·.Q	ش ا	1
HPSY	04.2.2	PIPI		10	13					۶.٠	13	.5	.
HGPS	05.1	GAS DIDING SYSTEMS	_	<u> </u>	٦.			-	ć	יי עו	٦,	<u>.</u>	4
2	1.0	CHO FING STOLENS	_	/1	7			100.0	ာ	۲.	1	0.	2

Appendix C

Problem Summation Tables - Private Sample

	SECOND A	IN THIRD L	SECOND AND THIRD LEVFL SUMMATIONS:			NO.	%2ND	%15 f	HOMES	&HUMES	LEVEL
PART C PLUMBING (0) 681 29.9 11.0 PART C PLUMBING (0) 681 29.9 11.0 2.7 1.	ANSI	ANSI All	9.1	~	0	2230		36.7	808	83.6	2
PART D HEATING SYSTEM (24) 533 29-8 8.6	CONS PLUM ELEC HFAT	1	CUNSTFUCTION PLUMBING ELECTRICAL HEATING SYSTEM		3636	1479 681 01 59	29.9 29.9 2.1 2.1 2.6	23.8 11.0 1.0	67 4 67 8 6 6 6 6 6 6 6 6 6 6 6 6 6 6 6 6 6	70.2 46.8 5.6 6.0	 William
PART C PLUMBING PART C PLUMBING PART E ELECTRICAL PART B CONSTRUCTION CONSTRUCTION CONSTRUCTION PART B CONSTRUCTION CONSTRUCTION PLUMBING ELECTRICAL FAMGE - GAS/ELECTRICAL FAMGE - GAS/ELECTRIC FUNDAGE - HOT DRAGE - GUIPMENT (11) 367 2.3 RANGE - GAS/ELECTRIC FUNDAGE - HOT DRAGE - GAS/ELECTRIC FUNDAGE - GAS/ELECTRIC F	ANSI	ENFORCEME	TNI	_	0	1791		28.9	635	66.1	2
CONSTRUCTION CO	HEAT PLUM FLEC CONS	I	HEATING SYSTEM PLUMBING ELECTRICAL COMSTRUCTION		24)	533 469 463 326	29.8 26.2 25.9 13.2	8.6 7.5 5.3	302 314 299 235	31.2 32.5 30.9 24.3	 യാധയി
CONSTRUCTION PLUMBING ELECTRICAL HEATING HEATING RANGE — GAS/ELECTRICAL APPLIANCES — EQUIPMENT RANGE — GAS/ELECTRIC FURNACE + HOT WATFF HEATERS REFRIGEPATOR REFRIGEPATOR RISCELLANBOUS MISCELLANBOUS RISCELLANBOUS CONSTRUCTION (34) 223 18-2 3-6 3-6 4-8 2-1 3-6 3-6 4-8 2-1 3-6 3-6 3-6 4-8 2-1 3-6 3-6 3-6 3-6 3-6 3-7 3-7 3-7 3-7 3-7 3-7 3-7 3-7 3-7 3-7	ZANS	POUTINE	KAINTFAANCE	J	2)	1490		24.0	809	71.1	2
MFCHANICAL/ELECTRICAL APPLIANCES -EQUIPMENT (11) 367 5.9 2 RANGE - GAS/ELECTRIC FURNACE-HOT AIR.6AS OR UIL EXHAUST FAN HOT WATFF HEATERS REFRIGERATOR ELECTRIC BASEBUARD HEATING UNITS MISCELLANEOUS MISCELLANEOUS A 4.5 2.9 2.9 2.9 2.7 3.5 3.0 3.0 3.0 3.0 3.0 3.0 3.0 3.0 3.0 3.0	NCON NECON NECON NHIO	CONSTRUC PLUMBINC ELECTRIC HEATING	T 10N		34)	1127 223 131	72.6 15.0 4.8	18.2 3.6 2.1 2.1	106 106 112	59.9 19.2 11.6	m :n
RANGE — GAS/ELECTRIC FURNACE+HOT AIR.6AS OR UIL EXHAUST FAN HOT WATFF HEATERS REFRIGERATOR ELECTRIC BASEBUARD HEATING UNITS MISCELLANEOUS RANGE — GAS/ELECTRIC RANGE — 30.5 1.4 T2 13.7 1.4 T2 19.6 1.2 T2 19.6 1.2 T3 1.4 T2 19.6 1.2 T4.2 .3 T4.2 .3 T5.2 14.2 .3 T6.2 14.2 .3 T6.2 14.2 .3 T6.2 14.2 .3 T6.3 .0 T6.4 10.4 10.5 T6.4 10.4 10.4 T6.5 1.4 T6.6 1	APFO	MECHANIC	APPLIANCES	J	11)	367		5.3	271	28.0	7
MISCELLANEOUS 4.5	ARGE AFHA AFFX AMWW AGRE AFFB	RANGE FURNACE EXHAUST HOT WATE REFRIGER ELECTRIC	GAS/ELEGTRIC HOT AIR.GAS OR UIL FAN F HEATERS ATOR . BASERDARD HEATING UNITS		(5) 33) 14) 28)	112	30.5 23.7 23.7 19.6 14.2 8.7	24.11.22.00.00	200 200 1	10.01 8.00 7.3 5.2 5.2 2.9	
	MISC	MISCELLA	NEOUS	1		278		4.5	239	24.7	2

LEVEL

HUMES SHUMES

	4151
	*2NU *
-11	23KD
PRIVATE SAMPLE DATA	1966
	SUNMATION:
	FUURTH LEVEL SL
	FUUS

CONS	PARTB	CONS PART B CLUSTRUCTION	~	3	1479		6.40	53.8	670	70.2	'n
R OOF	86/87	PCOE SYSTEM	-	5	10	:	1 3		353	1 0	4
3 E Z	86/87	PARTITION WALLS	_	5	308	0			-	0	4
FICE	H6/B7	FLOUR SYSTEMS		<u></u>	0	6,	21	0	4	'n	J.
DF X I	46/61/88	ULUKS EXIERIUR		<u> </u>	0 -	<u>.</u>		0	0 0	0	ŧ «
M Z F X	30/51/58 84/87			5 0	n x	0	0		7	÷ ~	f d
TRAL	E-APP.	TRANSIT CUNSIDERATIONS		0 0	2 0 0	 	1.2	• •	27	- ° ~	* 5
DINT	85.3.2/3		_	()	4				4	0	7
TIDN	16.5.1	TIFOUWNS)	0)	1	-1	0.			*	4
PLUM	PART C	PLUMB ING	_	(0	681		29.4	11.0	453	8.64	m
PFIA	(3	İ	-	(5)	520	76.4	22.3		378		7
PRFC	C5.2	PROTECTIVE REGULFFFENT vents and vential		00			7.0	2.0	147	15.2	+ 1
			-		4	-d •					
ELEC	PART E	FLECTRICAL	-	6	61		2.7	J. 1	5+	9.6	- I
FhOF	E11	WIKING METHODS)	0	0.1	100.00	2.7	1 • 0	54	5.6	4
HFAT	PART D	HEATING SYSTEM)	5	65		2.0	1.0	50	0.0	m
HPSY	0.5	PIDING SYSTEM	-	(0	55	93.2	2 • 4		54	5.6	7
HAPL	Do	APPLIANCES	_	ĵ	4		• 2	• 1	\$		3
***	2. 女子子子子子子子子子	经证券经济证证证证证 经有证证 经营销的 经存款证证 经外汇证 经转换 法法律的 医神经神经神经神经神经神经神经神经神经神经神经神经神经神经神经神经神经神经神经	* * *	# # # #	#	* * * * * * * * * * * * * * * * * * * *	* * * * *	* * * * * * * * * * * * * * * * * * * *	计分析特殊标件计	计计计计计计计计计	***
* ANS! *****	ENFORCEMENT x + + + + + + + + + + + + + + + + + + +	格林 经存货 计设计设计 医多种性 医多种性 医多种性 医多种性 医多种性 医多种性 医多种性 医多种性	* + + + · · · · · · · · · · · · · · · ·	# + C + + C + + C + + C + + C + + C + + C	1791	· 特 · 特 · 特	*	28.9	444444444	66.1	* * * * * * * * * * * * * * * * * * * *
HEAT	PART D	HEATING SYSTEM	~	231	523		29.3	° °	302	31.2	т
HAPL	D6	APPLI ANCES	-	5	456		25.5		278	23.7	7
нРSY	9.5	PIPING SYSTEM	_	2		2.6	2 .	æ.	4	. 4	#
Pt UM	PA41 C	PLU4BING	~	5	409		25.2	7.0	314	32.5	3
JCTI	C7.1	JUINTS + CONNECTIONS/TIGHT 1645, WATER	_	201)	201	2.	0		171		5
DSYS	C12	DRAINAGE SYSTEM	<u> </u>	5)	7.8				7.1	0	7
A P P P P P P P P P P P P P P P P P P P	ر د ا	EATER DISTRIBUTION SYSTEM		5 -	200	· 2			52		÷ :
VANV	C1 3	AND VENTING		7	13 C				3.1	0 0	r 31
PFIA	60		_	0	30		1.7		5.5	3.1	7
PHAS A 10F	C10 C5.1.5	HANGERS AND SUPPORTS ALIGN OF FITTINGS/DIRECTION OF FLOW	<u> </u>	3)	27	5.8	1.5	φ 3 • 1	2.5	2 - 8	4 1
J-1 E-1	TOAC			í			٠.		ı s		
	A K 1	ELECIKICAL	-	6	463		6.67	۲۰۶	4.62	30.9	
E WOR F XUR	E11 E20	WIRING METHUDS LIGHTING FIXTURES		55.0	154	33.3	3.4	1.0	136 53	14.1	† †

FOURTH LE	FOURTH LEVEL SUMMATION:	.701		. C Z	\$3KD	\$2ND	#1ST	HOMES	& HOME S	LEVEL
EACR EMKF ED1S EGDB EBFA EREC EFRO EPOW FUND ERXY EFPL	E7 E25 E23 E66 E19 F18 F10 E12 E5.0	BRANCH CIRCUITS REGUIRED ELECTRICAL MAKKING DISCENNECTING MEANS AND GRANCH CIRCUIT GROUNDING AND BUNDING GUIDOUR GUILLETS, FIXTURES, AIR-CUULING RECEPTACLE GUILLETS WALL SWITCHES POWER SUPPLY UNDER CHASSIS WIRING MATERIALS AND EQUIPMENT SWITCHES AND RECEPTACLE PLATES CONNECTION TO TERMINALS AND SPLICES		55 33 33 56 61 11 22 11 23 33 34 34 31 31 31 32 33 34 34 36 37 37 37 37 37 37 37 37 37 37	11. 24. 24. 24. 24. 24. 24. 24. 24		, , , , , , , , , , , , , , , , , , ,	233 114 124 133 133 1	7.26.27.11.1 7.36.27.11.1 7.36.27.27.2.3.3.3.3.3.3.3.3.3.3.3.3.3.3.3.3	44444444444
CONS	PAKT 3	CONSTRUCTION	9	326		18.2	5.3	235	24.3	٣
EXTW FLOR RODF INTW WNDW DEXT	96/87 86/87 86/87 86/87 86/87/88 86/87/88	EXTERIOR WALLS FLOOR SYSTEMS PARTITION WALLS WINDOWS DOURS EXTERIOR DOURS INTEKIOR	3900001	2222	46.0 24.5 15.6 8.3 2.1 2.1	1		10140	4 - 4 0	1 7 7 7 7 7 7
* * * * * * * * * * * * * * * * * * *	**************************************	######################################	* * * * * * * * * * * * * * * * * * *	****** 145 ****** 112	* * * * * * * * * * * * * * * * * * *	* * * * * * * * * * * * * * * * * * *	**************************************	**************************************	******** 1 • 1 7 ********	* * * * * * * * * * * * * * * * * * *
						:	• •	- i	• j	, , ,
NCXD NCXD NCPD NCBL NCHH NCFL NCFL	AINDGWS EXTER 103 PARTITION BLOCKING HOT WATER FLOOR SKIRTING EXTEP 103 TIE DOWN	AINDGWS EXTERIUM DOORS PARTITIONS DOORS BLOCKING FLOCK FLOCK SKIRTING EXTERIOM STAIRS TIE DOWN STRAPS LOOSE, FTC	1 2 2 4 7 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8	255 255 255 255 255 255 255 255 255 255	1,400 1,400	2000 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0	200000000000000000000000000000000000000	1333 2433 1672 700 26 134 9	2000 2000 2000 2000 2000 2000 2000 200	# # # # # # # # # # # # # # # # # # #
NPLM	PLUMB ING		94) 223		15.0	3.5	186	19.2	£
X 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4	FIXTUERS SEWER WASHING MACHING DISH WASHER WATER SUPPLY PI	ACHING FR PLY PIPING	0 757	100000000000000000000000000000000000000	75.3 3.0 2.2 2.2 1.3	11.3	2.7	142 88 5	14. 7.00.00	1
NELC	EL EC TR I CAL		50	131		90 • •0	2.1	112	11.6	J.
NEDP NESW NEKC NEIF NESR	DISTRIBUTION PANEL SWITCHES RECEPTICAL OUTLETS INTERINF LIGHTING SERVICE	DISTRIBUTION PANEL BOARD SWITCHES RECEPTICAL OUTLETS INTERIOR LIGHTING FIXTURES SERVICE	15 15 (12)) 31) 16) 15) 15) 12	23.7 12.2 11.5 9.2	1.00	2 2 2 2 2	31 15 13 12	2.11.2.5.11.5.5.11.5.5.11.5.5.11.5.5.11.5.5.11.5.5.5.11.5.5.5.11.5	

FOURTH LI	FOURTH LEVEL SUMMATION:			=======================================	83RU	42ND	3151	HUMES	RHOMES	LEVEL
NHTG	HEATING	_	7	7		5	• 1	7	7.	8 I
NHGP	CAS SUPPLY PIPING	! ! !	 		42.9	• 5	0	n	۳.	4
李春春春春春春春春春春春春春春春春春春春春春春春春春春春春春春春春春	蜂糖毒素或毒素不要,有有有有有有有有有有有有有有有有有有有有,有有有有有有有有有有有有有有有	* * *	*****	367	* *	* *	5 - 6	271	按特殊实验存款的 医乳蛋白蛋白蛋白蛋白蛋白蛋白蛋白蛋白蛋白蛋白蛋白蛋白蛋白蛋白蛋白蛋白蛋白蛋白蛋白	*****
ARGE	RANGE - GAS/ELECTRIC	}	(59)	112		30.5	1 • U	2.5	0.01	
ARHM	HAR DWARE		5)	25	22.3	ο. 2.5	†	21	2.2	7 7
ARGE	GAS LEAK			Jr .**	8.0	2.5	~ ·	∞ m	∞ °	7 7
ARCL	CONTROLS		0	۱ 🚙	7	i m	0	~	7.	1
AFHA	FURNACE, HOT AIF, GAS OR UIL	_	381	27		23.7	1 - 4	7.7	2 2 2 1 1	3
AFWT	MAIL THERMUSTAT	-	18)	18	20.7	6.4	ς.	1 8	1.9	4
AFDF	FURNACE DOURS		•	11	12.0	3.0	• 2	11		4 4
AFCL	CONTROLS		5 7	×Δ	7.6	2.2		n 4	n d	1 1
AFBM	DECEMBER ASSUMBLY ALLEMER MOTOR		2)	> 1	2.3	, c		2	• 2	*
AFFG	FUEL GUN	_	(0)	7	2.3	• 5	2	2	. 2	ř
AFTR	FILTER			2	2 • 3	5.	0.	2	- 2	r :
AF AB AF SC	HURNEK ASSEMBLY FUEL SUPPLY CHNNECTION				1.1	٠.	2.0	-		7 3
AFEX	EXHAUST FAN			72		19.6	1.2	71	7.3	2
AHWW	HEATERS	_	(+1	52		14.2	. 	20 0	2.2	ξ
AHEL	FLECTRIC HOT WATER HEATER GAS HOT MATER HEATER		(S)	36	3.8	9.5	00	35	3.0	+ 4
ACRF	. REFFIGEKATON	_	23)	32		5.7	\$ \$ \$	28	2.9	0
ACRG ACRG	REFRIGERANT SYSTEM GASKETING (DUDRS	~	3)	- 1	9.4	23.4	23	2 1	• 2	4 4
AFFB	ELECTRIC BASEGDARD HEATING UNITS	_				.3	0.	7	. 1	

FOURTH THROUGH EIGHTH LEVEL SUMMATIONS:

HUMES SHOMES LEVEL

6.35.0

24 TH

451H

#SOTH

H1 12

6. 25.5 115.3 10.2 2.2 1.2 7.1 1.2 3.0 13.9 26.9 28.4 28.4 20.4 B • € 2.8 2.7 2.7 1.2 0.51 30.5 27.5 5.6 1.0 30.0 2.9 4 • 7 • 0 5-----247 129 99 21 12 69 42 279 275 275 27 26 12 12 12 155 120 35 135 135 10 94 66 28 28 45 4.7 1.4 1.4 3.0 2.6 2. 2.3 4.5 1.9 3.0 2.4 20.8 20.4 20.4 19.7 1.9 1.8 22.0 14.6 6.1 1.3 06.1 12.2 5.0 3.0 2.8 9.6 7.8 2.0 21.3 98.6 47.1 +7.4 35.1 13.1 18.2 4.1 23.7 15.1 4.1 5.9 57.1 83.0 23.0 73.9 15.2 8.7 66.3 27.7 33.3 3303 33.3 0.00. 9.1 2.3 **5.96** 0.00 0001 41.1 25.0 23.2 7.1 00001 308 302 302 10 101 67 28 153 102 21 21 12 09 460 6 4 5 36 5 291 28 27 12 12 12 05 123 36 138 136 85 70 40 5) 238) 0 5 5 5 5 33 3 3 5 5 25 0 INTERSECTION OF ROOF AND EXTERIOR WALL MLM. PENE PENETRATION OF EXTERIOR COVERING WEATHER RESISTANCE - WATER LEAK ROUF TRUSS CUT FOR ROUF JACK EXTERIOR WALLS WEATHER RESISTANCE - RAIN LEAKS FASIENING OF STRUCTURAL SYSTEMS FASTENING OF STAUGTURAL SYSTEMS PANELING TO WALL FRAWING FASTENING OF STRUCTURAL SYSTEMS DECKING TO FLOOR JOISTS RUCEING TO TRUSS ATTACHMENT FLOUR SYSTEM TO METAL FRAME CEILING TO TRUSS ATTACHMENT RAIN LEAK - WATER RESISTANCE SYSTEM AT VENT PIPF (PLUMBING) FLUOR COVERING TO DECKING AT VENT PIPE I HEATING! DOUBLE WIDE MISALIGNMENT AT DOUBLE WIDE JUINT MEMBRANE PENETRATION DURABILITY OF PANELING UNDERNEATH OF FLUDA AT TIP DUT JUINT WEATHER RESISTANCE UAD CARRY CAPACITY WEATHER RESISTANCE RODENT RESISTANCE WEATHER BAPRIER FLOOK COVERING PARTITION WALLS DOORS EXTERIUR FLOUR SYSTEMS DUPABILITY RUSS TRUSS RUDE TRUSS DURABILITY CONSTRUCTION RUDE SYSTEM DEFLECTION DEFLECT TON DURABILITY JURABILITY DECKING DECKING DECKING DECKING CEILING MEMBRANE WINDOWS 87.1/B8.5 86/87/83 86/67/88 86.5/5.7 86.5/6.7 r 86.10 86.10 86.10 86/87 86/H7 36/87 86.10 86/87 86.5 86.4 86.4 PAKT 86.5 86.5 86.5 86.5 87.1 87.1 87.1 67.1 87.1 A7.1 90.40 86.5 86.5 87.1 87.1 87.1 87.1 RDEF 1.
RDEF 7.
RDEF 7.
RLCC
RDEL
RTRS
RTP S4.
CE 11 FLWR FLWP1. FOFF FDEF 1. DEXT RIEW RFSS RFSS4. INTW INSS INSSI FDUR1. FDUR3. FDUR3. FLPR FASS FASS1. FASS2. RLMP2. RLMP4. RLMP5. RFSS5. RFSS3. FASS4. - XWR 1. RLMP 3. RDUR FLOR. MONM REWR RLMP DEWR DEDU YMZE ANDR EXTW ROOF 115

FOURTH THROUGH EIGHTH LEVEL SUMMATIONS: EXWR?. B7.1 WINDUMS EXWR3. B7.1 D0F43[ITY EXDR. B7.1 EXTENTION FAMILIANS EXDR. B7.1 EXTENTION FAMILIANS		N.J.	174 % 5 ГН	45TH	4.77 4.77	7.380	HUMES & 19 11 11	AUMES L	EVEL o
AVE ET EALS		19		~	>	1.3	19		0 ,
AVE + 1 RAI:		4		. u		7 .	11		
1 H 2 N 1 H 2		11		ŝ	2			0	0
L.V.C. P. I. P.J.	-	13			.0	٠,	13		S
		(2)		-	5	5.	0		9
FASTEMENS		30		~		•2	m		э
COVERING		2		15.4		• 1	2	• 2	S
TRANSIT CONSTUERATIONS	3	2				1.8	2.7	- 0	4
A FRAME ASSEMBLY	(14)	1			8	1 - 1	17	1.8	2
TRANSVERSE MEMBERS				17.6	11.1	• 2	3		9
		10			7 .	.7	10	1.0	7
DOUGH INTERIOR	5					. 3	4		4
LUCKS. HARUMARF					100.0	٠,	4	*	5
	(0)					• 1	1	• 1	4
LOAD CAPACITY					100.0	• 1	1	• 1	Ç
	ن •	681					453	8 - 24	3
						1.	1 5	i	`
IURES	7	26			-	0 u	- 0		† u
	٠ ١	3 (,	• V ·	° 1	O 4		n -
	25	61		ה ה ה	9 4	1002	7 0		7 0
		* -		77	• -	12.5			- 1
1 4 5 0 E V 1 C E		3 -		0 7	٠, ر	7.0			. ~
345 I CA		† -		^		7 • 7			- 1
UES 1 67	,	- 0	•			7 2 6	_		- (
	7	O r	-	1		21.03	- 0		7 0
OF SHUMFAZENCE		Y) "	•	C ~		0.0	0 0		- 1
OF COLST AT UK		70	, u	חיי		† ° C	ა - ი -		- ^
- ^ N -		7 (0	7		0.1	4 .		ی -
- u	-	71		9		50	າ ⊂		1 4
1	C -	-		9		, ,	9) †
1	,	15			6	, ,	. 4		5
		١			•	•	•		10
NIING	0					• 1	-	• 1	of.
VEST TERP. INAL	0					• 1		• 1	5
				1,10.0		• 1	1	• 1	0
	•								
	2	٥ i		1	1	1		• j	1
	0	P				.00	54		.+
FITTINGS. CAMINET					100.001	٠,	54		5
HEATING SYSTEM	.5	ú.					5 &	0	2
PIPING SYSTEM		1 4		1		1 ~	24	1 .	\$
SYSTEMS	7	5				4	54		5
)		, iv		00.	000	*	54		0
FODENT RESISTANCE		J		103.		9	5.6		7
	ر ب	_					4	4.	5
INSTALLATION OF APPLIANCES	0	_					4	4.	5
MIS-LOCATION OF FURNACE THERMOSTAT		4		100.0	00		*	4.	2
· 乔宁森泰尔 经存货 计设计设计设计设计设计设计设计设计设计设计设计设计设计设计设计设计设计设计设	***	計	***	* * * *	**	*	* * * *	*	44.
	٠ -						639		
经济公司作品债券部件行行的保存额的存在的证明	***	**	***	: 你你你你你	**	********	作技术作者作品	상	· · · · · · · · · · · · · · · · · · ·
NG FIXT ORES IN THE STATE OF TH	UN DEVICES UF SHUNFA/ENCL UF JUINT AT DRAIN UNSTRUCTION RES. NT FITTINGS. CARINETS PLIANCES FURNACL THERMUSTAT **********************************	UN	UN (UN (UN (UN CE SHUMFA/ENCL (2) UP SHUMFA/ENCL (2) UP JUINT AI DRAIN UNSTAUCTION (2) RES (2) NT (0) FITTINGS, CAHINETS (0) PLIANCES (0) FULANCE (0) RES (0) NCE (0) RES (0) R	UN	UN (1 1 1 1 1 1 1 1 1 1

3	4	5	9	7	7	7	0	7	7	7	1	7	9	7	7	7	80	9	9	2	9	1	သ	30	7	2	7	- 1	an d	0 .0	· •	7	5	9	٥	<u>ب</u>	۲ .	0	ى م	Ω \	۰ ۵	n <	j- u	7	2 0		~	. 0	9	7	. 4
31.2	30	3											•	1.1						5		6			5.6																		0								
302	278	4	70	4 0	9	2	62	32	6	6	9	2	25	11	9	. 50	-	17		4	141	8	44	18	54	12	4 (n (79	0 4	. <	7	13	2	-	m :	7	٠,	- (7 (7 •	1 7	7 + 7	21	7	. 4	. 4	2	3	-	2
	85.6	35.1	3,	7.5		٠		6.2				4.	4.7	2.1	1.1	6.	• 2	3.2	9	4.	32.5	8	å	3.4	10.5	2.3	æ ·	• (1.1.1	• 1	9 4	4.	2.4	6•	• 2	0.		• 5	7.	* •	5 (7.0	7.0	7	1.3	000	ο σο	30	٥		
 				8 8			•	7.2						2.4				3.7		6	7		5		12.3		6.1	٠,	1000	, ,	7	4.	5.9		• 5		4.	2.	7.	÷ ·	*	7.	3	• 0 4	• (. &	8.2			- 0	
			5			÷		17.6)	3		•	6	30.8			•	c	4 • 6 0				38.5				50.0	÷	0	0.001			3	. (8	8.3				
								6	3					4.		0	4					5.		ċ	32.4							0.001															0.001			33.3	,
																	20.0							18.8								,																			
533	3	187	14		9	2	10	33	6	6	9	2		11		2	-	1.7	· ~	∞	173	6	44	1.8	99	12	4 (ς,	9 0	٧, 4	2	7	13	S	-	m (7	٠,	٦ ،	7 :	7.	1 07	4 7	22	7	. 4	. 4	4	3	-	٠,
28)	0)	1	20)				8						3)			(*)					2)	341							(1		6	;	7.)			ć	6		ć	5	-	10	3 =			0		-	2)		
-	~	_	_				_						¥			J				_	•	_			z				_		_		_				_			-	,		- ~		LICN	•	OF U		-		
HEATING SYSTEM		CIRCULATING AIR SYSTEM	SUPPLY SYSTEM		SIZING OF DUCT		REGISTERS			DIRT. FLOUR COVERING AND DUCT	3 OR DAMAGE	AIR BLOCKAGE	RETURN AIR SYSTEM	PERMANENT UNCLOSABLE UPENINGS		DUCT MATERIALS	.2 FLAME SPREAD NOT MORE THAN 200	JOINTS AND SEAMS	SUPPORTS	VENTING. VENTILATION AND COMBUSTION	1	JOINTS OF VENT SYSTEM SECURE	IAT ER HEATER			NOITAL	Σ	UP KIICHE	2	STRICTIONS	ED BY AT	S AND COTIL	SERVICE,	OR ACCES		LOCATION - RELATIVE TO COMBUSTIBLES	CLUIHES DRYER		MAGNING DUCI CUNNECTION	4 0 1 0 0	CONTRACE CLEAKANCES AND UPERALIUNS	DIDING SYSTEM	ON STATE OF	HANGER AND SIDDORIA			FLEXIBLE CONNECTOR THRU UNDERSIDE	UTOFF LISTED TYPE	ED 0	CORRUSION OF METALS	DIDE LOTAL COMPOUND - COEL LOTALE
			1.1	0.1.3	0.1.2	06.10.1.1	0.5	0.5	D6-10-5-2	0.5	0.5	0.5	0.2	06.10.2.4	06.10.2.1	06-10-2-2	D6.10.2.2	1	06-10-4		06.4.1	06.4.1			06.4.1	4.3	Do .4 .2	4.4	,	3.1		06.3.3.2		7	_	m (, N. (-	7•:	-	1 • 0			05.1.18	77	.13		.14	1.2		7
PART D	90	06.10	D6.10.1	06.10.1.3	06 • 1 (06.1	06.10.5	D6.10.5	D6 • 1	D6.10.5	06.10.5	D6.10.5	D6.10.2	06.1	06.1	06.1	.9Q	D6.	06.	06.	D6.	06.			D6.	06.4.3	D6 •	06.4.4	06.3	06.3.1	06-3-3	06.	06.7	D6.7	D6.7	06.8	06.2	D6.2.1	7.2.00	000	1,6.6.1	0.0	200	2 5	05-1-11	05.1.13		05.1.14	05.1.2		05.1.7

HUMES RHOMES LEVEL

NO. 27TH %6TH %5TH %4TH %3RD

FOURTH THROUGH EIGHTH LEVEL SUMMATIONS:

LEVEL	000000	٠	4	4	n .c	د ر	7	5	91	ζ,	0 6	7 (S	91		- 1	۵ -) 3		(0	'n	a ·	3 ~	1 5	* =	10	Ø	nc is	2	7	Ž	9	'n,	۱۰ ۵	7 - 2	0.0	۵. ۱	٥	9	5	7
S AMOH 2		32.5		- (0	0 70	. 7	9.	• 2	. 2	•			3.6	0	0 1	. 2	. 2	. 2	.,			1 • 1				. j.	• 2	•	• •	• 1	D •	4.	ۍ. •	9.			i	7.	• 1	. 1	⁶ 4
HUMES		514	171	h- ,	л ^ж	270	7	9	2	2 ·		1 4 (4)	4 5	35	14	† -	2	~	1.7	~	1	11	11	3/	10	70	3	7		-		۵.	4	ω.	0 4	m C	ייי ר	n	2	1	7	7
23RD	222222		2.	16.6	÷-				4, 0	4	7.	> ?		7.7			7 0		. 4	4.			2.3	0	0 0			4.	2.0	7.		1 - 7					9	9.	4.	• 2	• 2	7 5
84 TH	222220				0)))	7.7		0	0	0	•	61.0	ŝ	÷ -			0 0		-		xo xo	τ			7.	0				21.1	ò	•		5 1						
#51H	2.1 2.1 2.1 2.1 2.1 100.0		1			C	87.5		33.3	,	υν υ•ο	9		75.0	÷.								100.0		2		7	13.2		0 1			53.0		75.0	~	50.0)	0	33.3		
% 6 Tes			1				87.5								0	18 · V	0									0	÷	20.0		9	100.0											
€7TH			 																								7	25.0	2 0	e J												
11.1		695	201	7.8	2 0) x	~	9	2	5		5.6	48	36	15	14	7 7	7 <	1 ~	2	1	1 1	11	38	10	70	3	2	⊣ -	-		(3)	4	70	o 4	۳ ۵) ~	~	2	1	7	200
	1)	0)	1 -	~) _		(+		0			3)									0		3 3	5 6	1				0		+		2)	-	2		(0		1	1	
			201	31																																						
	¥1	_	1 0	_	,		-	~			n	_	_	•								_			. –	_				,	, T.	J		_	~	_		_		_	_	
ITH LEVEL SUMMATIONS:	PIPING DESIGN — LP SAS/NATURAL GAS (CAS PIPE SIZING (TABLE D—2, PG 71) CONCEALED TUBING INSODE WALLS, FLUOR CONCEALED JUINTS LOCATION OF GAS SUPPLY CUNNECTION (COUL PIPING SYSTEM STRAP HANGERS)	PLUMB ING	1 0		HUR (ZUNTAL DRAINAGE P (PING	FITTINGS	SOCKET FITTINGS FUR PLASTIC PIPE	DRAIN OUTLETS	7.	SYSTEM	NUMBER OF FIXIORE	No. 11 ADE L C - 3	I O		<u>.</u>	GKAUE JF TKAP AKK	1	MATERIALS AND DESIGNS	,	LOCATION	DUAL FIXTURES	OPENINGS	S	AATER HEATER CAFETY JEVICES	ES CENTRAL CONTROL	RELIFF VALVE DRAI	I MPRUPER LUCATION	UNDERSIZE PUPE	TEXTACTOR ENC	-	TAPPING FUR PRESTIEMP RELIEF VALV	WATER SUPPLY	125	SUPPLY CONNECTIONS	PIPE SIZE, LUCATION	25.17	PLASTIC PIPE AND FITTINGS		ON GF PIPE	[IRON	E OF WATER SUPPLY PIPING	
THROUGH EIGHTH LEVEL SUMMATIONS:	LP SAS/NATURAL GA [TABLE D-2, PG 71 U INS(DE WALLS, FL S SUPPLY CUNNECTION	PART C PLUMBING	/IIGHI [GAS, WATEK (20	URAINAGE SYSTEM	GRADE OF HUR (ZONTAL ORATNAGE P(PING	FITINGS	FITTINGS FUR PLASTIC PIPE	DRAIN OUTLETS	.1 LUCATION OF DAAIN	. 5 WET-VENTED DRAINAGE SYSTEM	2 SIZE - PIPING AND NUMBER OF FIXIURE	TRAPS AND CLEANUITS	TRAP	.9 (NSTALLATION	9.4 REMUVARILITY OF TRAP	X 0	PROHIB(TED TRAPS	MATERIALS AND DEST	TRAP SEAL	LOCAT	2 DUAL	CLEANOUT OPENINGS	2.2 ACCESS TO CLEANUALS	YSIEM V DEVICE	•1 RELIEF VALVES	.3 RELIEF VALVE DRAI	brend	UNDERSIZE PUPE	9	-	.2.1 TAPPING FUR PRES/IEMP RELIEF VALV	WATER SUPPLY	.1 SUPPLY PIPING SIZE	MATER OUTLETS AND SUPPLY CONNECTIONS	PIPE SIZE, LUCATION	A DEKMANN HIP	PLASTIC PIPE AND FITTING		CORROSION OF PIPE	.1 PIPING MATFRIAL (IRUN, SILEL, C	SIZE OF WATER SUPPLY PIPING	VESTS AND VENTING

FOURTH TI	FOURIH THRUUGH EIGHIH LEVEL	TH LEVEL SURMATIONS:		202	47TH %6TH	н 251н	41 H	63KI)	HUMES %	%HUME S	LEVEL
VVGL VVTL VVTL1.	C13.1 C13.5 C13.5.1	GENERAL — SIPHONAGE AND BACK PRESSURE VENT TERMINAL POOF EXTENSION	9	31 9			34.3 25.1 14.3	2.6	12 2 2	1.2	023
VVTL2. VVSP	C13-5-2 C13-3	5N I d I d	(0)	- r ·		• •	2.00	. 6	- m -	٠	9 W ·
VVSP2.	C13-3-1 C13-3-2 C13-3-2	MAIN VENI - MINIMOM DIAMFILK OF PIPING INDIVIDUAL VENTS DISTANCE OF EIVIEWE TOAR DECEM VENT				35.53 3.45 3.45 3.45 3.45 3.45 3.45 3.45	2.0	7.7.6		-	0 9 4
VVGC	CI 3.4	UNS TABLE FRUM		10		•	8.0 8.0	7.9	- m		. n
VV6C 1.	C13.4.1 C13.4.2	HURIZONTAL VENIS GRADE				E E E	2.9	• 2			9 9
VMAT	C13.2	MATERIALS	66	-			6.7	7.			W 4
VMAT23.	C13.2.2.3		•		100.	0.001 0	2.9	.2			o ~
PFIA	63	PLUMBING FIXTURES	56	30				.0 л 4-л	30		4 4
DISH	C9.2.3	DISHWASHING MACHINES		7 -		6	0.00	3.8	18	1.9	o 0
DISH2.	C9.2.3.2	PRUHIBITED CONNECTIONS OF UKAIN		01	55.	6 38.5	9	2.1	27		-
WACU	C9 - 2 - 4	CLUTHES WASHING MACHINE	0	8 60	77	2 15. 30.		1.7	† 00	† 30 • •	- 9
WACD 2.	09.2.4.2	FICA			75.	0 23.	3	1.3	9	9.	7
WACD1.	C9.2.4.1	ORAIN CEMEDAL DE CHI DE MENT	•		25	0 7.	0 :	5 °	2 5	• 5	7
PFGR3.	69-1-3	FIXIURE CONNECTION	o -			100.0		0 0	u tu	n ~	n 4
LUPE	C9.3	INSTALLATION OF PLUMBING FIXTURES	0	~				~ ~) -) v
IOPF3.	C9.3.3	BRACKFIS	,	ť		100.0		• 5			9.
PHAS	0.00	DIDING CHOODIST AND SUPPLIED WATER	:: -	2 (8				χ°ς,	7.7	ζ-9	4 u
PHAS3.	CI 0.3	1 × × × 1	(5	_			29.6	1.7			ט ילי
PHAS32.	5	UCTUPE				37.5	-	9.	- M	٠.	٥
ATIJE	C5.1.5	ALIGN OF FITTINGS/DIRECTION OF FLOW		-				• 2	-	. 1	4
FLFC	PART E	FLECTRICAL	0	463					599	30.4	3
FWOR	£11	WIRING METHODS	50	15				33.3			7
EWSU	E11.9			28				ر. ه د و	26	2.7	·Ω:
T T T T T T T T T T T T T T T T T T T	E11.12 E11.6	CABLE PROTECTION		7				5° ° ′		0 0	ν ν
FWBL	E11.4	N.O.		1				1.5	7	2.	2
EW TC	E11.1	TUBING, CONDUIT, CABLE TERMINATION		€ 2			3.2	1.1	ω 4	° ° °	ς Υ
FWPS	F11.7	THROUGH STUD		- 7				6.	4	. 4	, w
DEWS	F11.10	NON-METAL					9.	• 2		• -	יט
FXUR	F20	FRACTICES - AFFLIAN FIXTURES	44	9			0	13.2	5.54 1	5.5	0 4
EXGE	E20.1		0					· —		.5	5
EXGF1.	F20.1.1	SK CE	,			100.0	8.2	1.1	9.	. 5	٥١
T XX	F 7	RECESSED LIGHTING FIXTURE BRANCH CIRCUITS REQUIRED	36	٠,			•	.2.	53	5.5	ς 4
FBCR3.	E7.1.3		5	3			2 •	11.0	51	5.3	C
EBCR35	E7.1.3(E)	MHEN LAUNORY FACI		44				7.7	4 10	4.7	٥
EBCK34.	E7.1.3(D)	RANGE BRANCH CIRCUIT		7		2-0	1 . u	2.	~	. 1.	
EBCK2.	E7.1.2	PURTABLE APPLIANCES	-					<i>></i> 0	4 4 4	\$.	^
EMNP	E25.3	METAL NAME PLATE	n .	24			6 I 9	 	n .⇒) • C	
				f			4	1	,		

EVEL	:0	2	4	5	0 4	2	7	► U	0 0	, ~	- ^	- 4) -	0	Ω.	0	9	7	0	2	†	n	4	2	Q	0	?	4	2	7	. 4	٠,	4	5	4	5	3	4	*	5	•	E 1	4	5	9	0	٥	3 ′	יו כ	ه ۱	9	Ω	9	٥
S		. 1	٠,4	Σ,	0 1	n	4 0		7 .	- ^	7 ^	y n	7.	7.	ۍ . •	→ .	. 1	٠, س		. 1	5	0	6.	က္	٠ ت	• 2	, ,						9.	9.		• 2		. 1	.1	• 1		.3				6.	٠ د د	7.			.7	5.	••	-
SHOME			3	-		•	^	j -	-												2	1	7	~-4				7	7	-	•											24	14	71	Ĺ				-	1	•			
nOME S	11	7	33	13	9	0 -	28	2.0	71	- 0	7 (2	7	7	9 -	→ ·	7	3	-	1	15	13	18	17	3	2	2	1.7	17	13		-	0	9	(1)	2	1	1	1	~		235	3	110	\supset	5	m i	V -	14	10	1	6	9	-
8340	2.4	• 2	7.1	2.8	۲۰۱ د د د	1 - 1	7. 4	~ c	2.5	7	• •	+ <	† ·	3 * (L • 3	• 5	• 2	9.	• 2	• 2	4.5	4.3	4.3	4.1	9.	4.	;	3.7	3.7	3.2	1,3	2.5	1,3	1.3	0	*	• 2	•2	•2	• 2			46.0	7.	2.	2.9	6.	0 ~		٠.	2.1			"
24TH	20.87	2.0		,	7. 91	e O r			72.5	•	0 10				19.4				3.2			2.56		S	ŝ		0		0.00			10.7		0.00			33.3			00.00				30.7	-	6.0		-		, <u>,</u>	1.4			1.
85TH									~	• า เร	15.4	. 4	ů,	Š		10.1	ô		33,3						ŝ	÷	10.5		1	•				1			50.0			1						7.4		l• /		7	36.8		1.69	-
%6TH										-	0.02	0																														1												
%71H																																																						
NO.	11		33	13	91	r -	7 7	10	5 7	- 0	7 ^	7 (7 (7	φ.	-	-	~		-	2.1	50	67	13	~	2	2	17	17		1 4	-	٠.٥	م ا	· ~	2	. →	7	7			326	5	121	0	6	m (7	٠, ١	11	7	5	۵	1
			3				0	0	7 7 7	10					(+)			5)		1)	7		7	12)				<u></u>		151	2.5		0		7	1		1	0			9	60	7					=	3		1		
			_				,	- ·	<u> </u>	-					_			~		_	_		_	_			-	_	•	,			-		_	_	,	•	_			-	_	_					,			J		
ITH LEVEL SUMMATIONS:	MA(N CIRCU(T OF EAKER		IND BRANC	CTION DE	T BREAKFR PROTECTIO	-	OVERCURRENI PRUITION	4	INTERIOR GROUNDING - ELECTRICAL CROTHWING OF GROTHER FOR CONTONE OF	CECUNOLING OF ELECTRICAL FOOL	CROCKLYING TO GROUNDED SIRU	CRUCNDING AT LIGHT FLATURE	MELAL PARIS	GROUNDING CORD CONNECTED APPL	(FCT I IN	(ON PANEL	- CARRYI	TALLIC P(PES/DUCT		· AIR-C	-IXTURES AND	PECEPTACLE JUTLETS REQUIRED	LUCATION ON MALLS	IN KI	ES FUR	SPACES UNDER WALL-CABINET		AL COR DANCE		DILER ALIDOLY	ENTRANCE OF FEEDER ACCESSEVENT TO HOME		PROTECTION OF EXPOSED WIRING	112	LISTED AND APPROVED	EV I	E PLAT	S AND SP			CONSTRUCT (UN	EXTFRIOR WALLS	UKAL SYST	U WAL		WALL TO ROOF	0 1	HEAT LOSS	AIR INFILTRATION	INSULATION	LOAD CARRYING CAPACITY (WALL FRAMING	EXTERIOR COVERING
FUURTH THKOUGH FIGHTH LEVEL SUMMATIUNS:	MA(N CIRCU(T SPEA	5.2 MAXIMUM FUSE SIZE	DISCUNNECTING MEANS AND BRANCH CIRCUI	TON DEVIC	CIRCUIT BREAKFR PROTECTION	MARKINGS	F9.8 UVERCURKENI PROTECTION	CRUUNUI NG AND BUNDI NG	INTERIOR GROUNDING - ELECTRICA	SKUUNUING DE ELECIKICAL EGUI	*I SECURING TO GROUNDED SIRUC MET	SO GRUUNDING AT LIGHT FLATURE	GROUNDING OF EXPOSED METAL PARTS	.4 GROUNDING CORD CONNECTED APPLIANCE	SERVICE GROUNDING	GRUUNDING WIRE CONNECTION	GROUNDING OF DISTRIBUTION PANEL	BUNDING OF NUNCURRENT - CARRYING ME	.3. GROUND(NG JF METALLIC P(PES/DUCT	3.2 INSULATED NEUTRAL	URES. AIR-C	2.1 TYPE OF UJIOUÜR FIXTURES AND E	REQUIRE	LUCATION ON WALLS	IN KI	COUNTER TOP SPACES FOR BUILT	COUNTER TOP SPACES UNDER WALL-CABINET	RECEPTACLE JUTLETS	INSTALLATION IN AUCORDANCE	AND CHITCHES		MICH OIL Y LAKARAKA ANGER ANGER ANGERTA	TEDER CHASSIS WIRING	2.1 PROTECTION OF EXPOSED WI	MATERIALS AND EQUIPMENT	LISTED	ALUMI NUM/ CIPPER DEVICE	SWITCHES AND RECEPTACLE PLAT	S AND SPLICE	7.1 CONNECTION OF COMBUCTURS TO TER		PART B CONSTRUCT (UN	86/B7 EXTFRIOR WALLS	AL SYSTEM	EXTERIOR COVERING TO WALL FRA	WALL TO		0 1	HEAT LOSS	.			H6.6 WALL FRAMING	

F UURTH T	HEOUGH EIGH	FOURTH THROUGH EIGHTH LEVEL SUMMATIONS:			NO.	471H % 6TH	н 45ТН	47 FH	£380	HOMES	&HCME S	LEVEL
EXCC3.	86.6	INTERIOR COVERING			-		11.1	7.	.3	~	1.	Э
EXCR	87.2	CONDENSATION RESISTANCE	_	=	prod			. 7	٠,	1		3
FLOR	86/87	FLOOR SYSTEMS	_	707	90				24.5	7.1		4
FUEF	86.10	DEFLECTION	_	3)	21				t • 0	2.1	7.5	5
FDFF2.	86.10				1 0		85.7		j. 5	13		٥
FLCC	86.9	LUAD CARRYING CAPACITY	_	5)	15		,		4.6	14		2
FLCC 2.	60.0	PLCOK JOINS			ъ. ч		つ 、	7.11		л ,	ō, `	٠,
7 L.C. 1 .	0000		,	,			1.07				•	0 4
FLHL Cliff	3/.7	HEAL LOSS	_	2	71				 	01		٠
FLHLI.	C- / C	IN SOLA - LON			ю .		000			ο.		٥ 、
FLHL2.	6.78	TALENTAL OF STANSTON SYSTEMS	,	1	5 (33.3		7-1	+ .	* •	ا ن
FASS	0.00	ב הסק	-	5	* <		-			r		0 4
ELDN	H C 1	CIDICIAN ARES	U		۰ ۱		0.0		•	, ,		0 4
RODE	B6/87	SINUCIUNAL MEMBER	`	100	2 -					7	7 • 7	0 4
ROFF	86.13	DEFLECTION		; =	21					20		- 15
RDFF3.	66.10	CETLING		•	202		45.2		6.1	19	2.0	۰ ۵
RHLS	87.5	HEAT LUSS	_	0)	14				4.3	6		3 5
RHLS?	87.5.4	AIR INFILTRATION			80				2.5	30	70	9
FHLS1.	87.5	INSULATION			0		7			٩	J.	3
K FS S	86.5	FASTENING OF STRUCTURAL SYSTEMS	_	7	7				2.1	7		5
PFSS1.	86.5	TRUSS CONSTRUCTION			2		m		0	2	• 2	9
RFSS2.	86.5	TRUSS-10-WALL CUNSTRUCTION			2		ဗိ		9.	2	• 2	9
PFSS6.	86.5	TIP OUT MISALIGNMENT			2		73.0			2	• 5	9
RCNR	97.2	CONDENSATION RESISTANCE	_	3)	4				1.2	+	4.	5
RCNK2.	87.2	CELLING VENTILATED		:			25.0		70 ·	- (0
3100	100 g	COOL TONG			n (0	•	n :		2
Z Z Z Z	4.00	L	_	7	7 -	- 0	5 -		ې •	7 -	7.	0 1
. L C L C C C C C C C C C C C C C C C C	B7.4	REDEAT RESISTANCE			٦ ,	*00		7.0	ڻ. د ۲	7 0	٠.	ى -
N I N	B6/87	PARTITION WALLS	_	0	27				η C 1.	2 2 2 3 3 3 4	2.2	٠ ٦
SSNI	36-5/0-7	٥		- -	- 7			ď	7 0		• •	2 1
INSS 5.	86.5/6.7	I OK WALI		:			7					٠. ۵
INSS2.	36.5/6.7	Σ			4		25.0	14.8	1.2) †		ه ه
INSS 3.	86.5/6.7	WALL TO FLOOR SYSTEM			2		2,	7	• Ω	2		C
INCC	85.7		_	2)	3.0			7	3.1	7		5
INCC 2.	86.7				89		80.0			5		0
S HN !	B7.3	INTERIUR FLAME SPREAU - PANELING			-				٠ س	7		5
MONM	86/87/88		_	5	7					7		4
L L L L L L L L L L L L L L L L L L L	87.5.4	TOAD CADONING CADACTES CANDELLINE			ς,			71.4	ار د د	ς.		S I
MNC	00.00 0.00 0.00	-			٠.			•	• • '	-4 F	•	v 1
DEXT	86/87/88	DCOS EXTERIOR	_	100	- 4			•	• -	ન (7 •	n 4
ОЕН	87.5.4	AIR INFILTRA		5	- (4)			5	y 7	r n	• •	٠.
DELC	B6.3	LUAD CARRYING CAPACITY - MACKING						25.0	• •) -		
DINT	88.3.2/3		_	1				١		-		7
*******	***************************************	铁棒弹铁棒棒棒棒棒棒棒棒棒棒棒棒棒棒棒棒棒棒棒棒棒棒棒棒棒棒棒棒棒棒棒棒棒棒	* * * * * * * * * * * * * * * * * * *	· · · · · · · · · · · · · · · · · · ·	经分分价 化二乙二二二二二二二二二二二二二二二二二二二二二二二二二二二二二二二二二二二	**	经共享申请任务条件	棒糖化环糖糖	计计算计算	於 C 計 .	静 静 ·	· · · · · · · · · · · · · · · · · · ·
***	****	计格特尔语语 计计算记录 经营业 医乳球球球 化二甲基苯甲基苯甲基苯甲基苯甲基苯甲基甲基甲基甲基甲基甲基甲基甲基甲基甲基甲基甲基	****	4.4.4.4.4.4.4.4.4.4.4.4.4.4.4.4.4.4.4.	************	本种乔公亦并并为	***	****	***	444444444444444444444444444444444444444	· · · · · · · · · · · · · · · · · · ·	2 本本本本本本本
NCON	CONSTRUCTION	16N	_	1)	1127					515	6.65	~
OM ON	VMCIGN I™		,	1 2 3	ی ز	 	 		1 9	1 0	1 :	
NCWS	SCREENS	NS	-	000	140			•		139	7. + . 4	t .U
NCWH	HARDWARE	ARE						29.4	11.8		- j	*

LEVEL	00,	ς 4	F 50	2	s o	י ינ	2	4	5	ın «	\$ 18	٠ ٠	4	5	ς,	† u	1	* 4	+	5	4 :	0 0	٥. ه	5	Ċ	0 1	ه ۱	9	9 (. v	9	0 4		5 0	N 1	0	3	4 0	+ (n 4
HUMES	9.7	e (f	11.0	о О		0 (0	12.3	0		0 (0	0 0	4.0	•	19.2	14.7	0				0 (15.		ao u	2.4		n a		1 6	. 2	• 1	11.6	3.2		
HOMES &	94	٧.	106	00	17	0	'n	()	116	70	2 62	3,5	26	61	01.	13	51	4 u		186	142	00-	6	40	.0	4 17	3 0	•	u Qu	23	9	να	. w	W 4	2	1	112	31 23	15	1 51
%3 KD	8.4		9.6					2 。	11.5	0					0	0		0 4)- •			٠ ،			~		, ,				7		2.2		J - 1	4.		23.7	2 •	11.5
34 In	3.8		9		6.3				52.0	~		2 4	0	1.99	6		J								3	0	9	0.9				0			9	33.3		74.2		0.0
47c3																						_	14.8		12.2	ဂံ	0	29.4	\$	* *	25.3	•				50.0				
% 6 IH																																								
% 7 TH																																								
ž	95	7	110	ಸ್ತಾ	81.	0	2	2	130	<u>ଟେ</u>	74	70	30	20	01	13	51	7		223								10		24		Λα	n c	S	2	-1	131	31		15
			,					27)			15)		0)		,	1				34)		391		331		0	5			131			51	5	11		50)	8)	15)	7.)
										٠																											!			
			-					~		•	_		J			_				-	_	_		_		~	-			_			_				_	•	•	J
SH EIGHTH LEVEL SUMMATIONS:	IMPROPEM FIT REGLAZEO	STURM	IMPROPER FIT		SCREENS	STURM	REGIAZE:	ARTITIONS DOOKS	1	HARDWARF .	I OCK ING	CEVELING SOOR S	KACKING OF DOORS OT WATER HEATER COMPARIMENT	COMPARTMENT DOOR	INSULATION		HEATING DOCT VENI	ENIOR STAIRS	IE DOWN STRAPS ECOSE. ELC) WB ING	TUERS	CHEN SIZK		HTJ8 WITH SHOWERHEAU	LUGGED DAAIN	AUCET ASSEMBLY	CIOGGED DRAIN	TOILET SEAT	FLUSH TANK	URATOR IFS (LINGGED DRAIN	AUCET ASSEMBLY FR	HING MACHING	H WASHER	XTERIOR (FRUZEN	CTRICAL	TRIBUTION PANEL BOARD	TCHES	ACEPLATE EPTICAL GUTLETS
FOURTH THROUGH EIGHTH LEVEL SUMMATIONS:	IMPROPER REGLAZEO			HAKOWARE			NCCI CANUPY	PARTITIONS	IMPROPER		BI	NCBE LEVELING	OH			FLCOR	NCFV SKIRTING DOCT VENT	EXTERIOR STAIRS	STRAPS LCOSE. EI	NPLM PLUMBING		NPKS KITCHEN SINK	FAUCET	BATHTJB		NPCA FAUCET ASSEMBLY NPET TOTTETS (NPTT FLUSH TANK	LAVO		NPBA FAUCET ASSEMBLY NDBI SEMP		NPDW DISH WASHER	EXTERIOR	NPWB FRUZEN	NELC ELFCTRICAL	NEDP DISTRIBUTION PANEL BOARD NECR CIRCUIT BRFAKERS	NS	NEST FACEPTICAL OUTLETS

NERD NELF NEHT NERI NERF NERF NEIF NERF NETF IN				,		•					
	FUURIN INKUUCH EIGHIN LEVEL SUMMAIIUNS:			9 • D.N	H 199 HIJ	H 450 H	I + %	4 3KD	HUMES	SHUME S	LEVEL
	OUT DOOR LIGHT FIARURE	_	00	19		85.7	46.7	12.4	o in -	9.0.	₩ Q 4
	HEAL TAYE INTERIOR	J	60			• • •	0 0	• •			, עו פ
	NTERLUR LIGHTING FIXTURES SERVICE	_	12)	7 7 1			•	9.2 8.	12	1.2	0 4 4
	HEATING	_	7	7					~	7.	æ,
NHGP	GAS SUPPLY PIPING			3				42.9	3	.3	+
************************	**************************************	* * *	11)	367	****	* * * * * * * * * * * * * * * * * * * *	***	* * * * * * * * * * * * * * * * * * * *	* * * * * * * * * * * * * * * * * * *	28 · C · * * * * * * * * * * * * * * * * *	***
ARGE RA	RANGE - GAS/ELECTFIC	J	(50	112					16	10.0	m
ARHM	HARDWARF DVEN DCDRS	_	. 51	25				22.	21		 4 m
ARHK	KNOBS KNOBS AID MED	_	17	; o			7.00	'	, o	, -, o	150 4
AKBV	OVER 1	-	-	- 1			11 -1		, — .		וחו
ARBS	SURFACE GAS LEAK			-1 6				, π	1 8		V 4
ARPL	PILOT		3)	ю -				2.7	m -		‡ 4
APTI	I M FR		5	4			100.0	• •	4 -4		٠ ١
AFHA FU	FURNACE, HUT AIR, GAS OR UIL	_	38)	18					11	8 • 0	8
AFWT	WALL THERMOSTAT FURNACE DUDKS	_	18)	18				20.7	18 11	1.9	4 4
AFCL	CUNTROLS INTERNAL WILING		<u> </u>				10	6.9	80 90	30	4 10
AFBU	(1	_	5			100	12.5	1.			V 6
AFBW	BLIMER	_	(0	ı			12.	, 		-	100
AFBL Anno	AS	_	31	. 4 .		5	1 €	4.	1 4 -	7 % -) 4 1
AFBM	ALOWER MUTOR		7)	- ~ ;			0 • 67	2 ° 3	7 7 7	• L	n 4 .
AFFL	GAS LEAK	_	5	7 7			100.0	2.	7 ?	7.	4 iV
AFTR	FILTER BURNER ASSEMBLY			2				2.3	2	• 2	4 4
AFSC				٠				1.1	+		- 1
AEFX FX	FXHAUST FAN			72					7.1	7.3	e
AHWW HUT	IT WATER HEATERS	_	14)	52	 				50	5.2	m !
AHEL EL AHTK AHTE	ELECTRIC HOT WATER HEATER TANK LEAK		10)	36 16 16		100.0	† • † † † • † †	69.2 30.8 30.4	35 16 16	3 . 6	7 =

4 11 4 11	DATA
T TOTAL D	SAMPLE
THE A THE	KIVALE

FOURTH	FOURTH THROUGH EIGHTH LEVEL SUMMATIONS:			NO.	87TH 36TH 85TH 84TH	46 TH	₹5TH	24TH	# 3KU	HOMES	HOMES RHUMES LEVEL	LEVEL
AHER	PRESSURE RELIFF VALVE			٥				10.7	۲, ۱	ä	4	u
AHEH	HEAT ELEMENT			7					1.7) 1	9 4	
AHGS	GAS HOT WATER HEATER	~	()	~				4	0.00		•	, ,
AHPL	P1L01	_	0	. ~				0.00	1.9	1 -		- 4
AHPR	RFLIGHT PILOT						0.001	50.0	1.9	-		1 40
AHBR	BURNFR	~	ြ	7				50.0	1.9	7		, 141
AHBL	LEAK					7	100.001	0.00	1.9	1	•	9
ACRF	REFRIGERATOR	~	281	32						28	5.9	(4)
ACRE	REFRIGERANT SYSTEM GASKETING (DÜDRS	 ~ 	3)	3	 				9.4	2 1	.2	1 4 4
AFEB	FLECTPIC BASEBDAKD HEATING UNITS	(1) 1	1	7						7	. 1	~1
								THE RESERVE				

Appendix D

Problem Summation Tables - Field Sample

~ ~ ~ ~

N

2222

O.I

mmmm

l m m m m m m

2

 \sim

257

⋖
-
Η
~
DA
-
F-3
띡
^
=
\sim
SAMPI
-
ശ
_
9
٠,
딥
\vdash
re.

FOURTH LEVEL	FVEL SUMMATION:	TON:		NO.	%3KD	%2ND	8151	HÜMES	SHUMLS	LEVEL
* * * * * * * * * * * * * * * * * * *	******** ENFORCEMENT	非安全的法律法律法律法律法律法律法律法律法律法律法律法律法律法律法律法律法律法律法律	******	1075	*	**	4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4	****	****	****
***	*********	计标准设计 计数字 计数字 经人种证书 的复数非常的 化二甲基甲基甲基甲基甲基甲基甲基甲基甲基甲基甲基甲基甲基甲基甲基甲基甲基甲基甲基	*	*	* * * * *	* * * * * * * * * * * * * * * * * * * *	***	- 44	**	*
PLUM	PART C	PLUMBING	(0)	493		45.4	14.0	183	71.2	6
NLCM	C11	WATER DISTRIBUTION SYSTEM	(0)	21				156	63.7	7
DSYS	C12			15		4.	4.3	84	32.7	4
JCTI	C7.1	JUINTS + CUNNECTIONS/TIGHT IGAS, WATER	(105)	0			3.0	53		4 ·
V AN V	C13	VENTS AND VENTING	<u> </u>	_ 4	4.1		-5	٥	2.3	,
PFIA DEAD	7 1 2	PLUMBING FIXIURES DROHIBITED FITTINGS AND DRAFILLES						ታ (*	1.2	t 1
PHAS	101	AND THEFT			0 4		; ~	^	J 20	. 4
TANC	C 8	TRAPS AND CLEANUITS			• 2	• 1	1.3		*	*
HEAT	PART D	HEATING SYSTFM	(,	324		30.1	9.5	152	59.1	ĸ
HAPL	90	APPLIANCE S	(0)	17	53.7		6.4	125	44.6	4
HPSY			(o)	-		m	4.2	2.5	37.7	7
HLPG	04.2.5	LP GAS SAFFTY DEVICES		-	e.		၁	~	4.	4
ELFC	PAKI E	ELECTRICAL	(0)	189		17.0	5.4	114	4.4.4	m
FWOR	E 1 1	*IRING METHODS	(21)	d d	46.6		2.5	49	I 🖈	4
FRFC	E 6	RECEPTACLE OUTLETS REQUIRED	(0)	36	19.0	3.3	1.0		10.9	4
FRXY	F5.0	C.L.	ົວ •	19	10.1		٠,	19	7.4	4
EXUR	F.20		14)	15	6.1		4.	12	1.4	†
EBFA	E22	CERTINOLNE DUTLETS. FIXIURES. ALK-COOLING	200	12	6.3		., -	12	4.1	5 4
FOIS	001	DISCONDENS AND SCHOOL STANDER CIRCUIT	55	, 4	2.0	، ،	- ·	7 4	1.67	1 4
E POW	F10		0	. 4	2.1	4.		. 4	1.6	. 4
ESML	F18		(6 3)	۳)	1.0	۳.	٠,	2	യ •	4
EFRO	FIY	RECEPTACLE OUTLETS	ි •	m	1.6	· C		3	1.2	4
CONS	PART B	CUNSTRUCT ION	(0)	69		4.0	6.5	6 1	23.7	ж
FXTW	86/87	EXTERIOR WALLS	(0)		5	9	1.4	14	13.3	*
ROOF	H6/H7		(O)	14			4.	11		4
FLOR	86/87	FLOOR SYSTEMS	56	- 2	7.9	7.	∹-	2 ′	70 c	\$ \
2011	B6-5-1	TIFOLIWALLS	5 - 5		•			7 ^	10 at	† 4
DEXT	86/87/88	DODRS EXTERIOR	5 6	7 -	1.4	, -,		٦ ٦		- 4
***	***	含泛硫氧铵 法安全 计不断 计计算 计计算 化二甲基甲基甲基甲基甲基甲基甲基甲基甲基甲基甲基甲基甲基甲基甲基甲基甲基甲基甲基	***	**	特特特特	**************************************	*	特特	计计计计计计计计	46
* ANS!	ANSI AI	作 ANSI A119.1 安安安安安安安安安安安安安安安安安安安安安安安安安安安安安安安安安安	(0)	1045	*	*	29.6	236	91.8	2 本
CONS	PART B	COMSTRUCTION	(0)	061		63.3	13.7	228	33.7	m
EXTW	86/87		(0)		χĎ.	18.1		144	ů.	·# ·
TOOL	86/8/	KUUT SYSTM	56		ç ^	° -		101		\$ 3
2 X X X	B-APP.	TRANSIT CONSIDERATIONS	S S			. ~	2.4	5. 4 5.3	20.6	† 4
FLOR	86/87	FLOOR SYSTEMS	(0)	73	11.0	7.0	2.1	5.9	23.0	4
DFXT	86/87/88	DOURS EXTERIOR	.			1.4	† •	15	.0 .0	7

DATA	
H	
\vdash	
ţ	
SAMP	
Q	
\vdash	
囯	

FOURTH L	LEVEL SUMMATION:	:NO1:			*0 N	\$3RD	×2N0	*1ST	HUMES	&HOME S	LEVEL
MONM	86/87/38 86.5.1	W INDOWS TIEDUWNS		<u> </u>	12	1.8	1.1	w. 0	1 C	3.9	4 4
PLUM	PART C	PLUMB1NG	J	5	208		19.5	5.4	108	45°0	en
PFIA PREO VANV	69 65.2 613	PLUMBING FIXTURES PROTECTIVE REQUIPEMENT VENTS AND VENTING		000	138 50 20	66.3 24.0 9.6	13.2	3.9	72 45 19	28.0 17.5 7.4	7 7 7
ELEC	PART E	ELECTRICAL	~	(0	51		8.7	2.6	59	26.8	en I
EWOR	E11	WINING METHODS	-	(0	91 1	0.00	8.7	2.6	69	26.8	*
HEAT	PART U	HEATING SYSTEM	_	0)	85		8.1	2.4	76	29.6	60
HPSY HAPL	0.5	PIPING SYSTEM APPLIANCES		65	0124	11.8		1.7	60	23.3	7 7
* * * * * * * * * * * * * * * * * * *	**************************************	本本文章本文章文章文章文章文章文章文章文章文章文章文章文章文章文章文章文章文章	* * * * * * * * * * * * * * * * * * * *	****	4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4	# # # # # #	* * *	******** 26.0 *****	169	*****************	*****
NCON	CONS TRUCT ION	ION	~	0)	550		58.9		143	55.6	М
NC XD	EXTEPIO	EXTEPIOR DOUPS	_	43)		1 .	1 0		9.7		7
NC N	SMCONIX EXTERITOR	WINDOWS	~		2	2 .	÷ 7	0	000	ر ک	4 4
NCPD	PARTITI	EAFERIUR STAIRS	J	151					27		7
NCSM	SKIRTING								2.1	30	7
T T O O	HOT WATE	HOT WATER HEATER COMPARIMENT Reductive	~ ~	56	27	4.0	2.9		20 15		† 4
NCFL	FLOOR			1)			0 0		0	0 9	7
NCMG	SITE GRADING TIE DOWN STR	SITE GRADING TIE DOWN STRAPS LOOSE, ETC			7	1.3	7.	2.0	L 4	2.7	4 4
NPLM	PLUMBING		_	17)	216		23.1	0.1	* 6	30.0	٣
SMOL	WATER SUP	WATER SUPPLY PIPING	_	151	79	9	Z . S	j •		1 3	*
X	CF WER		_	00	707	31.9	†° 7	ر ، 2 د د	42	16.3	1 1
NPPR	URE	P E GULATOR			12	2 .				m c	* *
NELC	ELECTRI CAL		~	(9)	124		13.3	3.5	14	20.0	m
NEDP NERC	DISTRIBUT RECEPTICA	DISTRIBUTION PANEL BOARD RECEPTICAL OUTLETS		10)	33.5	44.4	8.0	1.6	40 26	15.6	+ 4.
N I N	SW IT CHES	בורוינ	_	(9		· ·		° 7	9		† †
NEFF		LIGHT FIXIURE		=	3				n -		7 1
NESP	SERVICE			3		ο ω • •		, ,			. 4
NHTG	HEATING		~	(7	7 7		4.7	1.2	34	13.2	3
NHGP	GAS SUP INSTALL	GAS SUPPLY PIPING INSTALLED SPACE HEATERS			23	52.3 22.7	2.5	.3	20	7. ¤	7 7

FOURTH LE	FOURTH LEVEL SUPMATION:			20	43K0	42ND	#1ST	HUMES	S TWOHS	LEVEL
NHUP	UIL SUPPLT PIPING	_	7	7	6.61	. 1	7.	9	2.3	*
* * * * * * * * * * * * * * * * * * *	非单字的专作的表示的作品,可以不够来说的不要要求,可以并不要要的。 本 APEO MECHANICAL/ELECTRICAL APPLIANCES —EQUIPMLNT ************************************	4 4 th	(C	374	李女爷女女女女女女女女女女女女女女女女女女女女女女女女女女女女女女女女女女女	* * *	******	106	$10 \circ c$	*****
АЕНА	FUKNACE.HJT AIR.GAS DR CIL	_	39)	181		49.4	5.1	1.1	30.0	3
AFPL AFCL	PILOT/ELECTRONIC IGNITIUN CONTROLS FIEL CAM		3)	4 C 35	22.1 19.3	10.7 9.4 8.0	1-1	32 21 20	12.5 d.2 7.8	444
AFRT AFRM	WALL THERMOSTAT BLOWFR MOTOR		17)	21	2.2	5.6 1.1	9-1-	118 2 3	7.0	444
AFAB AFB1 AFDR	BURNER ASSEMBLY BLOWER ASSEMBLY FURNACE DOUGH	J	2.3	2 2 1	1.1	ำงำ		721	304	7 7 7
AFGR AFSC	GAS REGULATOR FUFL SUPPLY CUNNECTION			1	9.	 W.W.	20		4 4	4 4
AHMW	HOT WATER HFATERS	~	281	82		21.9	2.3	52	20.2	3
AHEL AHG S	ELECTPIC HUT WATER HEATER GAS HOT WATER HEATER		171	43	52.4 13.4	1.2	2 e c	29	111 8. 13 8. 0. 0. 0. 0. 0. 0. 0. 0. 0. 0. 0. 0. 0.	44 ^
ARGE	RANGE - GAS/ELECTRIC	_	11)	12		19.3	2.0	36	14.0	3
ARPL ARGL ARCL ARBU AR I W	PILLOT GAS LFAK CGNTROLS HURNER INTERNAL WIRING HARDWARE		30 00 00 00 00 00 00 00 00 00 00 00 00 0	18 17 11 5 6	25.0 23.0 15.3 8.3 4.2	11 × 4 × 11 × 4 × 5 × 5 × 5 × 5 × 5 × 5 × 5 × 5 × 5	0.5.2.2.1	16 14 10 5 2	23.0 2.0 4.0 2.0 2.0 2.0 2.0	44444
AFEX ACR F	EXHAUST FAW REFRIGERATOR	-	6	25		6.1	7.	14	3.5	m m
ACFL ASOE	CONTROLS SMOKE DECTOR	_	5	T %	10.0	n 6	J	3 1	1.2	4 m
AFEB	FLECTRIC BASEAGARD HEATING UNITS	~	2	-	 	6	0	1	4	

FIELD SAMPLE DATA

HOMES SHGMES LEVEL

NO. 27TH 66TH 85TH 84TH 83RD

FOURTH THPOUGH EIGHTH LEVEL SUMMATIONS:

WATER OLISTRIBUTION SYSTEM WATER CONNECTION SYSTEM WATER CONNECTION SYSTEM WATER CONNECTION SPECIFICATION 1145 62.4 61.5 27.2 WATER HARDEN SAETY DEVICES 12. 27.2 34.0 36.0 36.0 36.0 36.0 WATER HARDEN SAETY DEVICES 12. 27.2 34.0 36.0 36.0 36.0 WATER HALE SAETY DEVICES 17. 27.0 27.0 27.0 WATER HALE SAETY DEVICES 17. 27.0 27.0 27.0 WATER HALE SAETY DEVICES 27.0 2	PLUM	PART C	PLUMBING	_	65 10	3					183	71.2	3
CII.2. WATER OUNEET NO. SUPPLY CER. LICATION 1945 92.4 91.5 27.2 1194 52.5 11.5 11.5	0 TN	C11	WATER DISTRIBUTION SYSTEM	-	2 (8				1 +	i s	•	*
CILIZATE WATER CONNECTION PIDE SIZE, LUCATION 134 92.4 91.5 27.2 133 51.	USC	C11.2	Y CONNECTI	_	1 (5			. 99	29.	\sim	2.	ς
CILIZATE FUNDANT TANK TA	nsc1.	C11.2.1	SIZE, LUCATI		1	7.		2 °	ol.	27.	\sim		,O
CITIZATE APPLIANCE CONVECTORY AT 6 GAP 10.0 50 10.0 22.9 10.1 10.	JSC 6.	CI1.2.6			7	0			4 •	2.			С
CILLAIL WATER MARRY DAIN CONTRINCE	JSC4.	C11.2.4	S/PROTECT 3Y AIR	Δp		<u>-</u>		•	•	•		٠,	ο.
THE LIFE VALVES CHISALIS THE LIFE VALVES CHISALIS THE LIFE VALVES CHISALIS THE LIFE VALVES CHISALIS CHI	4SD	C11.3	V I CE		_	0			22.	10.			.0
Continue	٧٠.	C11.3.1	☆		_	0.0		100.	22.	10.		- /	o r
THEMANIES IN FLONK 19 47.2 36.0 35.0 35.7 3.4 4.0 2.4 5.4 5.0 2.5 5.4 1.0 1.0 1.0 1.0 2.3 1.0 5.1 1.0 1.0 1.0 2.3 1.0 5.1 1.0 1.0 1.0 2.3 1.0 5.1 1.0 1.0 1.0 2.3 1.0 5.1 1.0 1.0 1.0 2.3 1.0 5.1 1.0 1.0 1.0 2.3 1.0 5.1 1.0 1.0 1.0 2.3 1.0 5.1 1.0 1.0 1.0 2.3 1.0 5.1 1.0 1.0 1.0 2.3 1.0 5.1 1.0 1.0 1.0 2.3 1.0 5.1 1.0 1.0 1.0 2.3 1.0 5.1 1.0 1.0 1.0 2.3 1.0 1.0 1.0 2.3 1.0 1.0 1.0 2.3 1.0 1.0 1.0 1.0 1.0 1.0 1.0 1.0 1.0 1.0	4RV3.	C11.3.1.	RELIEF VALVE DRAIN	_		.		3 3 3 3	20.	ກໍ		, i	-
INTERCRETE LEGATION 1 1 1 1 1 1 1 1 1	1KV33.					9 43.	30.	38.	φ -	ς, c			3 0
### UNDERSTREATION FOR THE STATE THE PRESTREATION FOR THE PRESTRE AND PRESSURE RELIEF VALVES 3 5.0 5.0 1.4 5.0 5.1 5.1 5.1 5.1 5.1 5.1 5.1 5.1 5.1 5.1	IK V 5/°		C L		_	2 210	- 47	* C	'n	7 -			י מ
FERRIMATE SAUVE FLORE FERR	1KV31.		\supset				2 5		2 0	- 1	n (r		0 r
CILITION TEMPERATURE AND PRESSURE RELIEF VALUES 3 0.0 0.	IRV35.		E FI 0.0			5.0	, Ç		7 .	• •	, m		מר מ
CIL-3-1-2 MARERALS USE AND TEMPERATURE LIMITS DF VAIL CON-USING CP PPE CON	IRV1.	CI 1.3.1.1	TEMPERATURE AND PRESSURE RELIEF VAL	V.			0	0 0	1.	•	3		7
CORMUSTING F PIPE CONTRIBUTION CORMUSTING F PIPE CONTRIBUTION CONTRI	1R V 2.	C11.3.1.2	PRESSURE AND TEMPERATURE LIMITS OF	٧A		3		٠ù (1.	٠	~		7
CORPOSITION OF PIPE CORPOSITION OF PIPE CORPOSITION OF PIPE CORPOSITION OF DISSIMILAR AFTALS COLLIZE COLLIZE ANTHRIAN COLLIZE ANTHRIAN COLLIZE ANTHRIAN COLLIZE COLLI)ME	C11.4		_	_	3			10.	4.	22		2
CLOCATOR OLIVED TO DISSIMILAR ALIALS CLOCATOR OLIVERS AND CAPS CLOAD OLIVERS AND CAPS CLOCATOR OLIV	ML 2.		PIPE		-	9.1		5	7.	ή,	10		0 \
C12.2.3 C12.2.3.3 C12.2.3 C12.	ME.I.		UF DISSIMILAR 4ETAL			_ (•	3	*	- :	ů,	Ω.
Colored State Colored Stat	7.5	C12	DRAINAGE SYSTEM		~ -	7 0			7	3 0	400	° -	1 1
Color	UT3.	612.23	RS AMD CAP		1 [X - C		.,	970	3 0	7 ° ×	• -	, 4
3. C12.2.3.3		C12.2.3.2	SIZE CUMPARED TO PIPING, WATER-TIG	ب		· ~	6	44.	48	14.	73	9	7
C12.2.2 CLERRANCE FRUM DRAIN GUTLET C12.1.2 MATERIALS C12.1.2 MATERIALS C12.1.2.2 FITTINGS C12.1.2.2 FITTINGS FOR COPPER TUBING MATERIALS C12.1.3 GRADE OF HORIZONTAL DYAINAGE PIPING C12.7 JOHNS FOR PLASTIC PIPE C13.1 VENT REMINAL C13.5 VENT TERMINAL C1	UT33.	C12.2.3.3	MINIMUM DIAMETER - DRAIN CONNECTIO	_		1		•	•	•	7	٠	۲-
C12.1.2. MATERIALS C12.1.2.2 FITTINGS FOR COPPER TUBING MATERIALS C12.1.2.2 FITTINGS FOR PLASTIC PIPE C12.1.2.3 GRADE WITHINGS C12.1.2.3 GRADE WITHINGS C13.1.2.4 GRADE WITHINGS C13.5 VENT TRAINAINE FOR PLASTIC PIPE C13.5 VENT TRAINAINE C13.	UT2.	C12.2.2	CE FROM DRAIN OUTL			~ ,			•	•		4.	ا 0
Colored Filtings For Copper Tubing Materials Colored Filtings For Copper Tubing Materials Colored Filtings For Copper Tubing Materials Colored Filtings For Plant Colored Filtings For Filtings For Plant Colored Filtings For Filtings Filtings For	ML 41.2	C12.1			6	2 ء		6	.i -	•	2 0	200	Λ 4
3. C12.1.2.3 SUCKET FITTINGS FOR PLASTIC PIPE 1 50.0 50.0 7 7 7 7 7 7 7 7 7	MI 22	(12-11-2-2	FITTINGS FOR COPPER TUBING MATERIAL	- 0		7 -	Ċ	100	• 1	•	7 -	0 4) r
C12.7 GRADE OF HORIZONTAL DRAINAGE PIPING C7.1 JUNINS + CONNECTIONS/TIGHT IGAS. MATLK C13. VENTS AND VENTING C13.5 VENT TRAINAUL C13.5 VENT TRAINA	ML23.	C12.1.2.3	SUCKET FITTINGS FOR PLASTIC PIPE				0	500	• •	•		. 4	~
C13-1 VENT TERMINAL C13-5 L05 L0	GR	C12.7	GRADE OF HORIZUNTAL DRAINAGE PIPING			_			•	•	-	4.	30
C13.5 VENTS AND VENTING C13.5 VENT TERMINAL C1	11	C7.1	DNS/TIGHT IGAS. WATE		1	٠,١				÷.	3.5 3.	7	.
C13.5.1 FUNDER FORTER ALS C13.5.2 FLASHING C13.5.2 FLASHING C13.5.2 FLASHING C13.5.2 FLASHING C13.5.2 FLASHING C13.5.2 FITTINGS C2.5.2 FITTINGS C2.5.2 FITTINGS C3.5.4 FITTINGS C4.1 FITTINGS C5.1.4 FITTINGS C6.1 FITTI	A 1	C13	VENIS AND VENIENCE			,			u	-	ט מ		† '1
C13.5.2 FLASHING C13.2.2 FLASHING C13.2.2 FITTINGS FITTINGS FITTINGS C13.2.2.3 FITTINGS FITTINGS C13.2.2.3 FITTINGS C13.2.2.3 FITTINGS C13.2.2.3 FITTINGS C13.2.2.3 FITTINGS C13.2.2.3 FITTINGS C23.2.2 FITTINGS C4 1.00.0 100.0 14.3 .2 11.0 4 11.0 6.0 11.0 11.0 11.0 11.0 11.0 11.0	TL 1.	C13.5.1	ROOF EXTENSION	_	10	o ^		4	78.	• 1	7 ^		٥ ٦
C13.2 MATERIALS C13.2.2 FITTINGS FITTINGS FITTINGS C13.2.2.3 FITTINGS FITTINGS C13.2.2.3 FITTINGS FITTINGS C13.2.2.3 FITTINGS FITTINGS C13.2.2.3 FITTINGS C23.2.4.4 FITTINGS C23.2.4.5 FITTINGS C33.2.4.5 FITTINGS C33.2.4.5 FITTINGS C33.2.5 FITTINGS C43.2	TL2.	C13.5.2	FLASHING			۱۱		, ,	14.	•			
C13.2.2 FITTINGS FOR PLASTIC PIPE (a) 1 100.0 14.3 .2 1 (b) 2 100.0 100.0 14.3 .2 1 (c) 2 100.0 100.0 14.3 .2 1 (d) 5 100.0 100.0 14.3 .2 1 (e) 6 5 100.0 100.0 14.3 .2 1 (f) 6 7 1 100.0 100.0 14.3 .2 1 (e) 7 1 100.0 100.0 14.3 .2 1 (f) 7 2 1 100.0 14.3 .2 1 (f) 8 1 100.0 100.0 14.3 .2 1 (f) 9 1 100.0 100.0 14.3 .2 1 (f) 1 100.0 14.3 .3 1 (f) 1 100.0 14.3 1 (f) 1 100.0 14.3 1 (f) 1 100.0 14.3 1 (f) 1 100.0	A T	C13.2	MATERIALS	_	(2)	1			+	•	1	4.	'n
Columbia	AT2.	C13.2.2	FITTINGS	_	<u> </u>	_		000	14.	•	1	4.	٥
C92 PLUMBING FIXTURES (0) 5 1.00 4 1.0 4 1.0 64.0 1.0 1.0 1.0 1.0 1.0 1.0 1.0 1.0 1.0 1	AT 23.	C13.2.2.	FITTINGS FOR PLASTIC PIP			1		100.	14.	•	1		7
C9-2-4-2 CLOTHES WASHING MACHINE C9-2-4-2 CLOTHES WASHING MACHINE C9-2-4-2 CLOTHES PECIFICATIONS C9-2-4-2 CLOTHES PRACHINE C9-2-4-2 CLOTHES PRACHINE C9-2-4-2 CLOTHES PRACHINE C9-2-4-2 CF-1-4-2 LIMPROPER EDGATION OF PIPE, FIXT/FOULP C9-1-4-5 IMPROPER EDGATION OF PIPE, FIXT/FOULP C10 HANGERS AND SUPPORTS C8-1 TRAPS AND CLEANUUTS C8-1 CRAPS AND CLEANUUTS C8-1 CRAPS AND CLEANUUTS C8-1 CRAPS AND CLEANUUTS C9-1-4-5 CRAPS AND CLEANUUTS C8-1 CRAPS AND CRAPS	A	63	PLUMBING FIXTURES		(0)	ις, Ι				, ,	4		* (
C5-1-4-2 IMPROPER LOCATIONS C5-1-4-5 IMPROPER LOCATION OF PIPE, FIXT/FOUIP C6-1-4-5 TRAPS AND SUPPORTS C6-1-4-5 TRAPS AND CLEANUUTS C6-1-4-5 TRAPS AND CLEANUUTS C7-1-4-5 TRAPS AND CLEANUUTS C8-1-4-5 TRAPS AND CREANUUTS C8-1-4-5 TRAPS AND CLEANUUTS C8-1-4-5 TRAPS AND CLEANUUTS C8-1-4-5 TRAPS AND CREANUUTS C8-1-4-4 TRAPS AND CREANUUTS C8-1-4-4 TRAPS AND CREANUUTS C8-1-4-4 TRAPS AND CREANUUTS	× - C	7.60	INCOME. NETTOWN O		2	٠ u		-	100.		,	0	ζ :
C5-1.4 PPOHIBITED FITTINGS AND PRACTICES C5-1.4-5 IMPROPER LOCATION OF PIPE, FIXT/FOUIP C10 HANGERS AND SUPPORTS C8 TRAPS AND CLEANUUTS C8-1 TRA	~	(9-7-4-2	ATION	-	5	ر د	-	100	100	-	† 3	•	0 ~
5. C5-1.4-5 IMPROPER LOCATION OF PIPE, FIXT/FOUIP C10 HANGERS AND SUPPORTS C8 TRAPS AND CLEANUUTS C8-1 TRAPS AND CLEANUUTS (0) 1 100.0 .2 1.	AP	C 5-1-4	PRACTICE	_	•	٠,٠	3	•	•	• 1	r ir	•	- 1
C10 HANGERS AND SUPPORTS (2) 2	AP5.	4	IPE. FIXI/FOUL			, (n			30.	• •	ייי ר	1.2	r - W
C81 TRAPS AND CLEANUUIS (0) 1 100.0 .2 1 .	IA S	C10	S	J	2.1	2				4.	2	အ	ŧ
COST DATE OF THE CIVILIDES OF THE COST OF	200	200	TRAPS AND CLEANUUTS	<u> </u>	<u> </u>	- 4 -				•	→ -	*	† 0
	AP2.	C8-1-2	DIATE PERSONAL	_		٦,			001	•	-4 -	•	0

LEVEL	£ 1	44	٥ ١	-			1	91	_	۰ 0		. 0	٥	5	91	~ c	o 00	7	_	7	ጥ ‹‹	0	0	9 !	J.	ე ⊲	+ :C	0. /	1	9	۰۰	۰ د		9	7	-	٥٠	*	3	ተመጠጠመብ
2HOME S	59.1	48.6	, ,	7.4				80	*	* '	• 6	19.1	•	٥,	12.5	; ;		70	4.	•	10.9			4.	4.	• ~	. ~		ŝ	-	• • •		1 · C		ω •	*	* •	*	4.04	24.5 9.7 5.8 5.8 1.9
HOMES	152	125	50	6.	11	9	2	2	→ •		50	64	-	33	32	21	6.2	۷. ۱	-		7.8	13	2	- 4 ·		70	97	19	19	95	77	71	. #	ſΩ	2	⊶ ,	-	7	114	4011 4020 4020
83R0		53.7	17.0	5.9	† ° °	6.1	•	9.	ا (ر		15.4	15.1	۳.	10.2	6.6	7 CX	• 6	9.	• 3	m i	ۍ پ پ	4.0	٥	۳,	m r	6.0	46.0	18.8	18.8	14.2	ς · · · · · · · · · · · · · · · · · · ·	7.0	1.2	5.	0	ຕຸ		•		46.6 13.2 8.5 7.9 2.6 2.1
I + **			31.6	10.9	0 0 7	3.4	1.1	1.1	9.	0 4	- 30	28.2		9	16.4	S	Ť	1 • 1	0		18°4	7.5	1.1	9.	9.	•	· •	40.	0	ં	° ^		1.7			۲.	•			28.4 18.2 17.0 5.7
*51 H			*	32.8		0							2.0				3.0						6.3		-	0.00		ं					2.7				•			
46TH				34.5					50.0	0.00	9						3.1												100.0			~	36.4		66.7	3				
871н																	3.7	•																						
DATA NU.	324	174	2,5	19	11	9	2	2	→ ,	⊣ -	50	64	-	33	32	21	6.2	2	-		32	13	2	,	⊣ -	7 0 7 1	- 4	. 2	61	7 0	7 7	7 7	4	33	7				189	100 100 100 100 100
SAMPLE	(0)	00	111					1	d	ô	0			1	2:	1.3				i	0				0	5	6	0			6			5		:	7		(c)	21)
FIELD	-							-		_	_			J	.	_		,	ш		_			ER AT 10	_	_				NOT LO	,		0				_		~	_
ITH LEVEL SUMMATIONS:	HEATING SYSTEM	APPLIANCES	4	DUCT TURE RISER	<	DIRT. FLOOR COVERING AND DUCT	E OUTRE?		AIR TIGHTNESS OF SUPPLY DUCT SYSTEM	RETURN AIR SYSTEM	TION	K ACCESS		VENTING. VENTILATION AND COMBUSTION		COUNTS OF VENI SYSTEM SECURE	HOT WATER HEATER	TEKMINATE UN	PART OF APP	TING SYSTEM TERM	MAKKING	FURNACE CLEARANCES AND OPERATIONS		ER CLEARANCES AND OP	ANCES	021 108 515	GAS PIPING SYSTEMS	LOCATION OF GAS SUPPLY CUNNECTION	LP-GAS SYSTEMS	IDENTIFICATION OF GAS SUPPLY CONNECT	ADDITANCE TOWNED TOWN	OR THRU JANDERSID	CONNECTOR/SHARP RADIUS	EPAIRED DEFFCIS	CURROSIUN UF METALS	CAS PIPING	IP CAS CAFETY DEVICES	SAFEII DEVICE	ELECTRICAL	WIRING METHUDS PASSING OF CABLE THROUGH STUDS CABLE SUPPURT LODSE CONNECTIONS CONTINUITY OF CABLE SHEATH CABLE PFOTECTION
	Ī	4	ر																								1		٦,							NI.				
FOURTH THROUGH EIGHTH LEVEL	PART D HE	D6 A	5	06.10.5	06-10-5	D6.10.5	D6.10.5.2	D6.10.1	06.10.1.3	D6-10-2	06.7	1.90	16.40	06.4	D6.4.1	D6.4.1		06.4.2	06.4.1	06.4.3	06.6	D6.6.1	06.6.2	06.6.1		05.5.6	05.1	05-1-10	05.1.10.1	05-1-11	05-1-18	7.1.10		05.1.2		05-1-2-2	0.1.0	04.2.5	PART E	E11 F11.7 F11.9 E11.6 E11.6

LEVEL	5 5	7	٠,٠	9	٥	9	0	de l	Λ,	ο .	4 11	ο.	0 -:	y ur	7 4	ۍ.	2	9	7	5	٥	1	ς.	†	0 4	<i>†</i> <	+ w	,40	1	4:	Ω,	Ø u	n 4	٠, ١	י כ	٠ ١	ۍ د	.0	C) C	-	0.40	2	4	C	0	r 4	2	٥
%HUME S	4.	10.9	10.5	5.5	1.6	1.2	1.2	7.4	4.7	0 !	1.4	*	* *	4.1	1 . 0	000	20	10	:0	4.	4.	1.6	1.6	1 · 0	1 ° 0		1.5	23.7	١ ١	18.3	17.1	-	† ·	•	+ 1			2.7	80	יסי •		1.2	7.		*	4.	† 10	30	4.
HUMES %	~1 =	300	2 8	6	4	12) H	3	61	61	20 0	71	٠ ٠	1	71	- 4	, ~	~	2	2	7	1	4	4	,	4 °	7 5	n m	7				7 - 7	- -	٦.	7 -	1 [7	7	2	2	2	n r	٠ -	2	1	- -	7 ~	2	-
8.3F.D	. ·	. 6	19.0	4.8	2.1	1.6	1.6	10.1	1.01	7.6	6.1	٠,	٠, ر	0.0	2.6	7 - 7	1.1	1.1	1.1	• 5	• 5	2 • 1	2.1	1.2	Z • L	0	1.0			σ.	65.2	65.2	1.4	* • T	T • T	20.3	10.1	10.1	4.3	4.3	2.9	4.3	1.4	2.9			7.9		1.4
54 T H	1.1			25						t			0 • 0	CI CI	0	60.04		0	40.0	20.0	5		100.0		0001		130.0				e M		2 . 1			•	50.0	50.0	4.17	21.4	14.3		7.1		50°0	50.0	0.00	100.0	50.
Н159				0.	ŗ	χ • χ				1.046			0.001						100.0		00001											1 3 3 . 0			100			100.0		\sim	1.99	0.001	•			100.0			50.0
86TH												•	-						100.001		7										•	_									1.00								
87TH																			_																														
NO.		1 75	2 4	6	4	3		19		8 7		⊶ .	7 [71	ى -	, ,	۷ ر	7	7	7	1	4	4	4	4 1	~ ^	n 20	04		48	45	42	→ -	-	-	7 [7	7	3	m	۷ ر	w 4	٠.	2	1	- -	7 ~	7	~
		(7 2						1)			0	-	2	6	5 5	10	5		0)		(0		ô		3 6	õ			<u> </u>	Ĉ			5	1	10	3 6		0	7		5		<u></u>	0		6	2	
											_																		- į																				
		,					ve T.S	J)			-		<u>۔</u> ٿ	-	-		_		•	7.)		_		. .	_	,		_	_	٠		-	_			,	_	_		_	5.5	_	_	,	_		
SUMMATIUNS:	CONDUIT. CABLE TERMINATION	CABLE SUPPURT - NON-METALLIC GUILET	TOTALINA IN ANI C	COUNTER TOPS IN KITCHENS	ADJACENT TO APPLIANCES	BU ILT-IN	UNDER WALL-CABINET	MATERIALS AND EQUIPMENT		ER DEVICES	FIXTURES		OSTIBLE WALL OR CEILING	KES, AIK-C	ES AND EQUIPME	- 1	1	CY.	5 GROUNDING AT LIGH	RONDING UF NUNCURRENT - CAFRYING M	- CARFRYING	BRANCH CIRCU	LOCATIUN ABOVE FLOUR		ENIRANCE UP FEEDER ASSEMBLY ID HUME	MALL SWITCHES	INSTALLATION IN ACCURUANCE	NOTEDIOTOROS		EXTERIOR WALLS	FASTENING OF STRUCTURAL S	. EXTERIOR COVERING TO WALL FRAMING	LEAT LOSS	TASH ATTON	CONDENSATION PERIODE	N	NET FOR THE	CEILING	LUAD CARRY CAPACITY		TENSION MEMBER FAILURE	INSTITUTE INSTITUTE IN THE INSTITUTE IN	E BONDING/EXTERIOR COVERING		LUAU CARRYING CAPACITY		URILLING/NOICHING UF SIRUCIUMAL MEMBERS PARTITION WALLS	FASTENING OF STRUCTURAL SYSTEMS	WALL TO ROOF SYSTEM
	TUBING. CONDUIT. CABLE TERMINATION	O CABLE SUPPORT - NON-METALLIC COILE	E6 KELEPIALE UUILEIS KEWUINE)	(A) COUNTER TOPS IN KITCHEN	AUJACENT TO APPLIANCES	COUNTER TOP SPACES FUR BUILT-IN	(D) COUNTER TOP SPACES UNDER WALL-CABINET	E5.0 MATERIALS AND EQUIPMENT	LISTED AND APPROVED	1 ALUMINUM/COPPER DEVICES	LIGHTING FIXTURES	GENERAL	•1•1 COMBUSTIBLE WALL OR CEI	TYPE OUT DOOR OUTLEIS: FIXIORES: AIR-COULING	DUIDCUK FIXIUKES AND EQUIPME	CERVICE		2 GROUNDING OF ELECTR	.5 GROUNDING AT LIGH	RONDING OF NONCURRENT - CAFRYING M	.1 EXPUSED NINCURRENT - CARFRYING MET	DISCONNECTING MEANS AND BRANCH CIRCU	2	P.DWEK SUPPLY	.9 ENIMANCE UF FEEDER ASSEMBLY IN HUM	800	AC CUR DANC	NO STATE OF THE ST		EXTERIOR WALLS	FASTENING OF STRUCTURAL S	76.6 EXTERIOR COVERING TO MA	BOSO LUAU CARRING CAPACITY	ב	SKATSISEG	T BOOF CYCTEM	DEFLE			KUUF TRUSS	TENSION MEMBER FAILUR	B7.5 FINAL LUSS	METALLIC RODE BONDING/EXTERIOR COVERING	7 FLUUR SYSTEMS		DECKING OF CTURE OF STREET	KUCIUKAL MEMBEK	6.7 FASTENING OF STRUCTURAL	

ANGE CAPACITY - RACKI ************* *********** **********		(0	~ (50.0	0.06	1.4	-4 (9
#6/87/88 DUURS EXTERIUP #6/87/88 DUURS EXTERIUP #86/87/88 DUURS EXTERIUP #86/87/88 DUURS EXTERIUP #86/87 CANSTRUCTION #86/87 EXTERIOR WALLS #7.1 EXTERIOR FASTENERS #7.1 EXTERIOR COUPERING #7.1 DUURS #7.1 DUURS #7.1 DUURS #7.1 AT VENT PIPE (FEUMBING) #7.1 BASTILITY #7.2 AT VENT PIPE (FEUMBING) #7.3 AND COUPERING #7.4 EXSTENING OF STRUCTURAL SYSTEMS #7.5 AND COUPERING #7.6 DURABILITY #	~		7 6			1.00 0	2.4	· ~) 4 I
######################################	J SN	0	ı - -			100.0	1.4	1		14.2
B6/B7 EXTERIOR WALLS B7.1 DURABILITY B7.1 LATERIOR WALLS B7.1 LATERIOR COVERING B6.4 LODURABILITY B6.5 LODURABIL	*****	*****	1045	* * * * * * * * * * * * * * * * * * *	* * *	* * *	* * * * *	236	******* 91.6 *****	* * * * * * * * * * * * * * * * * * * *
B6/B7 EXTERIOR MALLS B7.1 EXTERIOR FASTENERS B7.1 EXTERIOR COVERING B7.1 MEATHER RESISTANCE — RAIN LEAKS B7.1 MEATHER RESISTANCE — RAIN LEAKS B7.1 MINDOWS B7.1 B7.1 B7.1 B7.1 B7.1 B7.1 B7.1 B7.1	-	60	661					228	88.7	ы
B7.1 DURABILITY B7.1 EXTERIOR FASTENERS B7.1 EXTERIOR COVERING B7.1 WEATHER RESISTANCE — RAIN LEAKS B7.1 WEATHER RESISTANCE — RAIN LEAKS B7.1 PENETRATION OF EXTERIOR COVERING B7.1 PENETRATION OF EXTERIOR COVERING B7.1 RAIN LEAK — WATER RESISTANCE MEY B7.1 RAIN LEAK — WATER RESISTANCE MEY B7.1 AT MEMBRANE PENETRATION B7.1 AT WENT PIPE [PLUMBING] B7.1 AT WENT PIPE [PLUMBING] B7.1 AT VENT PIPE [PLUMBING] B7.1 AT VENT PIPE [PLUMBING] B6.4 KOOF TRUSS B6.4 KOOF TRUSS B6.4 KOOF TRUSS B6.4 KOOF TRUSS B6.4 FASTENING OF STRUCTURAL SYSTEMS B6.10 DECKING B7.10 DINBERS		0	189	1	1 		26.6	1 👉	1 3	4
B7-1 EXTERIOR FASTENERS B7-1 INTERIOR COVERING B7-1 WEATHER RESISTANCE — RAIN LEAKS B7-1 WEATHER RESISTANCE — RAIN LEAKS B7-1 PENETRATION OF EXTERIOR COVERING B7-1 PENETRATION OF EXTERIOR COVERING B7-1 RAIN LEAK — WATER RESISTANCE MENGENERS B7-1 AT VENT PIPE INTITION EXTERS B6-4 LOAD CARRY CAPACITY B6-5 AT VENT PIPE INTITION WALLS B6-10 DEFLECTION	_	0	3			69.8	20.0	127		5
B7-1 EXTERIOR COVERING B7-1 WEATHER RESISTANCE — RAIN LEAKS B7-1 POUDRS B7-1 POUDRS B7-1 POUDRS B7-1 POUDRS B7-1 POUDRS B7-1 RAIN LEAK — WATER RESISTANCE MEND B7-1 AT VENT PIPE PLUMBING I B7-1 AT VENT PIPE PERTING I B6-4 DECKING B6-4 CODE TRUSS CUT FOR ROOF JACK B6-10 DECKING BF-10 DECKING BF-10 DECKING BF-10 DECKING BF-10 DECKING			128		97.0	07.7	6	N	0	9 1
B7.1 WEATHER RESISTANCE - RAIN LEAKS B7.1 JUNRS B7.1 POLIURS B7.1 PRINTRATION OF EXTEKIOR COVERI B7.1 RAIN LEAK - WATER RESISTANCE MERGEN: B7.1 RAIN LEAK - WATER RESISTANCE MERGEN: B7.1 AT MEMBRANE PENETRATION B7.1 AT WENT PIPE INCUMBING! B7.1 AT VENT PIPE INCUMBING! B6.4 B6.4 COPELITY B6.4 B6.4 COPELITY B6.10 DEFLECTION			n -			1 *0	, ,	v ~	0 4	0 4
B7.1 WINDOWS B7.1 PENETRATION OF EXTEKIOR COVERI B7.1 PENETRATION OF EXTEKIOR COVERI B7.1 RAIN LEAK — WATER RESISTANCE MENONE B7.1 AT WEMBRANE PENETRATION B7.1 AT VENT PIPE IPLUMBING I B7.1 AT VENT PIPE IPLUMBING I B7.1 AT VENT PIPE IPLEATING I B6.4 LOAD CARRY CAPACITY B6.4 LOAD CARRY CAPACITY B6.4 LOAD CARRY CAPACITY B6.4 LOAD CARRY CAPACITY B6.10 DEFLECTION BF.10 DEFLECTION BF.10 DEFLECTION BF.10 DEFLECTION BF.10 DEFLECT	_	51	57			0	8.6	37	14.4	· ~
B7-1 B6-15 B7-1 B7-1 B7-1 B7-1 B7-1 B7-1 B7-1 B7-1			28			14.8	4.2	21	8.2	٥
BY-1 BY-1 BY-1 BY-1 BY-1 BY-1 BY-1 BY-1	(16		23.1	8.5	2.4	15	υ. υ.α.	9
B7-1 B7-1 B7-1 B7-1 B7-1 B7-1 B7-1 B7-1	92	6	_			7 • 4	, <u>,</u>		41.6	0 1
87-1 INTERSECTION OF ROUF AND EXTER B7-1 MEMBRANE PENETRATION B7-1 AT VENT PIPE [PLUM3ING] B7-1 AT VENT PIPE [PLUM3ING] B7-1 AT VENT PIPE [PLUM3ING] B6-4 LOAD CARRY CAPACITY B6-4 LOAD CARRY CAPACITY B6-4 LOAD CARRY CAPACITY B6-4 DURABILITY ME-46RANE B6-10 DEFLECTION B6-10 PARTITION WALLS B6-10 PARTITION MALLS B6-10 PARTITION B6-10 FARME ASSEMBLY TANNELS B6-10 PARTITION B6-10 FARME ASSEMBLY TRANSIT CONSIDERATIONS B-1 TRANSIT CONSIDERATIONS B-2 B-4 SPRING/SPRING HANGERS B-2 SPRING/SPRING HANGERS B-1 COUPTING MECHANISM B-2 GRAKES B6-10 UNDERNEATH OF FLOOR SYSTEM B7-1 UNDERNEATH OF FLOOR SYSTEM B1-17	. PENE (1	(44)	162				24.5	103	40.1	ۍ ۱
B7.1 MEMBRANE PENETRATION B7.1 AT MEMBRANE JOINT (WITHIN FI B7.1 AT VENT PIPE [PLUMBING] B6.4 LOAD CARRY CAPACITY B6.4 LOAD CARRY CAPACITY B6.4 LOAD CARRY CAPACITY B6.4 DECKING B6.10 DEFLECTION B7.1 LUNGITUDINAL MEMBERS B6.10 DEFLESTRIMS B6.10 DEFLESTRIM	IOR WALL		_			. 9	1.	$\overline{}$	4.3	9
BY 11 AT VENT PRIPE IPLUMBING I BY 1 AT VENT PIPE IPLUMBING I BY 2 LOAD CARRY CAPACITY BS 4 KOOF TRUSS BS 4 KOOF TRUSS BS 4 BOOF TRUSS CUT FUR ROOF JACK BS 4 DECKING BS 10 DEFLECTION BS 10 DEFL	4	1)	7	:	4.3		1.1	~ ~	2.7	91
B7.1 AT VENT PIPE THEATING I B6.4 B6.4 B6.4 B6.4 B6.10 B6.1	FLI UF K		7 6	5 %		0 '	• ·	7 ^		
B6.4 LOAD CARRY CAPACITY B6.4 ROUF TRUSS ROOF TRUSS ROOF TRUSS CUT FJR ROOF JAC B6.4 DORABILITY MF4BKANE B6.10 DEFLECTION B6.81 PARTITION MALLS B6.87 PANELING TO WALE SYSTEMS B6.87 PANELING TO WALE FRAMING B6.876.7 FASTENING OF STRUCTURAL SYSTEMS B6.8 ARE ASSEMBLY B.9 TRANSIT CONSIDERATIONS B.1 LUNGITUDINAL MEMBERS TIRES B.5 AXLES B.5 AXLES B.5 AXLES B.6 AXLES B.7 WHEFLS/RIMS B.7 WHEFLS/RIMS B.7 WHEFLS/RIMS B.7 WHEFLS/RIMS B.7 WHATHER RESISTANCE B7.1 UNDERNEATH OF FLOOR SYSTEM			7 7	28.6		9 9	ائد ا	2 <		
B6.4 KOUF TRUSS B6.4 DORABILITY B6.10 DEFLECTION B6.10 DEFLECTION B6.10 DEFLECTION B6.10 DEFLECTION B6.5/6.7 FASTENING OF STRUCTURAL SYSTEMS B6.5 TRANSIT CONSIDERATIONS B1.1 TRANSIT CONSIDERATIONS B1.2 TRANSIT CONSIDERATIONS B1.3 TIRES B1.4 SPRING/SPRING HANGERS B1.5 SPRING/SPRING HANGERS B1.5 SPRING/SPRING HANGERS B1.5 SPRING/SPRING B2.5 SPRING/SPRING B3.5	_	0	5				œ.	S		5
B6.4 DECKING B6.10 DEFLECTION B6.10 DEFLECTION B6.10 DEFLECTION B6.10 DEFLECTION B6.10 DEFLECTION B6.576.7 FASTENING OF STRUCTURAL SYSTEMS B6.576.7 PANELING TO WALL FPAMING B-APP. TRANSIT CONSIDERATIONS B.1 A FRAME ASSEMBLY LUNGITUDINAL MEMBERS LUNGITUDINAL MEMBERS B.5 AXLES B.5 AXLES B.6 AXLES B.7 WHEELS/RIMS B.7 WHEELS/RIMS B.9 BRAKES B.9 BRAKES B.9 BRAKES B7.1 UNDERNEATH OF FLOOR SYSTEM	_	2	4 4	100-0	80.0	2.4	9.	4 4	1.6	9
DURABILITY MEMBRANE B6.10 DEFLECTION B6.10 DECKING B6.57 PARTITION WALLS B6.576.7 PARTITION WALLS B.APP. TRANSIT CONSIDERATIONS B.B APP. TRANSIT CONSIDERATIONS B.B TRANSIT CONSIDERATIONS B.B TRANSIT CONSIDERATIONS B.B TRANSVERS MEMBERS B.S TIRES B.C COUPLING MECHANISM B.P GRAKES B6.7 FLOOR SYSTEMS B6.8 BARKES B6.7 FLOOR SYSTEMS B7.1 UNDERNEATH OF FLOOR SYSTEM				•	0 0		. 2.	-		- 0
MEABRANE B6.10 DEFLECTION B6.10 DEFLECTION B6.11 PARTITION WALLS B6.57 FASTENING OF STRUCTURAL SYSTEM B6.576.7 PANELING TO WALL FPAMING B-APP. TRANSIT CONSIDERATIONS B.1 A FRAME ASSEMBLY LUNGITUDINAL MEMBERS B.3 TIRES TIRES B.4 SPRING/SPRING HANGERS B.5 SPRING/SPRING HANGERS B.7 WHEELS/RIMS B.7 WHEELS/RIMS B.7 WHEELS/RIMS B.7 WHEATHER RESISTANCE B7.1 UNDERNEATH OF FLOOR SYSTEM D. COUPLING MECHANISM B.9 BRAKES B6/B7 FLOOR SYSTEMS B7.1 UNDERNEATH OF FLOOR SYSTEM	_	0	2			1.2	• 3	2		5
B6-10 DEFECTION B6-10 DEFECTION B6-10 DEEKING B6-576-7 FASTENING OF STRUCTURAL SYSTEM B6-576-7 PANFLING TO WALL FPAMING B-APP- TRANSIT CONSIDERATIONS B-1 A FRAME ASSEMBLY LUNGITUDINAL MEMBERS TIRES B-5 AXLES B-4 SPRING/SPRING HANGERS B-5 SPRING/SPRING HANGERS B-7 WHEFLS/RIMS B-7 WHEFLS/RIMS B-7 WHEFLS/RIMS B-7 WHEFLS/RIMS B-7 WHETLS/RIMS B-7 WHETLS			2 -		100.0		_ش ر	2		9 :
B6/B7 B6/B7 B6/B7 B6.5/6.7 FASTENING OF STRUCTURAL SYSTEM B6.5/6.7 PANFLING TO WALL FPAMING B-APP. TRANSIT CONSIDERATIONS B.1 A FRAME ASSEMBLY LUNGITUDINAL MEMBERS B.5 TIRES B.4 SPRING/SPRING HANGERS B.7 WHEFLS/RIMS B.7 WHERS/RIMS	_	0	⊣ –		0.001	0 4	7.	⊣ –		n 4
86.5/6.7 FASTENING OF STRUCTURAL SYSTEM B6.5/6.7 PANELING TO WALL FRAMING B-APP. TRANSIT CONSIDERATIONS B.1 A FRAME ASSEMBLY LUNGITUDINAL MEMBERS LUNGITUDINAL MEMBERS B.5 AXLES B.4 AXLES B.4 SPRING/SPRING HANGERS B.7 WHEFLS/RIMS B.2 COUPLING MECHANISM B.9 BRAKES B6/B7 FLOOR SYSTEMS B7.1 UNDERNEATH OF FLOOR SYSTEM	_	0)	_		9	•	٠,	86		2 4
B-APP. TRANSIT GONSIDERATIONS B-1 A FRAME ASSEMBLY B-1 A FRAME ASSEMBLY B-1 A FRAME ASSEMBLY LUNGITUDINAL MEMBERS TRANSVERSE MEMBERS TRES B-5 AXLES B-4 SPRING/SPRING HANGERS B-7 WHELS/RIMS B-7 WHELS/RIMS B-8 GOUPLING MECHANISM B-9 BRAKES B-7 FLOOR SYSTEMS B-7 UNDERNEATHER RESISTANCE B7-1 UNDERNEATH OF FLOOR SYSTE		(0)	118			00	17.9	86	38.1	S
B.1 A FRAME ASSEMBLY LUNGITUDINAL MEMBERS B.8 TIRES B.4 SPRING/SPRING HANGERS B.7 WHEELS/RIMS B.2 COUPLING MECHANISM B.9 BRAKES B.7 FLOOR SYSTEMS B.7 WEATHER RESISTANCE B7.1 UNDERNEATH OF FLOOR SYSTE		10	_ ~		1 00°C	ွဲ	2 0	ეი ი დ ი	က် င	,0 1
LUNGITUDINAL MEMBERS TRANSVERSE MEMBERS B.5 B.4 AXLES B.4 AXLES B.4 SPRING/SPRING HANGERS B.7 WHEFLS/RIMS B.2 COUPLING MECHANISM B.2 GOODLING MECHANISM B.4 BARKES B.7 FLOOR SYSTEMS B.7.1 WEATHER RESISTANCE B.7.1 UNDERNEATH OF FLOOR SYSTEMS	, _	1+)	57			ဘ	1 20	24	9 9	5
H.B TIRES B.B TIRES B.5 AXLES B.7 AXLES B.7 B.7 WHEFLS/RIMS B.2 COUPLING MECHANISM B.9 BRAKES B.9 BRAKES BA/BT FLOOR SYSTEMS B7.1 UNDERNEATH OF FLOOR SYSTEMS B7.1 UNDERNEATH OF FLOOR SYSTEMS B7.1 UNDERNEATH OF FLOOR SYSTEMS			34		9.69		5.1	34	رب ه	9
ATLES AXLES SPRING/SPRING HANGERS WHEFLS/RIMS COUPLING MECHANISM BRAKES T FLODR SYSTEMS WEATHER RESISTANCE UNDERNEATH OF FLOOR SYSTE			о т о		S.	9	1.4	ه حن		9 1
SPRING/SPRING HANGERS WHE FL S/RIMS COUPLING MECHANISM BRAKES T FLOOR SYSTEMS WEATHER RESISTANCE UNDERNEATH OF FLOOR SYSTE			× -			9	† - - -	ο 4		n ν
WHEFLS/RIMS COUPLING MECHANISM BRAKES T FLODR SYSTEMS WEATHER RESISTANCE UNDERNEATH OF FLOOR SYSTE			- 4				9.) m		ν ω
COUPLING MECHANISM BRAKES T FLOOR SYSTEMS WEATHER RESISTANCE UNDERNEATH OF FLOOR SYSTE			4					9		5
T FLOOR SYSTEMS WEATHER RESISTANCE UNDERNEATH OF FLOOR SYSTE	•	:	٦.			1.2	• 2		4.	in i
WEATHER RESISTANCE UNDERNEATH OF FLOOR SYSTE		7 6	7 7			9	7.	704	•	v <
UNDERNEATH OF FLOOR SYSTE OURABILITY		000	- M			2	5.	ת ה	14.0	r 10
UURABILITY France Courseine			33		100.0	2 。	5.7	30	4.	9
)	?	2.7			-	4.1	19	7.4	ς.
FLOOR COVERING FLOOR COVERING			* 0		33.3	12.2	1.7	70	ν ν. υ •υ	Q 4
97			4		0	51	9.	· 60)	1.2	¢

FOURTH	FOURTH THROUGH EIGHTH LEVEL	1TH LEVEL SUMMATIONS:			NU. 87	TH 361H	%51⊓	84 TH	3RJ	HUMES &	&HUME S	LEVEL
FIIC	я7 з	ü	_	5	ς.				0	2		5
FILE	B 7.3	HOT MATER HEATER COMPARIMENT FLOOR	,		. 50		100.0		10	ın		٥
FDFF	B6.10		_	()	-			0	• 2		0	5
FDFF1	86.10	DECKING					100.0		• 2	-		9
FASS	86.5	OF STRUCTURAL SYST	_	0.0	-			1.4	• 2	1	4, •	2
FASS2.	86.5	AL FKA			1		100.0		• 2	_		0
FLRR	87.4	RUDENT RESISTANCE							0			2
0E X T	86/87/38)	(0	15					15		1
ÐEWR	87.1	WEATHER RESISTANCE - MATER LEAK			30			53.3	1.2	8		ו עו
DEDU		UFABILITY						0	0			5
MONA	86/81/88	SM DQ P. I.M.	_	(?	1.2				0) .		7
A NA	87.1/88.5							100.0	0		0	Ω,
LIDN	B6.5.1	TIEDOWNS	b-specif	0	1				• 2			3
TIDN2.	36.5.1	LOAD CAPACITY			-			100.0	7.	1		C
PL UM	PART C	PLUMBING	J	(0)	2,8					108	42.0	3
			,		1 0				1.		0	
PFIA	6.3	PLUMBING FIXIURES		0 0	1 3 G			α	0 0 x	71		7 5
X144	7.67	TATORES		5 70	4 5		d	0 0	° -	4 4		מ י
TOUS	(9.2.1.5		-	0	26	3	32.1	18.3	2.	24	. 6	7
1011.2	69.2.1.2				21	32.3	2	5 .	ô	14		1
SHRS	69.2.2	SHUWFR STALLS	t-man d	0 0	16		3	•	7	15		9
S HR S 2.	C9 .2 .2 .2	7			10	2	~1	7 .		5		1
SHR S 3.	09-2-2-3	SHOWER/ ENCL			9	37.5	7		2.	٥	?	1
PFGR	C9.1		besid	()	5.7			0	7	35	3.	5
	C 9.1.1	WOALITY OF FIXTURES			2.5		100.0	-	0	w ") (۰۵۰
PRFO	C5.2	PROTECTIVE REQUIREMENT	_	أ	50					45	٠,	7
PKE05.		RUDENT RESISTANCE			34			58.0	9 1	40-	?	U 12
7X H 24 - 2 - 2 - 2 - 2 - 2 - 2 - 2 - 2 - 2	C3.2.4	TREEZING AND MENTING	,	1	0 0			. 7	0 1	7 7	0 1	7
VV TI	C13.5	VENT TERM NAL		5 5	23			000	9.0	10	7.4	. 5
VVTL3.	C13.5.3	VENT CAPS			2.0		100.0	100.0		12		Ç
FIFC	PART	ELFCTRICAL	_	0	15					7.9	20.3	m
2	- 1			1							Ė	
FWOR	E11		•	(2)	16				100.0	69	26.8	t
E WFB	F11.5	FASTENING BOXES, FITTINGS, CABINETS						100.1	200		9	0
HEAT	PART 0	HEATING SYSTEM	_	60	8.5					16	29.6	3
A > dH		PIDING AKATER	-	0.0		 	 		-	0.9	ا ا ا	·\$
HGPS	05.1	GAS PIPING SYSTEMS		50				00	1	69		^
PGPG	05.1.1	GENERAL	_	(2)			100.0	100.0	1.	09	3	9
HGPG1.	05-1-1-1	RODENT RESISTANCE				199.0	.00	30.	-	0 9	÷.	1
HAPL	90		 .	3					ů:	22		4
HAINI	1)6.3	INSTALLATION OF APPLIANCES MINITAL OCATION OF FURNACE THERMOSTAT	_	5	24		1.001	0.001	28.2	22	0 ° 0	n 0
					j					,)	
* * * * * * * * * * * * * * * * * * *	NI LOOX	据建筑建设部等条件设置计算设置设置设置设置设置设置设置设置设置设置设置设置设置设置设置设置设置设置	* * * * * * * * * * * * * * * * * * * *	* * * * * * * * * * * * * * * * * * * *	934 934 ******	***	* * * * * * * * * * * * * * * * * * *	* * * * * * * * * * * * * * * * * * * *	* * * * * * * * * * * * * * * * * * *	1691	0.50	2 ****
NCON	CONSTRUCT! ON	NO II	bend	0	550					143	55.0	3
					i.						İ	-
NC XD	EXTERI	EXTERIUR DOORS	_	431	547				7 ** 7	16	37.7	*

LEVEL	១៣១៤៤៣៤	ጥ 4 20 40 40 40 4	. 4 ለ ለ 4 4 ለ ለ 4 3	w \$ 4 m 4 m		* * * * * * * * * * * * * * * * * * *
%HUMES			10.5 2.3 10.1 5.8 7.7 7.3		100.00 100.00 100.00 100.00 100.00 100.00 100.00	
HUMES	10 10 10 10	266 266 115 117 114	7	000 00 4 4	₩₩₩₩₩₩₩₩₩₩₩₩₩₩₩₩₩₩₩₩₩₩₩₩₩₩₩₩₩₩₩₩₩₩₩₩₩	2 C C C C C C C C C C C C C C C C C C C
#3RD	22.0 0.93 3.5 1.8	22.22 6.12 3.53 2.12 1.60	13227337	2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2	0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0	
H1 5%	49.6 15.0 7.4 4.1 2.9	30.3 15.6 15.6 12.3	1-12 v4 w	10.ŭ 92.3		25.9
451н					28.1 31.0 20.7 3.4 57.1	52 66 9
% o TH						
\$7TH						
0.0	121 38 19 10 7	162 19 19 15 15 15	199 199 199 115 120 200 9	2 13 12 7 4 4 216	20 20 20 20 20 20 20 20 20 20 20 20 20 2	111 4 4 4 4 4 4 4 4 4 8 8 8 8 2 2 2 2 2 2 2
		23)	0) 0)	1)	131	3)
		<u> </u>		<u> </u>		
**					1	
FOURTH THROUGH EIGHTH LEVEL SUMMATIONS:	HARDWARE IMPROPER FIT STORM REGLAZED FROZEN CANDPY	SCREENS WINDOWS FFGLAZED HARDWARE STURM I MPROPER FIT SCREENS EXTERING	PARTITIONS DOOKS HARDWARE IMPROPER FIT SKIRTING COMPARTMENT DOOR INSULATION LEVELING	RACKING UF DURKS FLGOR HEATING DUCT VENT SITE GRADING TIE DOWN STRAPS LOUSF, ETC	EXTERIUR EXTERIUR FIXTUERS KITCHEN SINK FAUCET ASSEMBLY CLOGGED DRAIN FLANGE SEAL TOILFTS CLOGGED DRAIN FLUSH TANK	TOTLET SEAT LAVORATOR IES CLOGGED DAAIN FAUCET AS SEMBLY BATHTUB WITH SHOWFRHEAD CLUGGED DRAIN FAUCET AS SEMBLY SEWER ELECTRICAL DISTRIBUTION PANEL BOARD FUSES

LEVEL	000000000000000000000000000000000000000	m tttnttc	1		***************************************
HOMES	3.1 10.1 9.3 6.2 1.2	1	7°8 7°8 3°1 441°2 441°2 30°0	11 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2	01 L1 1 1
HUMES %F	2 2 4 4 5 5 8 8 2 3 3 4 4 5 5 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8	2 1 1 2 1 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2	2 0 8 8 8 8 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4		
Q	2200110	01100400	# # # # # # # # # # # # # # # # # # #	1 + 1 0 + 1 0 0 0 0 1 0 0	0001170005000172-
1 & 3K	2 6 6 6 6 6 6 6 6 6 6 6 6 6 6 6 6 6 6 6	-	52°. 72°. 10°. * * * * * * * * * * * * * * * * * * *	22 24 19 19 19 19 19 19 19 19 19 19	65 155 155 155 155 155 155 155 155 155 1
F4 TH	14. 9. 76. 78.	4 4		4 5 5 5 5 5 5 5 5 5 5 5 5 5 5 5 5 5 5 5	25.
455TH	36.7 13.0	100.0		9.00 0.00 0.00 0.00 0.00	, , ,
H199				,	
47 TH			# # # # # # # # # # #		
. OK	N 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2	187 1 187 1 4	23	33.40 100 80 97.00 100 100 100 100 100 100 100 100 100 1	7 7 7 7 7 7 7 7 7 7 7 7 7 7 7 7 7 7 7 7
	1)	(9 (7 (7)	7 + + + + + + + + + + + + + + + + + + +	20 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2
			1 # #		
**			1 ANCE	.	TF D
SUMMA TI ONS		U. RES	ERS ERS ERS ERS ERS ERS ERS ERS ERS ERS	RONIC IGNITION TLOT S VALVE OUTON IITCH WIKING EMERGENCY SWITCH	GAS LEAK 22LE / ORIFICE 22LE / ORIFICE WRONG INITIALLY INSTALLED 01L LEAK THERMOSTAT ANSFORMER ARNOR ARINGS TOR MUUNT FR REGULATUR SUPPLY CONNECTION SUPPLY CONNECTION
SUMM	s si	L. CL (FELINE TTE LIGHT (NG FIXTURE	GAS SUPPLY PIPING INSTALLED SPACE HEATER OIL SUPPLT PIPING ***********************************	PILUT/ELECTRONIC IGNITION RELIGHT PILOT CONTROLS BURNEK CONTROLS VALVE THERMOCOUPLE RESET BUTTON BLOWER LIMIT SWITCH INTERNAL WIKING UN/OFF EMERGENCY SWIT	AS LEAK AS LEAK AS LEAK AS LEAK RONG INITIALLY IN IL LEAK IHERMOSTAT NSFORMER RINGS OR MUUNT R ASSEMBLY R ASSEMBLY R ASSEMBLY E DUORS EGULATUR SUPPLY CONNECTION
LEVEL	BREAKEFS OUTLETS APE FIXRURE R	HT FI	PIPING SPACE H PING PING H PING H PING PILOT OLS VALV OCHUPLE BUTTUN SWITCH L WIKING	T LEAK E / OR IFICE ONG INITIALL LEAK HERMOSTAT FORMER MOTOR NGS ADUNT ASSEMBLY ASSEMBLY ASSEMBLY ASSEMBLY INDUNKS CONNEC	
ІСНТН	USTAT USTAT EPTICAL UNILET UT DGOR HEAT TAPE LIGHT FIXEURE LIGHT FIXEURE	FACEPLATE TICHES FACEPLATE FACEPLATE FACEPLATE FERTOR LIG KVICE ATTING	SUPPLY PIPING SUPPLY PIPING SUPPLT PIPING ************************************	LUTZELECTRONIC I RELIGHT PILOT INTROLS BURNER CONTROLS VALVE THERMOCOUPLE RESET BUTTON BLOWER LIMIT SWITCH INTERNAL WIRING ONVOFF EMERGEN	PUEL GON NO ZALE / OR 1F WRONG INITI OIL LEAK NALL THERMOSTAT TRANSFORMER BLOWER MOTOR BEARINGS MOTOR MOUNT FILTER BLOWER ASSEMBLY BLOWER ASSEMBLY FUNER ASSEMBLY FUNER ASSEMBLY FUNER ASSEMBLY FUNER ASSEMBLY FUNER ASSEMBLY FURER SUPPLY CON
UGH E	CIRCU(T BREAKEFS FUSTAT RECEPTICAL UUILETS UUT DCOR HEAT TAPE LIGHT FIXEURE INTERIOR	FACEPLATE POWER PULE/L(FELINE SWITCHES FACEPLATE EXTERIOR LIGHT(NG FIXTURE SERVICE	GAS SUPPLY PIPING INSTALLED SPACE HEATERS OIL SUPPLY PIPING ***********************************	PILUT/EL RELIGH CONTROLS BURNE BURNE CONT THER RESE BLOWER LIMIT INTERN	MALL THE BEAR HOTTON FILLER BUNDER FUEL SEEF
HX.O	~		* * *		
-			* *	1. 1	
FOURTH THROUGH EIGHTH LEVEL	NECE NEDI NERC NERC NEKD NEHT	N N N N N N N N N N N N N N N N N N N	NHGP GAS SUPPLY PIPING NHSP INSTALLED SPACE HEATERS NHOP OIL SUPPLY PIPING ***********************************	AFPL AFFL AFFU AFFU AFFC AFFC AFFC AFFS AFFS AFFS	AFFICAFFA AFFA AFFA AFFA AFFA AFFA AFFA

	>	FIELD SA	SAMPLE DATA	×.							
FOURTH 1	FOURTH THROUGH EIGHTH LEVEL SUMMATIONS:		O Z	* 47TH	%0TH	451H	44 TH	%3R∪	HUMES	&HOME S	LEVEL
AHWM	HOT WATER HEATERS	(28	0	2					26	20.5	ed
AHEL	ELECTRIC HOT MATER HEATER	1)	7.1 4	6				52.4	29	11.3	4
AHEH	HFAT ELEMENT			6				11.0	æ :		Ċ.
AHEC	CONTROLS DESCRIPTION	_	(o :		4	14.0	n 0	A r	1.9	ر ۷
AHEM	THE STATE OF THE S			t ^		3.5		2.6	٠	•	o 4
AHER	PRESSURE RELIEF VALVE			ر ک)		1.9	ייני		2
AHTK		_	0)	3				3.7	M	1.2	5
AHTE	LEAK			3		100.0		3.7	9		Ó
AHEP	PRESSURE REGULATOR	,		ب				3.7	3	1.2	S
AHGS	GAS HOT WATER HEATER		2) 1	~ \				13.4	J (3.5	+ (
AHPL		_		4		(4.9	2 :		٠ ک
AHPR	DOESSIDE DELICE VALVE			2 د		50.0	18.2	2.4	7 0	ب م	9 4
AHCI	777	_	0	n ~				7.4	n (c
AHCT	THERMOSTAT			2		100.0		2.4	2		9
ARGE	RANGF - GAS/ELECTRIC	- T	11) 7	2					36	14.0	Э
ARPL	P11.01	_	3) 1	9				5.	16	6.2	1 4
ARPR1.	PELIGHT PILOT		1	5			83.3	20.8	13	5.1	ī
ARGL	GAS LEAK		ו					3.	14	5.4	4
ARCL	CENTROLS	_	7 17	7				Š	10	3.0	4
AROB	OVEN BURNER			4			36.4	5.6	4	1.6	ıΩ.
AKSB	VORTACE BURNER			0.6			٠,	7.4	חר	7.1	n 1
T 7 7 7	PIPMES		-	7			ů	0 * 7	7		Λ .
APAV	DURNER	-		ם ת			C	0 ° 0	חת	1.5	3 * 10
ARBS	SURFACE) (m			50.0	4.2	~	J 30	J -D
AKIW	INTERNAL WIKING			9				8.3	2		7
ARHW	HARDWARE	_	0)	٤				4.2	3		4
ARHO	OVEN DOORS			~1			100.0	7.4	M		5
AEFX	EXHAUST FAN		2	5	1				14	5.4	3
ACRF	REFRIGERATOR	_	9) 1	0					5	υ. Φ•	m
ACRL	CONTROLS FAN	_	3				130.0	10.0		4 4	4 5
ASDE	SMUKE DECTOR			æ					ſť	2.7	(T
										• i	
AFEB	ELECTRIC BASEBOARD HEATING UNITS	-	1,	1	 	 			1	4	3

U.S. DEPT. OF COMM. BIBLIOGRAPHIC DATA	1. TOBLICATION ON RELIGION ON RELIGION			3. Recipient's Accession No.		
4. TITLE AND SUBTITLE	1 11000		5. Publication	n Date		
4. THE AND SUBTILE						
PERFORMANCE OF MOBILE HOMES - SUMMARY REPORT				1 1976		
				6. Performing Organization Code		
7. AUTHOR(S)			8 Performin	g Organ. Report No.		
J. H. Pielert, W. E. Greene, Jr., L. F. Skoda, W. G. Street				g organi. Report No.		
9. PERFORMING ORGANIZAT	ION NAME AND ADDRESS		10. Project/	Task/Work Unit No.		
	BUREAU OF STANDARDS		11. Contract	Grant No.		
	N, D.C. 20234					
	, 5101 20201					
12. Sponsoring Organization Na	me and Complete Address (Street, City,	State, ZIP)	13. Type of !	Report & Period		
	elopment and Research	,	Covered	*		
_	Building Technology and Sta	ndards		Final		
Department of Housing and Urban Development				ng Agency Code		
Washington, D.C. 20	_		· ** oponsorn	ig rigelity code		
15. SUPPLEMENTARY NOTES						
	less factual summary of most significant	information. If documer	nt includes a s	ignificant		
bibliography or literature su	rvey, mention it here.)					
This project was fun	ded at the National Bureau	of Standards tr	the Depart	tment of		
	velopment with the objectiv					
	g them to possible inadequa					
Mobile Homes and the	mobile home enforcement pr	ocess. Addition	ally, the	durability of		
	ts was a study objective fo					
	home performance data were					
categorized and rela	ted to the project objectiv	es. This summar	y report i	is the last		
of a series of four	project reports. It docume	nts the project	approach,	results of		
the various tasks, a	nd presents conclusions and	recommendations	. This wa	as a problem		
oriented study and d	id not attempt to document	the many areas o	f satisfac	ctory mobile		
home performance.						
17 4514 740 7 7 0						
17. KEY WORDS (six to twelve	entries; alphabetical order; capitalize on	ly the first letter or the	first key word	unless a proper		
name; separated by semicolo		D				
Mobile Homes: Mobile	Construction; Enforcement	Process; Housing	; Hurrican	ne Agnes;		
liobite nomes, nobite	Home Parks; Performance Da	ta; Regulatory P	rocess; St	andards		
		110		T01 110 0 = 5 : 5		
18. AVAILABILITY	Unlimited	19. SECURIT (THIS RE		21. NO. OF PAGES		
		(THIS RE	. (1)			
X For Official Distribution	n. Do Not Release to NTIS	711107	WELER.	7.00		
		UNCL ASS	IF IED	142		
Order From Sup. of Doc., U.S. Government Printing Office Washington D. C. 20402 SD Car. No. Cl.2				22. Price		
Washington, D.C. 20402, SD Cat. No. C13 (THIS PAGE)						
Order From National Te Springfield, Virginia 221	chnical Information Service (NTIS)	UNCLASS	IFIFD			
		ONCLASS	AL ALLU			